



**Insurer Reference: SNH8716H**  
**Repairer Reference: M7213/SNH8716H**  
**Date calculated: 06/03/2023 2:30 PM**

**Full Report**  
**Registration: SNH8716H**  
**Printed: 06/03/2023 2:30 PM**

## Summary Information

<b>Claim</b>			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Alywin Yeo	Currency:	SGD
Claim Reference:	SNH8716H	Date of Incident:	19/12/22
Estimated Repair Time:	8	Hire Car Start:	
Actual Repair Days:		Hire Car End:	

## Vehicle Details

### Vehicle

Manufacturer:	MERCEDES-BENZ
Model:	CLA (C118)
Sub Model:	CLA 250
Model Sheet Number:	03 L7 55
Registration:	SNH8716H
VIN number:	W1K1183462N196376
Odometer:	

### Model Specs

FROM VIN N195603	DYNAMIC SELECT	ILLUMINAT AMBIENTE	INNER HEADLINING
SPORT S-WHEEL LEATH	MODIFICAT PACK 20/2	MODEL 2021	DR MIRROR GPS AERIAL
REINFORCED BRAKE	AIR CON THERMATIC	CRUISE CONTROL	ERM BRAKE ASSIST
DISTRONIC PLUS	REMOTE CONT 315MHZ	TOUCHPAD	HEADUNIT ASIA
CONNECT 20 MID	DIGITAL INSTRUMENTS	MEDIA DISPLAY	LIGHT-/VIEW PACKAGE
FOLDING REAR SEAT	MICROFIBRE PAD	AMG LINE	DOUBLE CUP HOLDER
ELEC FOLD DR MIRRORS	OUT/IN MIRR AUTO DIM	DRIVER SEAT MEMORY	PASS SEAT MEMORY
LUMBAR SUPPORT	MIRROR PACKAGE	SEAT COMFORT PACKAGE	SUN VISOR SPEC FUNC
EMERGENCY SYSTEM	MOBILE KOM-MODUL LTE	REARVIEW CAMERA	ACTIVE CARBON FILTER
MOTOR NOISE SPEAKER	EXHAUST WITH OPF GEN	KEYLESS GO	POWER- YST EURO 6D
7-SPEED AUTOMATIK	COMFORT SUSPENSION	TYRES 225/45 WR 18	WHEELS 7.5J X 18 ALU
HANDS-FREE ACCESS	PANORAMIC ROOF	PARKTRONIC	COMPRESSOR VARIABLE
AMG STYLING	PARK PACK	TWO COAT METALLIC	PREPARE OFF VEHICLE
REFRIGERANT R1234YF	CLEAR COAT HARD	SHIF-PADDLE STRG CHR	

## Vehicle Condition


### Vehicle Status

Pre-Accident Damage:

Date of Inspection:

### Damage Areas

All ☐  
Underbody ☐

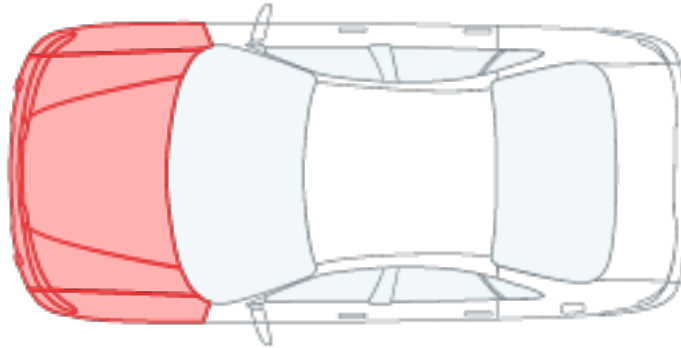

### Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	----------------------------	---------------------------	---------------------------	----------------------------	----------------------------	-----------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

### Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
54-1011 01	SHORT TEST INCLUDES: CONNECT + DISCONNECT STAR DIAGNOSIS, PRINT DATA, DELETE ERROR MEMORY		3.0	12.60
88-1102 01	R + R FRONT BUMPER CPL		9.0	37.80
88-1319 01	ADD FOR R + R FRONT BUMPER (VEHICLE WITH PARKTRONIC)		1.0	4.20
88-1133 01	DIS + ASS FRONT BUMPER (BUMPER REMOVED) AFTER CHECK: RENEW PARTS IF NECESSARY		17.0	71.40
88-1360 01	ADDITION TO DIS + ASS FRONT BUMPER (VEHICLE WITH PARK ASSISTANT)		3.0	12.60
88-1361 01	ADDITION TO DIS + ASS FRONT BUMPER (VEHICLE WITH DISTRONIC PLUS)		2.0	8.40
88-1933 01	ADDITION TO R + R FRONT BUMPER (VEHICLE WITH COLLISION WARN SYS)		1.0	4.20
88-1162 01	ADDITION TO DIS + ASS FRONT BUMPER		1.0	4.20

Code	Description	WU	Price SGD
	(VEHICLE WITH ACTIVE BRAKE ASSIST)		
82-4800 01)	RENEW RIGHT HEADLAMP	2.0	8.40
88-3956 01	RENEW R/FR WING (BUMPER REMOVED/DETACHED) INCLUDES: R/F WHEELHOUSE COVER CPL REMOVE AND REFIT	12.0	50.40
30-4210 01	ADJUST DISTRONIC CONTROL UNIT	2.0	8.40
82-1110 01	ADJUST HEADLAMPS	3.0	12.60
0471	BONNET REPAIR	15.0*	63.00
0741	L/F WING REPAIR	5.0*	21.00
1482	RIGHT FRONT DOOR REPAIR	5.0*	21.00
<b>Labour Cost</b>		<b>Hrs</b>	<b>WU</b>
<b>Panel / Mechanical Labour</b>		<b>8.10</b>	<b>81.0</b>
<b>Total of Labour</b>			<b>340.20</b>

## Paint

Paint Work		Time Basis 10 WU/h	
Code	Description - CLEAR COAT HARD	WU	Price SGD
98-1682 ZAX	FRONT BUMPER TRIM PAINTING	9.0	37.80
98-2615 01	R/F WING PAINTING STAGE I-M	7.0	29.40
98-2807 01	BONNET PAINTING STAGE III	19.0	79.80
98-2417 01	L/F WING PAINTING STAGE III	9.0	37.80
98-4317 01	RIGHT FRONT DOOR PAINTING STAGE III	13.0	54.60
L 2242	R/OUTER A-PILLAR PAINTING STAGE II	7.0	29.40
98-1340 01	PREPARATION WORK FOR TWO COAT PAINTING OF FITTED BODY PARTS	14.0	58.80

<b>Total Paint</b>	<b>Hrs</b> <b>7.80</b>	<b>WU</b> <b>78.0</b>	<b>Price SGD</b> <b>327.60</b>
--------------------	---------------------------	--------------------------	-----------------------------------

<b>Material Cost - Paint</b>	<b>Price SGD</b>
Repair Painting	92.73
Surface-/Blend Paint	9.72
New Part Painting (Bold)	82.50
Material-constant Metal	13.47
<b>Total</b>	<b>198.42</b>

## Spare Parts

				prices as at 2015-06-01
Code	Description	Part Number	Part Source	Price SGD
0283	FRONT BUMPER TRIM	118 880 8700 9999	Original	1,310.00
0405	FRONT GRILLE	118 880 0802	Original	670.00
0858	R/COVER LID	247 691 0500	Original	0.00
0304	R/F BUMPER GRILLE	118 885 4401	Original	80.00
0742	R/F WING	118 881 0400	Original	650.00
0562	RIGHT HEADLAMP ASSY	118 906 2200	Original	2,305.00

f: OEM Parts	<b>Savings</b>	<b>0.00</b>
n: Non-OEM Parts		
u: Used parts		

<b>Subtotal</b>	<b>5,015.00</b>
<b>Total</b>	<b>5,015.00</b>

### Extras

Code	Description	Price SGD
1000	SUNDRIES	85.00*
	<b>Total Extras</b>	<b>85.00</b>

### Final Calculation

	SGD	SGD
<b>Parts</b>	5,015.00	
<b>Total Parts</b>		<b>5,015.00</b>
<b>Labour Time Base 10 WU/h</b>		
Total 81.0 WU X 42.00 SGD/h	340.20	
<b>Total of Labour</b>		<b>340.20</b>
<b>Total Of Extras</b>		<b>85.00</b>
<b>Paint Work Time Base 10 WU/h</b>		
Labour Cost 78.0 WU X 42.00 SGD/h	327.60	
Material Cost	198.42	
<b>Total Paint Including Material</b>		<b>526.02</b>
<b>Repair Cost Excludes GST</b>		<b>5,966.22</b>
GST (+8.0%)		<b>477.30</b>
<b>Repair Cost Included GST</b>		<b>6,443.52</b>

### Comments

\* - USER SUPPLIED DATA  
 NN - NO MANUFACTURERS CODE EXISTS  
 ) - WU PARTIAL INCL IN OTHER POSITIONS

### Assessment Note

No assessment notes entered.