

Auto Insure Pte. Ltd
6 Marsiling Lane
739145



Insurer Reference: SNH8716H
Repairer Reference: M7213/SNH8716H
Date calculated: 22/12/2022 5:02 PM

Full Report
Registration: SNH8716H
Printed: 22/12/2022 5:02 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Loh Chen Khuan	Currency:	SGD
Claim Reference:	SNH8716H	Date of Incident:	19/12/22
Estimated Repair Time:	8	Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	MERCEDES-BENZ
Model:	CLA (C118)
Sub Model:	CLA 250
Model Sheet Number:	03 L7 55
Registration:	SNH8716H
VIN number:	W1K1183462N196376
Odometer:	

Model Specs

FROM VIN N195603	DYNAMIC SELECT	ILLUMINAT AMBIENTE	INNER HEADLINING
SPORT S-WHEEL LEATH	MODIFICAT PACK 20/2	MODEL 2021	DR MIRROR GPS AERIAL
REINFORCED BRAKE	AIR CON THERMATIC	CRUISE CONTROL	ERM BRAKE ASSIST
DISTRONIC PLUS	REMOTE CONT 315MHZ	TOUCHPAD	HEADUNIT ASIA
CONNECT 20 MID	DIGITAL INSTRUMENTS	MEDIA DISPLAY	LIGHT-/VIEW PACKAGE
FOLDING REAR SEAT	MICROFIBRE PAD	AMG LINE	DOUBLE CUP HOLDER
ELEC FOLD DR MIRRORS	OUT/IN MIRR AUTO DIM	DRIVER SEAT MEMORY	PASS SEAT MEMORY
LUMBAR SUPPORT	MIRROR PACKAGE	SEAT COMFORT PACKAGE	SUN VISOR SPEC FUNC
EMERGENCY SYSTEM	MOBILE KOM-MODUL LTE	REARVIEW CAMERA	ACTIVE CARBON FILTER
MOTOR NOISE SPEAKER	EXHAUST WITH OPF GEN	KEYLESS GO	POWER- YST EURO 6D
7-SPEED AUTOMATIK	COMFORT SUSPENSION	TYRES 225/45 WR 18	WHEELS 7.5J X 18 ALU
HANDS-FREE ACCESS	PANORAMIC ROOF	PARKTRONIC	COMPRESSOR VARIABLE
AMG STYLING	PARK PACK	TWO COAT METALLIC	PREPARE OFF VEHICLE
REFRIGERANT R1234YF	CLEAR COAT HARD	SHIF-PADDLE STRG CHR	

Excess \$2500
Not Authorized.

Gene Riq

6 Days.

part by mt.

23/12/22

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damage before/after resurvey
- Participate in dispute resolution
- To provide a written estimate on "reproduce" basis
- No work to be done without written approval
- Summary of work to be done, resurveyed and is subject to approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Vehicle Condition

Vehicle Status

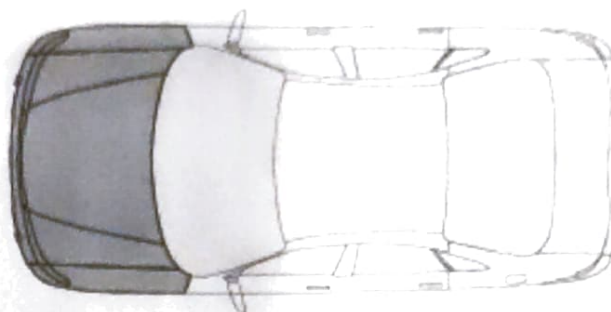
Pre-Accident Damage:

Date of Inspection:

Damage Areas

All

Underbody

☐
☐


Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	-------------------------	------------------------	------------------------	-------------------------	-------------------------	--------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
54-1011 01	SHORT TEST INCLUDES: CONNECT + DISCONNECT STAR DIAGNOSIS, PRINT DATA, DELETE ERROR MEMORY		3.0	12.60
54-7989 01	R + R BATTERY EARTH CABLE (WHEN DISCONNECTING ELECTRIC PLUG AND SOCKET CONNECTIONS)		2.0	8.40
88-2531 01	REPAIR OF R/FRONT-END DAMAGE INCLUDES: RENEW BUMPER, BONNET, RADIATOR COVER, FRONT WING AND FRONT LAMP UNIT, CONVERT ATTACHED PARTS, RENEW IF NECESSARY		43.0	180.60
88-1319 01	ADD FOR R + R FRONT BUMPER (VEHICLE WITH PARKTRONIC)		1.0	4.20
88-1360 01	ADDITION TO DIS + ASS FRONT BUMPER (VEHICLE WITH PARK ASSISTANT)		3.0	12.60
88-1361 01	ADDITION TO DIS + ASS FRONT BUMPER		2.0	8.40

Code	Description	WU	Price SGD
88-1933 01	(VEHICLE WITH DISTRONIC PLUS) ADDITION TO R + R FRONT BUMPER	1.0	4.20
88-1162 01	(VEHICLE WITH COLLISION WARN SYS) ADDITION TO DIS + ASS FRONT BUMPER	1.0	4.20
60-1331 01	(VEHICLE WITH ACTIVE BRAKE ASSIST) ATTACHED PARTS IN ENGINE COMPART R + R FOR RENEWAL OF THE FRONT MODULE INCLUDES: ALL ATTACHED PARTS IN REPAIR AREA REMOVE AND REFIT	10.0	42.00
62-1279 01	REPLACE INTEGRAL CARRIER (STRIPPED) INCLUDES: STRUT BETWEEN INTEGRAL CARR- IER AND RADIATOR CARRIER R + R	9.0	37.80
30-4210 01	ADJUST DISTRONIC CONTROL UNIT	2.0	8.40
0741	L/F WING REPAIR	5.0*	21.00
1482	RIGHT FRONT DOOR REPAIR	5.0*	21.00
Labour Cost		Hrs	WU
Panel / Mechanical Labour		8.70	87.0
Total of Labour			365.40

Paint

Paint Work		Time Basis 10 WU/h	
Code	Description - CLEAR COAT HARD	WU	Price SGD
98-1682 ZAX	FRONT BUMPER TRIM PAINTING	9.0	37.80
98-1710 ZAX	R/F SIDE SPOILER PAINTING	1.0	4.20
98-1710 ZAX	R/F OUTER SENSOR PAINTING	1.0	4.20
98-2805 01	BONNET PAINTING STAGE I-M	22.0	92.40
98-2615 01	R/F WING PAINTING STAGE I-M	7.0	29.40
98-2417 01	L/F WING PAINTING STAGE III	9.0	37.80
98-4317 01	RIGHT FRONT DOOR PAINTING STAGE III	13.0	54.60
L 2242	R/OUTER A-PILLAR PAINTING STAGE II	7.0	29.40
98-1340 01	PREPARATION WORK FOR TWO COAT PAINTING OF FITTED BODY PARTS	14.0	58.80
Total Paint		Hrs 8.30	WU 83.0
			Price SGD 348.60

Material Cost - Paint

Repair Painting	40.26
Surface-/Blend Paint	9.72
New Part Painting (Bold)	163.50
Material-constant Metal	13.47
Total	226.95

Spare Parts

				prices as at 2015-06-01
Code	Description	Part Number	Part Source	Price SGD
0471	BONNET <i>X Repair</i>	118 880 4700	Original	1,660.00
0515	BONNET LOCK	177 880 3000	Original	110.00

Code	Description	Part Number	Part Source	Price SGD
0930	CTR FRT REINF ?	177 620 8000	Original	460.00
0283	CRA / FRONT BUMPER TRIM	118 880 8700	9999Original	1,310.00
0405	WOT / FRONT GRILLE	118 880 0802	Original	670.00
0336	FRONT IMPACT DAMPER	118 880 1902	Original	120.00
0340	? FRT BUMPER C-MEMBER	118 885 4500	Original	135.00
0305	? LWR BUMPER GRILLE	177 885 9100	Original	240.00
0346	MIG / R/BUMPER COVER	118 885 4801	Original	45.00
0304	WOT / R/F BUMPER GRILLE	118 885 4401	Original	80.00
0316	? R/F INN BUMPER BRKT	118 885 3601	Original	95.00
0328	? R/F LWR BUMPER TRIM	118 885 5401	Original	25.00
0362	WOT / R/F OUTER SENSOR	000 905 5604	9999Original	175.00
0314	? R/F SIDE SPOILER	118 885 5201	9999Original	70.00
0342	? R/F UPP BUMPER BRKT	118 885 5000	Original	65.00
0842	? R/F W-HOUSE FRT CVR	118 690 0201	Original	180.00
0840	? R/F W-HOUSE INN CVR	118 690 5001	Original	25.00
0742	P/S / R/F WING	118 881 0400	Original	650.00
0746	? R/F WING COVER	118 889 0100	Original	80.00
0748	? R/F WING INSULATOR	118 885 4400	Original	40.00
0562	P/S / RIGHT HEADLAMP ASSY	118 906 2200	Original	1,320.00
f: OEM Parts				
n: Non-OEM Parts				
u: Used parts				
Savings				0.00
Subtotal				7,555.00
Total				7,555.00

Extras

Code	Description	Price SGD
1000	SUNDRIES	85.00*
	Total Extras	85.00

Final Calculation

	SGD	SGD
Parts		
Total Parts	7,555.00	7,555.00
Labour Time Base 10 WU/h		
Total 87.0 WU X 42.00 SGD/h		
Total of Labour	365.40	365.40
Total Of Extras		85.00
Paint Work Time Base 10 WU/h		
Labour Cost 83.0 WU X 42.00 SGD/h		
Material Cost	348.60	
Total Paint Including Material	226.95	575.55
Repair Cost Excludes GST		8,580.95
GST (+7.0%)		600.67
Repair Cost Included GST		9,181.62

1978

Comments

* - USER SUPPLIED DATA

NN - NO MANUFACTURERS CODE EXISTS

) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.