

(08/11/13) Wef

ASS. REC. BY: Pasun

REF:

CS/CT122012975/Rgp3

894R

ASSIGNMENT

From:

Date:

Estimated Cost:

Veh No:

SMN 89760

Yr Regn:

2017 / May

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SMN 89760

Make:

SUZUKI SX4 S-CROSS 1.6 92cc 1586

at Workshop m/s

PREMIUM

Colour:

BROWN

A/C:

Insured / Std / NI / NA

of

24, 1st floor, second

Sp. Reading

133887

T/Radio:

Insured / Std / NI / NA

Insured:

CTI

Eng/No:

Policy No.

C/No:

BMJYB22S004/1795

Claims No.

Gen. Cond: Good / Fair / Poor / Burnt

Sum Insured:

Excess:

Steering: In order / Jammed / Leaked / Burnt or

(Client's Record)


Brake: In order / Jammed / Leaked / Burnt or

Make of Veh:

Modi: Nil / S/Rim / STD A/Rim or

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

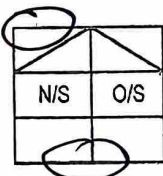

Bal. or Market Value:

66K

Tyre Size:

F:

215/50R17

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

GITI

Front

Rear

R/Bal.

6

mm

R/Bal.

6

mm

L/Bal.

6

mm

L/Bal.

6

mm

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

days

Res.: Yes or No

Lum Sum:

%

3 Val.: Yes or No.

D.O.A.

27/12/22

D.O.I.

03/01/23

Survey held at

PREMIUM

CA / REV / REP. / 24 HRS

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

FRONT & REAR

Date:

Person Contacted:

Vehicle: IN / OUT

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

REPAIR LIMIT - 28K

TOTAL LOSS

03/02/23 Submit Uneconomical Total Loss report

Date/Time, File Pass to?

☐

: Prel. Report

1) 03/02 Typist

☐

: Final Report

Date/Time, File Return to?

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

2)

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech. Invs (\$

☐

: Weekend (\$

) \$ + RS \$

) Photos

) Others

Report Format :

Lump Sum / I.B.I. (\$

TOTAL

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATE : ACCIDENT REPAIRS
WORKSHOP : UBI ROAD 1
CONTACT NO : 6366 2323
FAX NO : 6841 1183
REFERENCE : PA/TP/1170/2022/EQ
DATE : 29-Dec-22
WIP : 56974

VEHICLE IN WORKSHOP. KINDLY ARRANGE FOR SURVEY ON 3/1/2023

YOUR INSURED VEH NO : SJG 8176 T

China Taiping Insurance (S) Pte Ltd

3 Anson Road

#16-00 Springleaf Tower

Singapore 079909

Attn: Motor Claims Dept

OWNER'S NAME : M/S ULTRATEST MARINE SERVICES PTE LTD
ADDRESS : 441A BUKIT BATOK WEST AVENUE 8
#11-881
SINGAPORE 651441
TELEPHONE : HP +65 97296323
TYPE OF CLAIM : THIRD PARTY CLAIM
POLICY NO : SI22V15393/VPE/R03
VEHICLE NO : **SMN 8976 D**
MODEL CODE : SUZUKI SX4
MODEL YEAR : 23/5/2017
ENGINE NO : M16A2014413
CHASSIS NO : TSMYB22S00411795
MILEAGE : -
DATE IN : -
ESTIMATED BY : JOHNNY BOO / ALLAN WU
ACCIDENT DATE : 27-Dec-22
PLACE OF ACCIDENT : PIE TOWARDS TUAS NEAR THOMSON EXIT

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SMN 8976 D - FRONT

S/N	NATURE OF JOBS	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
1	TO REMOVE, CHECK AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT WASHER ASSY.	S/N \$ 280.00 ✓	
2	TO REMOVE AND TRANSFER BOTH HEADLIGHT'S CONTROL UNIT AND POWER MODULE.	S/N \$ 400.00 X	
3	TO REMOVE AND RENEW AIRCON CONDENSER, ADDITIONAL RADIATOR AND RADIATOR. CHECK ELECTRICAL FANS AND CONTROL UNIT. PRESSURISE COOLING SYSTEM. TO CARRY OUT VACUUM AND REGAS.	S/N \$ 1,600.00 ?	
4	TO REMOVE CENTER CONSOLE, INSTRUMENT PANELS AND CLUSTERS. RENEW DASHBOARD, BOTH FRONTAL AIRBAGS, SLIP RING. TRANSFER OLD FITTINGS. RENEW SEAT BELTS AND CONTROL UNIT.	S/N \$ 2,800.00 ✓	
5	TO REMOVE AND REINSTALL LHS FRONT DOOR PANEL TRIM. TO REMOVE AND REINSTALL LHS WING MIRROR ASSY TO FACILITATE RESPRAY OF LHS FRONT DOOR.	S/N \$ 280.00 X	
6	TO RENEW FRONT WINDSCREEN.	S/N \$ 480.00 ✓	
TOTAL LABOUR CHARGES - FRONT		: \$ 5,840.00	

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SMN 8976 D - FRONT

S/N	NATURE OF JOBS	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
7	TO INSTALL SOLAR FILM FOR FRONT WINDSCREEN.	S/N \$ 400.00	/
8	TO CARRY OUT WATER SEEPAGE TEST FOR AFFECTED WINDSCREEN.	S/N \$ 200.00	X
9	TO DISMANTLE AND RENEW FRONT BUMPER, BOTH FRONT FENDERS, BONNET AND BOTH HEADLIGHT. TO RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED.	3,200.00 ^{e3w x 3} \$ 900	
10	TO RESPRAY FRONT BUMPER, BOTH FRONT FENDERS, BONNET, HINGES AND LHS FRONT DOOR.	3,000.00 ^{e3w x 3 + 60} \$ 960	
TOTAL LABOUR CHARGES - FRONT		: \$ 12,640.00	

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SMN 8976 D - REAR

S/N	NATURE OF JOBS		ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
1	TO REMOVE AND TRANSFER REAR PARKING AID. CHECK FUNCTION.	S/N \$	280.00	/
2	TO REMOVE AND TRANSFER REAR LID'S CONVENIENCE LOCK SYSTEM, WIRE HARNESS FOR TAIL LIGHTS AND REAR LID WIPER ASSY.	S/N \$	480.00	/
3	TO DISLODGE AND REINSTALL REAR WIRE HARNESS FOR LIGHTS, BATTERY MANAGER, FUSE AND RELAY TRAYS, ELECTRICAL AND AUDIO EQUIPMENT. INSPECT FOR DAMAGE AND RENEW WHERE NECESSARY.	S/N \$	1,400.00	?
4	TO REMOVE AND REFIT REAR WINDSCREEN.	S/N \$	480.00	/
5	TO REMOVE AND REINSTALL EXHAUST SYSTEM AND REAR SUSPENSION ASSEMBLY. RENEW ACCORDINGLY.	S/N \$	2,800.00	?
6	TO REMOVE AND REINSTALL FUEL TANK ASSY.	S/N \$	600.00	?
TOTAL LABOUR CHARGES - REAR		:	\$	6,040.00

55 UBI ROAD 1, SINGAPORE 408699
 TEL : 6366 2323 FAX : 6841 1183
 EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SMN 8976 D - REAR

S/N	NATURE OF JOBS	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
7	TO SETUP VEHICLE ON CELLETE BENCH FOR REPAIR.	S/N \$ 1,800.00	/ photo
8	TO DISMANTLE AND RENEW REAR BUMPER AND REAR LID. TO CUT OUT AND WELD REAR END PANELLING AND SPARE WHEEL HOUSING. TO REPAIR BOTH REAR FENDERS. RE- ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED.	S/N \$ 4,400.00	/ 1800
9	TO RESPRAY REAR BUMPER, REAR LID, BOTH REAR FENDERS, SPARE WHEEL HOUSING AND REAR END PANELLING.	S/N \$ 3,000.00	/ 1500
10	TO CARRY OUT STONE CHIP PRIMER WORK ON REAR PANELLING AND SPARE WHEEL HOUSING.	S/N \$ 480.00	/
11	TO TOW BACK THE VEHICLE FROM ACCIDENT SCENE.	S/N \$ 280.00	? receipt
12	TO CARRY OUT DIAGNOSTIC CHECK.	S/N \$ 192.00	/
TOTAL LABOUR CHARGES - FRONT & REAR		: \$ 28,832.00	



55 UBI ROAD 1, SINGAPORE 408699

TEL: 6366 2323 FAX: 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SMN 8976 D - FRONT

S/N	PARTS DESCRIPTION	QTY	DAMAGED PARTS & PRICES	
			S/NETT	REMARKS
1	FRONT BUMPER <i>com/</i>	1	\$	1,050.00
2	FRONT BUMPER SIDE RETAINER - LH / RH <i>com/ x NN</i>	1 <i>2</i>	\$	72.00
3	FRONT BUMPER WIRE HARNESS	1		TBC
4	RADIATOR GRILLE <i>com/</i>	1	\$	735.00
5	FRONT BUMPER - LOWER <i>com/</i>	1	\$	960.00
6	FRONT BUMPER TRIM - LOWER <i>com/ x NN</i>	1	\$	390.00
7	FOG LAMP COVER - LH / RH <i>com/ x NN</i>	1 <i>2</i>	\$	420.00
8	HEADLAMP - LH / RH <i>com/ de x NN</i>	2	\$	15,300.00
9	FRONT WHEEL ARCH TRIM - LH / RH <i>com/ de x NN</i>	2	\$	540.00
10	FOAM <i>com/</i>	1	\$	360.00
11	FRONT WHEEL HOUSING GARNISH - LH / RH <i>com/ de x NN</i>	2	\$	420.00
12	BONNET <i>com/</i>	1	\$	3,714.00
13	BONNET HINGE - LH / RH <i>com/ x NN</i>	2	\$	150.00
14	FRONT FENDER - LH / RH <i>com/ x NN</i>	2	\$	1,320.00
15	RADIATOR AIR GUIDE - LH / RH <i>?</i>	2	\$	96.00
16	FRONT BUMPER REINFORCEMENT BEAM <i>com/</i>	1	\$	990.00
17	FRONT MEMBER SUPPORT <i>?</i>	1	\$	630.00
18	FRONT WINDSCREEN <i>com/</i>	1	\$	2,775.00
19	FRONT STEERING AIR BAG <i>ACT/</i>	1	\$	2,691.00
20	FRONT DRIVER KNEE AIRBAG <i>ACT/</i>	1	\$	2,415.00
SUB TOTAL SPARE PARTS - FRONT		:	\$	35,028.00

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.



55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SMN 8976 D - FRONT

S/N	PARTS DESCRIPTION	DAMAGED PARTS & PRICES			REMARKS
		QTY	S/NETT		
21	FRONT DRIVER KNEE AIRBAG COVER <i>de /</i>	1	\$	195.00	
22	FRONT PASSENGER AIR BAG <i>det /</i>	1	\$	1,500.00	
23	FRONT PASSENGER AIR BAG COVER <i>com /</i>	1	\$	570.00	
24	FRONT SEAT BELT - LH / RH <i>det /</i>	2	\$	3,840.00	
25	FRONT SEAT BELT ADJUSTER - LH / RH <i>9,</i>	2		TBC	
26	FRONT AIR BAG CONTROL UNIT <i>det /</i>	1	\$	1,860.00	
27	FRONT NO PLATE <i>Lt /</i>	S/N	\$	60.00	
28	FRONT WINDSCREEN SEALANT <i>m /</i>	S/N	\$	200.00	
TOTAL SPARE PARTS - FRONT		:	\$	43,253.00	

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699

TEL: 6366 2323 FAX: 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG


MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SMN 8976 D - REAR

S/N	PARTS DESCRIPTION	DAMAGED PARTS & PRICES			REMARKS
		QTY	S/NETT		
1	REAR LID <i>bt/</i>	1	\$	2,160.00	
2	REAR LID HINGE - LH / RH <i>?</i>	2	\$	120.00	
3	REAR LID INNER TRIM <i>?</i>	1	\$	540.00	
4	REAR LID GARNISH <i>?</i>	1	\$	450.00	
5	REAR LID WEATHER STRIP <i>ne/</i>	1	\$	270.00	
6	REAR LID EMBLEM "SUZUKI" <i>ne/</i>	1	\$	60.00	
7	REAR LID EMBLEM "SX4" <i>ne/</i>	1	\$	75.00	
8	REAR LID EMBLEM "S-CROSS" <i>ne/</i>	1	\$	90.00	
9	REAR LID EMBLEM "ALL GRIP" <i>ne/</i>	1	\$	90.00	
10	REAR BUMPER <i>TORN</i>	1	\$	1,200.00	
11	REAR BUMPER SIDE RETAINER - <i>ne/</i> LH / RH <i>NN</i>	2	\$	90.00	
12	REAR BUMPER REINFORCEMENT - LH / RH <i>bt/</i>	1	\$	510.00	
13	REAR BUMPER - LOWER <i>de/</i>	1	\$	960.00	
14	REAR BUMPER LOWER SUPORT - LH / RH <i>?</i>	2	\$	210.00	
15	REAR BUMPER LOWER TRIM <i>de/</i>	1	\$	480.00	
16	REAR BUMPER LOWER FOG LAMP COVER <i>ms/</i>	1	\$	30.00	
17	REAR BUMPER REFLECTOR - <i>con/</i> LH / RH <i>?</i>	2	\$	108.00	
18	REAR END PANEL <i>st/</i>	1	\$	930.00	
19	REAR SPARE WHEEL HOUSING PANEL <i>bu/</i>	1	\$	690.00	
20	REAR SPARE WHEEL HOUSING EXTENSION <i>bt/</i> LH / RH <i>NN</i>	2	\$	360.00	
SUB TOTAL SPARE PARTS - REAR		:	\$	9,423.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APROVED
SPARE PARTS ARE SPECIAL NETT.

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699
 TEL : 6366 2323 FAX : 6841 1183
 EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SMN 8976 D - REAR

S/N	PARTS DESCRIPTION	QTY	DAMAGED PARTS & PRICES	
			S/NETT	REMARKS
21	REAR WINDSCREEN X	1	\$ 1,830.00	
22	REAR WINDSCREEN MOULDING me /	1	TBC	
23	REAR BUMPER WIRE HARNESS ?	1	TBC	
24	REAR BUMPER PARKING AID SENSOR am /	4	TBC	
25	REAR EXHAUST bt /	1	\$ 1,890.00	
26	REAR EXHAUST MOUNTING - LH / RH m /	2	\$ 96.00	
27	REAR EXHAUST HEAT SHIELD bt /	1	\$ 90.00	
28	REAR WHEEL HOUSING GARNISH - LH / RH ca / X NN	1	\$ 630.00	
29	REAR UNDER BODY TRIM - LH / RH ?	2	\$ 1,200.00	
30	REAR NO PLATE mis /	S/N	\$ 60.00	
31	ACRYLIC SEALANT m /	S/N	\$ 180.00	
32	CAVITY WAX m /	S/N	\$ 140.00	
33	STONE CHIP m /	S/N	\$ 180.00	
34	METAL FILLER POWDER m /	S/N	\$ 280.00	
35	REAR WINDSCREEN SEALANT m /	S/N	\$ 200.00	
36	SUNDRIES ?		\$ 700.00	
TOTAL SPARE PARTS - FRONT & REAR		:	\$ 60,152.00	
TOTAL LABOUR CHARGES - FRONT & REAR		:	\$ 28,832.00	
GRAND TOTAL		:	\$ 88,984.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APROVED
 SPARE PARTS ARE SPECIAL NETT.



55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

NAME

SURVEYED DATE

AUTHORISED DATE

EXCESS COST

LIABILITY

REMARKS

Rasul - Hp 90010068
03/01/23 @ 1350
20 days
P/P
Resurvey before paint

PLEASE NOTE

THIS ESTIMATE IS BASED ON VISUAL INSPECTION OF THE AFFECTED VEHICLE. SHOULD WE REQUIRE FURTHER LABOUR CHARGES AND SPARE PARTS IN THE PROGRESS OF REPAIR, WE SHALL INFORM YOU ACCORDINGLY. FOR INSPECTION OF VEHICLE, PLEASE REFER TO MS. NORAH KHAI AT TEL: 6768 9828 / 6768 9911 FOR APPOINTMENT.

YOURS FAITHFULLY,
PREMIUM AUTOMOBILES PTE LTD

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

JOHNNY BOO
BODY REPAIR MANAGER

ALLAN WU
CLAIMS CONSULTANT

