

(08/11/13) wef

ASS. REC. BY: Panne

REF:

CC4/11122012997/Rpa3

1896

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No:

SMU 4674

at Workshop m/s

MABA

of

Fam Young

Insured:

111

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

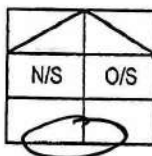

Bal. or Market Value:

145K

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

days

Res.:

Yes or No

Lum Sum:

%

3 Val.:

Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Date / Time

Action / Instruction

REPAIR UNIT - 92K

Veh No:

SMU 4674

Yr Regn:

2020 July

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Toyota Camry Hybrid 2.5G c.c 2487

Colour

GOLD

A/C:

Insured / Std / NI / NA

Sp. Reading

73879

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

AX VH 701039735

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

215/55R17

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

6

mm

R/Bal.

6

mm

L/Bal.

6

mm

L/Bal.

6

mm

D.O.A.

23/12/22

D.O.I.

29/12/22

Survey held at

MABA (FY)

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech. Invs (\$

☐

: Weekend (\$

) : S + RS SI

) : Photos

) : Others

Report Format :

Lump Sum / I.B.I: (\$

TOTAL



Main Office : No. 22, Jalan Kilang, Singapore 159419
Tel: 6476 3333 Fax: 6271 5891

Service Centre : Block 1008, Bukit Merah Lane 3,
#01-04/06/08/115, Singapore 169722
Tel: (65) 6476 3333 (8 Lines) Fax: (65) 6270 8314
www.mova.com.sg
GST Reg. No: M2-0088864-2

Mova Spray Centre
2K Oven Spray Painting System

Power-M Automotive Pte Ltd
Specialise In Car Air-con Services,
Car Audio & Hi-Fi System.

Hilton Car Rental Centre
Hilton Auto Trading
Dealing In New/Used Cars, Hire Purchase & Insurance.



TP INSURER: India International Insurance Pte Ltd (HQ)
ER BENG HUI

Singapore

Claimant Insurer: Income Insurance Limited

PARTICULARS OF CLAIM

Claim Type:	THIRD PARTY	Ref. No:	
Policy No:		Date of Loss:	23/12/2022
Vehicle Reg. No.:	SMU467Y	Driveable?	
Party At Fault:	UNKNOWN		
Driver (TP):	ER BENG HUI		
Make/Model:	TOYOTA CAMRY, 2.5 (A)	Vehicle Reg. Date:	28/07/2020
Vehicle Colour:	SILVER	Chassis No:	AXVH701039735
Engine No:	A25A5118692		
Odometer:	0 KM		
Paint Type:			
List Item Discount:	25.00 %		
Total Loss?	NO		
Est. Duration of Repair (day)	20		
Description of Accident/Loss	REFER TO SKETCH		
Remarks:	VEHICLE AT 15 FAN YOONG ROAD.		
Present Location:	MOVA AUTOMOTIVE PTE LTD (BUKIT MERAH)		

COST OF CLAIMS

	Amount
Parts	15,714.17
Miscellaneous Items	11.00
Labour	5,590.00
Paintwork Labour	0.00
Towing	0.00
Gross Total (\$)	21,315.17
+ GST 7.00% (\$)	1,492.06
Nett Amount (\$)	22,807.23

This claim is handled by: BRIAN

REPAIR DETAILS

Reference

Part Source: MRM-SG

Version: 1.0 (Last Synchronised: 28 Dec 2022)

Parts: 143

TOYOTA CAMRY 2.5 (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's

(Price-denominated Standard List)

Print Code: Mova Automotive Pte Ltd/SMU467Y/28/12/2022 18:36

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Estimates on Parts

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1		*REAR WINDSCREEN SEAL <i>de</i>	25.00	0.00	*95.00 FL
2	1		*BOOT LID <i>bt</i>	25.00	0.00	*1,580.90 FL
3	2		*BOOT LID HINGE LH/RH	25.00	0.00	*317.00 FL
4	1		*BOOT LID INNER TRIM <i>de</i>	25.00	0.00	*390.90 FL
5	10		*BOOT LID INNER TRIM CLIPS <i>de</i>	25.00	0.00	*55.00 FL
6	1		*BOOT LID WEATHERSTRIPS <i>de</i>	25.00	0.00	*258.50 FL
7	1		*TOYOTA LOGO - HYBRID <i>de</i>	25.00	0.00	*95.00 FL
8	1		*BOOTLID HANDLE TRIM <i>de</i>	25.00	0.00	*215.30 FL
9	1		*BOOT LID HANDLE TRIM SEAL <i>de</i>	25.00	0.00	*45.30 FL
10	1		*LOWER BOOT LID TRIM <i>de</i>	25.00	0.00	*105.80 FL
11	2		*NUMBER PLATE LAMP LH/RH	25.00	0.00	*361.00 FL
12	1		*BOOT LID LOCK HANDLE <i>X</i>	25.00	0.00	*165.80 FL
13	1		*CAMRY EMBLEM <i>de</i>	25.00	0.00	*79.80 FL
14	1		*SYNERGY EMBLEM <i>de</i>	25.00	0.00	*80.50 FL
15	2		*TAILLAMP INNER LH/RH <i>con</i>	25.00	0.00	*1,490.60 FL
16	2		*TAILLAMP INNER GASKET LH/RH <i>con</i>	25.00	0.00	*70.00 FL
17	2		*TAILLAMP OUTER LH/RH <i>con</i>	25.00	0.00	*1,961.00 FL
18	2		*TAILLAMP MOUNTING CLIPS <i>con</i>	25.00	0.00	*17.00 FL
19	2		*TAILLAMP LOWER BRACKET LH/RH <i>con</i>	25.00	0.00	*151.60 FL
20	1		*TAILLAMP SIDE TRIM LH/RH <i>mis</i>	25.00	0.00	*49.30 FL
21	1		*REAR BUMPER <i>de</i>	25.00	0.00	*856.50 FL
22	2		*REAR BUMPER RETAINER LH/RH <i>lpc-R4-new LH-X</i>	25.00	0.00	*217.40 FL
23	10		*REAR BUMPER CLIPS <i>de</i>	25.00	0.00	*55.00 FL
24	2		*REAR BUMPER UPPER GROMMET LH/RH <i>de</i>	25.00	0.00	*17.00 FL
25	4		*REVERSE SENSOR <i>de</i>	25.00	0.00	*1,522.00 FL
26	4		*REVERSE SENSOR RING <i>de</i>	25.00	0.00	*42.00 FL
27	1		*REAR BUMPER LOWER COVER <i>con</i>	25.00	0.00	*380.50 FL
28	2		*REAR BUMPER SIDE COVER LH/RH <i>X</i>	25.00	0.00	*221.00 FL
29	2		*REAR BUMPER REFLECTOR LH/RH <i>X</i>	25.00	0.00	*159.20 FL
30	2		*REAR BUMPER REINFORCEMENT <i>bt</i>	25.00	0.00	*760.80 FL
31	1		*REAR END PANEL <i>bt</i>	25.00	0.00	*790.20 FL
32	1		*END PANEL TRIM <i>de</i>	25.00	0.00	*360.50 FL
33	1		*REAR FLOOR PANEL <i>X</i>	25.00	0.00	*1,347.50 FL
34	1		*LUGGAGE COMPARTMENT BOARD <i>de</i>	25.00	0.00	*550.80 FL
35	1		*TOOL BOX SPONGE <i>de</i>	25.00	0.00	*390.50 FL
36	1		*REAR FLOOR PANEL, UNDERNEATH COVER <i>X</i>	25.00	0.00	*390.50 FL
37	2		*REAR FENDER LH/RH <i>bat</i>	25.00	0.00	*2,561.00 FL
38	2		*REAR FENDER TOP COVER LH/RH <i>see</i>	25.00	0.00	*501.60 FL
39	2		*TAILLAMP PANEL LH/RH <i>bt</i>	25.00	0.00	*641.00 FL
40	1		*REAR FENDER INNER TRIM LH <i>de</i>	25.00	0.00	*620.30 FL
41	10		*REAR FENDER INNER TRIM CLIPS LH <i>de</i>	25.00	0.00	*55.00 FL
42	1		*REAR FENDER INNER TRIM RH <i>de</i>	25.00	0.00	*618.30 FL
43	10		*REAR FENDER INNER TRIM CLIPS RH <i>de</i>	25.00	0.00	*55.00 FL
44	1		*NUMBER PLATE <i>X</i>	0	0.00	*40.00 FS
45	1		*BODY SEALING TAPE <i>X</i>	0	0.00	*80.00 FS
46	1		*REAR WINDSCREEN SEALANT <i>de</i>	0	0.00	*40.00 FS
47	1		*REAR WINDSCREEN PRIMER <i>de</i>	0	0.00	*30.00 FS

F=Franchise part. S=SpocNett. L=ListItemDisc.

Sub Total (\$\$) 20,888.90
 - List Item Discount on L Items (\$\$) 5,174.73

Total Parts (\$\$) 15,714.17

Mova Automotive Pte Ltd/SMU467Y/28/12/2022 18:36. Not valid without Reference section.
 Generated using Merimen e-Claims IEAS

Estimates on Miscellaneous Items

No	Qty	Particulars	Amount
<u>Miscellaneous Items</u>			
1	1	OD/TP Case (Insurer)	11.00 ✓
Sub Total (\$\$)			11.00

Estimates on Labour

No	Particulars	Lab.Type	Amount
<u>Labour Items</u>			
1	TO KNOCK, CUT, WELD REAR END PANEL, BOTH LH/RH REAR FENDER AND REAR BOOT FLOOR. TO REPLACE REAR DAMAGED PARTS AS RELATED TO ACCIDENT.	New	1600 2,200.00 ✓
2	TO SPRAY PAINT ON REAR BOOT LID, REAR BUMPER, REAR END PANEL, REAR BOOT FLOOR, BOTH LH/RH REAR FENDER.	New	1000 1,000.00 ✓
3	TO REMOVE AND REFIT REAR WINDSCREEN.	New	120 120.00 ✓
4	TO APPLY ANTI RUST PROOFING ON AFFECTED AREAS.	New	80 120.00 ✓
5	TO APPLY BODY SEALANT ON CUTTING AREAS.	New	60 120.00 ✓
6	TO TRANSFER/INSTALL TAILGATE LOCK MECHANISM, TAILGATE TRIM, WIRING HARNESS AND ATTACHED PARTS TO NEW UNITS.	New	60 120.00 ✓
7	TO REMOVE AND REFIT REAR SEAT, SEAT BELT, UPHOLSTERY, SIDE TRIM, ATTACHED PARTS TO ASSIST REPAIR.	New	1260 120.00 ✓
8	TO INSTALL REVERSE SENSOR, CODING AND CHECK FUNCTIONING.	New	100 200.00 ✓
9	TO INSTALL REAR VIEW CAMERA AND SET UP IN HEADUNIT.	New	60 180.00 ✓
10	TO REMOVE AND REFIT EXHAUST SILENCER	New	X 200.00 ✓
11	TO DISMANTLE FUEL TANK TO ASSIST REPAIR.	New	80 200.00 ✓
12	TO DISCONNECT HYBRID BATTERY SYSTEM AND RESET SYSTEM.	New	250 400.00 ✓
13	TO CHECK FOR AND RECTIFY WIRING FAULT. TO CONDUCT DIAGNOSTIC CHECK AND FUNCTIONAL CHECK.	New	60 180.00 ✓
Gross Labour Cost (\$\$)			5,590.00

Mova Automotive Pte Ltd/SMU467Y/28/12/2022 18:36. Not valid without Reference section.

Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Paul
Hp 9001 1068

11 days

P/P

29/12/22 @ 1545

Ready before
paint

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	189G
Vehicle Details	
Vehicle No.:	SMU467Y
Vehicle to be Exported:	No
Intended Deregistration Date:	02 Jan 2023
Vehicle Make:	TOYOTA
Vehicle Model:	CAMRY HYBRID 2.5G CVT
Primary Colour:	Silver
Manufacturing Year:	2019
Engine No.:	A25A5118692
Chassis No.:	AXVH701039735
Maximum Power Output:	155.0 kW (207 bhp)
Open Market Value:	\$38,076.00
Original Registration Date:	28 Jul 2020
First Registration Date:	28 Jul 2020
Transfer Count:	0
Actual ARF Paid:	\$35,307.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	27 Jul 2030
PARF Rebate Amount:	\$26,480.00
Intended COE Rebate Details	
COE Expiry Date:	27 Jul 2030
COE Category:	E - Open - all except motorcycle
COE Period(Years):	10
QP Paid:	\$35,001.00
COE Rebate Amount:	\$26,485.00
Total Rebate Amount:	\$52,965.00

Toyota Camry Hybrid 2.5A G

Overview

Financial

Accessories

Similar

Research

Photos

Map



PRIME MOTOR & LEASING



(CHENG YONG CREDIT ENTERPRISES PTE LTD GROUP OF COMPANIES)

• PRIME CAR RENTAL & TAXI SERVICES PTE LTD • SECTION CREDIT & MOTOR LEASING PTE LTD • BEST PETROL AND DIESEL SUPPLY PTE LTD • BEST ELECTRICITY SUPPLY PTE LTD

Price **\$131,000**

Depreciation **\$16,880 /yr**
[View models with similar depre](#)

Reg Date **19-Sep-2019**
(6yrs 8mths 16days COE left)

Mileage **N.A.**

Manufactured **2019**

Road Tax **\$1,784 /yr**

Transmission **Auto**

Dereg Value **\$51,349 as of today (change)**

Fuel Type **Petrol-Electric**

COE **\$37,000**

OMV **\$38,098**

Engine Cap **2,487 cc**

ARF **\$35,338**

Curb Weight **1,570 kg**

Power **155.0 kW (207 bhp)**