

ASS. REC. BY:

REF:

LIP / 22013030/kw

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value:

\$72k

IDAC Accident Report:

Consistent?: Yes or No

GIA / PR Seen:

Consistent?: Yes or No

Est. Repairs:

24

days

Res.: Yes or No

Lum Sum:

1-B1

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Date / Time

Action / Instruction

Veh No:

SMT 154E

Yr Regn:

03, 20

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Mit Attrage

c.c

1193

Colour

M. Margn

A/C:

Insured / Std / NI / NA

Sp. Reading

22782

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

MNBSTA13AK14 003691

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder? Jammed / Leaked / Burnt or

Brake: Inorder? Jammed / Leaked / Burnt or

Modl: Nil / S/Rlm / STD A/Rlm or

Tyre Size:

F:

R:

185/55R15

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI / TOYO / YOKO or

Front

R/Bal.

3

mm

Rear

R/Bal.

6

mm

L/Bal.

3

mm

L/Bal.

6

mm

D.O.A.

28/12/22

D.O.I.

30/12/2022

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear N/S & Frt

The U/C / Chassis frame / Body Structure affected due to collision.

Date/Time, File Pass to?

☐

: Prell. Report

1)

Date/Time, File Return to?

☐

: Final Report

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S + RS. SI

P. 1005

Others

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

TOTAL

Report Format:

Lump Sum / I.B.I. (\$

Cheng Hoe Motor Pte Ltd

Blk 1019, Yishun Industrial Park A #01-374/382, Singapore 768761
 TEL: 67556142 (YIS) FAX: 67557719 (YIS) Email: chmotor@singnet.com.sg
 GST:201001158E RCB NO:201001158E

M/S: LIBERTY INSURANCE PTE LTD
 51 CLUB STREET
 #03-00 LIBERTY HOUSE
 SINGAPORE 069428
 TEL: 62218611 FAX: 62241047
 ATTN: Motor Claim Department

WS Ref: TP/LIBERTY/AMK
 Claim Type: Third Party
 Accident Date: 28/12/2022
 TP Veh Reg No: SNH5185J

Estimate No: ES2291355/AMK
 Date: 29 Dec 2022
 Policy No: 5126203053
 Veh Reg No: SMT154E
 Make/Model: MITSUBISHI MIT.
 ATTRAGE 1.2 CVT
 Chassis No: MMBSTA13AKH003691
 Engine No: 3A92UJC5652
 Reg. Date: 25/03/2020

Estimate Repair Cost to Vehicle No :SMT154E

Description	U/Price	Quantity	List Price	Amount
			SS	SS
Net Price				
1 FRONT BUMPER	696.00	1 PC	R ₁ 696.00	✓
2 FRONT BUMPER LOWER SKIRT	786.00	1 PC	CM 786.00	✓
3 FRONT BUMPER LOWER CENTRE GRILLE	165.00	1 PC	CM 165.00	✓
4 FRONT BUMPER INNER TOP GARNISH	69.00	1 PC	Bu/CM 69.00	✓
5 FRONT BUMPER SIDE RETAINERS	17.00	2 PCS	DII 34.00	✓
6 FRONT BUMPER CLIPS	5.00	6 PCS	na 30.00	✓
7 FRONT GRILLE ASSY	545.00	1 PC	CM 545.00	✓
8 FRONT GRILLE LOGO	52.00	1 PC	na 52.00	✓
9 BONNET	699.00	1 PC	R ₁ 699.00	✓
10 BONNET INNER LOCK	68.00	1 PC	DII 68.00	✓
11 BONNET HINGES	54.00	2 PCS	DII 108.00	✓
12 BONNET INSULATOR CLIPS	5.00	6 PCS	na 30.00	✓
13 HEADLAMPS	554.00	2 PCS	mg/CM 1,108.00	✓
14 FRT SUPPORT PANEL	999.00	1 PC	999.00	?
15 AIR-CON CONDENSER	693.00	1 PC	693.00	?
16 AIR-CON INNER TOP GARNISH	106.00	1 PC	CM 106.00	✓
17 AIR-CON LIQUID PIPE	198.00	1 PC	198.00	?
18 RADIATOR	872.00	1 PC	872.00	?
19 RADIATOR FAN COWLING	127.00	1 PC	CM 127.00	✓
20 RADIATOR FAN BLADE	71.00	1 PC	71.00	?
21 RADIATOR SPARE TANK	58.00	1 PC	na 58.00	X
22 RADIATOR SIDE GARNISHS	16.00	2 PCS	CM 32.00	✓
23 RADIATOR FAN MOTOR	475.00	1 PC	475.00	?
24 FRONT FENDERS	438.00	2 PCS	876.00	4+
25 FRONT FENDER EMBLEMS (EDC)		2 PCS		4+
26 FRONT FENDER INNER SHIELD CLIPS	5.00	12 PCS	na 60.00	X
27 ENGINE INTAKE MANIFOLD	598.00	1 PC	598.00	?
28 ENGINE THROTTLE BODY	981.00	1 PC	981.00	?
29 REAR BUMPER	748.00	1 PC	T ₁ 748.00	✓
30 REAR BUMPER LOWER SKIRT	786.00	1 PC	Bu 786.00	✓
31 REAR BUMPER LH REFLECTOR	24.00	1 PC	mg D.I 24.00	✓
32 REAR BUMPER LH SIDE RETAINER	29.00	1 PC	CM 29.00	✓
33 REAR BUMPER CLIPS	5.00	6 PCS	na 30.00	✓
34 REAR BUMPER LH INNER SHIELD	41.00	1 PC	T ₁ 41.00	✓
35 BOOTLID	799.00	1 PC	R ₁ 799.00	✓
36 BOOTLID HINGES	192.00	2 PCS	384.00	4+
37 REAR BOOTLID INNER LOCK	206.00	1 PC	na 206.00	✓

Labour Subtotal S\$ 350.00
 Total Discount S\$ 0.00

Cheng Hoe Motor Pte Ltd

Blk 1019, Yishun Industrial Park A #01-374/382, Singapore 768761
 TEL: 67556142 (YIS) FAX: 67557719 (YIS) Email: chmotor@singnet.com.sg
 GST:201001158E RCB NO:201001158E

M/S : LIBERTY INSURANCE PTE LTD
 51 CLUB STREET
 #03-00 LIBERTY HOUSE
 SINGAPORE 069428

TEL: 62218611 FAX: 62241047
 ATTN: Motor Claim Department

WS Ref: TP/LIBERTY/AMK
 Claim Type: Third Party
 Accident Date: 28/12/2022
 TP Veh Reg No: SNH5185J

Estimate No: ES2291355/AMK
 Date: 29 Dec 2022
 Policy No: 5126203053
 Veh Reg No: SMT154E
 Make/Model: MITSUBISHI MIT.
 ATTRAGE 1.2 CVT
 Chassis No: MMBSTA13AKH003691
 Engine No: 3A92UJC5652
 Reg. Date: 25/03/2020

Estimate Repair Cost to Vehicle No :SMT154E

Description	U/Price	Quantity	List Price	Amount
38 REAR BOOTLID INNER RUBBER	<i>Dis 100</i> 157.00	1 PC	<i>SS</i> 157.00	<i>✓</i> SS
39 BOOTLID SPOILER	<i>Br ✓</i> 157.00	1 PC		
40 BOOTLID OUTER CHROME	348.00	1 PC	<i>Wap</i> 348.00	<i>✓</i>
41 BOOTLID LOGO	45.00	1 PC	<i>re</i> 45.00	<i>✓</i>
42 REAR BOOTLID EMBLEM (ATTRAGE)	37.00	1 PC	<i>re</i> 37.00	<i>✓</i>
43 REAR BOOTLID EMBLEM (MIVEC)		1 PC	<i>re</i>	<i>✓</i>
44 LH TAILLAMP	296.00	1 PC	<i>Br</i> 296.00	<i>✓</i>
45 LH TAILLAMP PANEL	87.00	1 PC	<i>Br</i> 87.00	<i>✓</i>
46 LH TAILLAMP CLIP	6.00	1 PC	<i>re</i> 6.00	<i>✓</i>
47 REAR LH FENDER	823.00	1 PC	<i>Br</i> 823.00	<i>✓</i>
48 REAR LH FENDER INNER TRIM	178.00	1 PC	<i>re</i> 178.00	<i>✓</i>
49 REAR LH FENDER AIR GRILLE	92.00	1 PC	<i>re</i> 92.00	<i>✓</i>
50 REAR END PANEL	421.00	1 PC	<i>Br</i> 421.00	<i>✓</i>
51 REAR END PANEL INNER TOP GARNISH	114.00	1 PC	<i>Br</i> 114.00	<i>✓</i>
52 REAR END PANEL WARNING BUZZER	112.00	1 PC	<i>re</i> 112.00	<i>✓</i>
53 REAR END PANEL BUZZER SENSOR	98.00	1 PC	<i>CM</i> 98.00	<i>✓</i>
54 REAR LH WHEEL HOUSING	797.00	1 PC	<i>Br</i> 797.00	<i>✓</i>
55 REAR LH SHOCK ABSORBER	198.00	1 PC		<i>?</i>
56 REAR SPARE TYRE PANEL	906.00	1 PC		<i>?</i>
57 REAR SPARE TYRE TOP BOARD	197.00	1 PC		<i>?</i>
58 REAR LH CHASSIS FRAME	988.00	1 PC	<i>re</i> 988.00	<i>X</i>
			19,483.00	
Less 10%			1,948.30	17,534.70
Special Net				
59 FRONT NUMBER PLATE	35.00	1 PC	<i>re</i> 35.00	<i>✓</i>
60 REAR NUMBER PLATE	35.00	1 PC	<i>re</i> 35.00	<i>✓</i>
61 COOLANT	35.00	1 UNIT	<i>re</i> 35.00	<i>✓</i>
62 REAR END PANEL SEALANT	40.00	1 UNIT	<i>re</i> 40.00	<i>301m</i>
63 REAR SPARE TYRE PANEL TOP COAT	120.00	1 UNIT		<i>?</i>
64 REAR WINDSCREEN GLASS SEALANT	40.00	1 ROLL	<i>re</i> 40.00	<i>✓</i>
65 REVERSE SENSORS	200.00	1 SET	<i>shan</i> 200.00	<i>✓</i>
			505.00	505.00
Labour				
66 TOWING	100.00	1 LA	<i>(Bill)</i> 100.00	<i>✓</i>
67 REMOVE AND REFIX AIRCON,CHECK,VACUUM & REFILL GAS	100.00	1 LA	100.00	<i>✓</i>

Cheng Hoe Motor Pte Ltd

Blk 1019, Yishun Industrial Park A #01-374/382, Singapore 768761
TEL: 67556142 (YIS) FAX: 67557719 (YIS) Email: chmotor@singnet.com.sg
GST:201001158E RCB NO:201001158E

M/S : LIBERTY INSURANCE PTE LTD

51 CLUB STREET

#03-00 LIBERTY HOUSE

SINGAPORE 069428

TEL: 62218611

FAX: 62241047

ATTN: Motor Claim Department

WS Ref: TP/LIBERTY/AMK

Claim Type: Third Party

Accident Date: 28/12/2022

TP Veh Reg No: SNH5185J

Estimate No: ES2291355/AMK

Date: 29 Dec 2022

Policy No: 5126203053

Veh Reg No: SMT154E

Make/Model: MITSUBISHI MIT.
ATTRAGE 1.2 CVT

Chassis No: MMBSTA13AKH003691

Engine No: 3A92UJC5652

Reg. Date: 25/03/2020

Estimate Repair Cost to Vehicle No :SMT154E

Description	U/Price	Quantity	List Price	Amount
			<u>S\$</u>	<u>S\$</u>
68 REMOVE & REFIX FRT BUMPER,LOWER SKIRT & ATTACHMENTS,GRILLE,BONNET & ATTACHMENTS,HEADLAMPS,BOTH FENDERS,CUT,WELD & RENEW FRT SUPPORT PANEL,KNOCK & REPAIR FRT CHASSIS,FRT BOTH WHEEL HOUSING,FRT BOTH DOORS & REALIGN THE SAME	1,400.00	1 LA	1,400.00	7
69 PUTTY & RESPRAY FRT BUMPER,LOWER SKIRT & ATTACHMENTS,BONNET & ATTACHMENTS,BOTH FENDERS,FRT SUPPORT PANEL,FRT CHASSIS FRAME,BOTH FRT DOORS & ALL AFFECTED AREAS	1,200.00	1 LA	1,200.00	11000
70 REMOVE AND REFIX REAR WINDSCREEN GLASS	100.00	1 LA	100.00	✓
71 REMOVE & REFIX RR BUMPER & LOWER SKIRT,BOOTLID & SPOILER & ATTACHMENTS,TAILLAMPS,CUT,WELD & RENEW RR LH FENDER & WHEEL HOUSING,REAR END PANEL,RR SPARE TYRE PANEL,LH TAILLAMP PANEL,LH CHASSIS FRAME,KNOCK & REPAIR RR RH FENDER,RR LH DOOR & REALIGN THE SAME	2,600.00	1 LA	2,600.00	20000
72 PUTTY & RESPRAY REAR BUMPER,LOWER SKIRT,PARKING SENSORS,BOOTLID & TOP SPOILER,BOTH FENDERS,LH WHEEL HOUSE,REAR END PANEL,REAR SPARE TYRE PANEL,LH CHASSIS FRAME,REAR LH DOOR & ALL AFFECTED AREAS	1,800.00	1 LA	1,800.00	16000
73 TO MOUNT ON CAR-O-LINER,JACK & STRAIGHTEN CHASSIS	250.00	1 LA	250.00	?
74 REMOVE & REFIX REAR SEAT,CARPET,ROOF LINING TO FACILITATE REPAIR	120.00	1 LA	120.00	✓
75 REMOVE & REFIX REAR LH SHOCK ABSORBER & REALIGN THE SAME	100.00	1 LA	100.00	?
76 REMOVE & REFIX ENGINE INTAKE MANIFOLD,THROTTLE BODY AND REALIGN THE SAME	150.00	1 LA	150.00	?
77 TO CONDUCT COMPUTERIZED WHEEL ALIGNMENT	60.00	1 PC	60.00	✓
78 RUSTPROOFING	150.00	1 LA	150.00	✓
			8,130.00	8,130.00

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	28/12/2022 18:55 (SGT)
Reported by	Both
Date of Accident	28/12/2022 09:25 (SGT)
Exact Location of Accident	Singapore
Additional Location Information	SERANGOON GARDEN WAY
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SMT154E
-----------------------------	---------

INSURED/POLICYHOLDER

Is company?	No
Name Of Registered Owner	HO CHEONG KIAN
NRIC No	SXXXX298E
Email Address	jerryho5353@gmail.com
Mobile Phone No	(Phone) +65-98261591
Alternative Phone No	-

VEHICLE PARTICULARS

Manufacturer	Mitsubishi
Model	ATTRAGE 1.2 CVT
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Private car
Transmission	Auto
CC	1193

INSURANCE COMPANY

Name of Insurance Company	Income Insurance Limited
Policy Number / Cover Note Number	5126203053

DRIVER


Name of Driver	HO CHEONG KIAN
NRIC No	SXXXX298E
Date Of Birth	03/11/1949
Occupation	Indoor

Describe Circumstance of the Accident

** NOTE : PLEASE TAKE NOTE THAT YOUR INSURER HAVE 14 DAYS TIME FRAME for you to submit OWN DAMAGE Claim under your Own Comprehensive policy. Pls check your policy for more information.

() Claim Own Policy (/) Claim Third party () Reporting Only
() Claim OD/ TP at other workshop ()

Sketch Plan

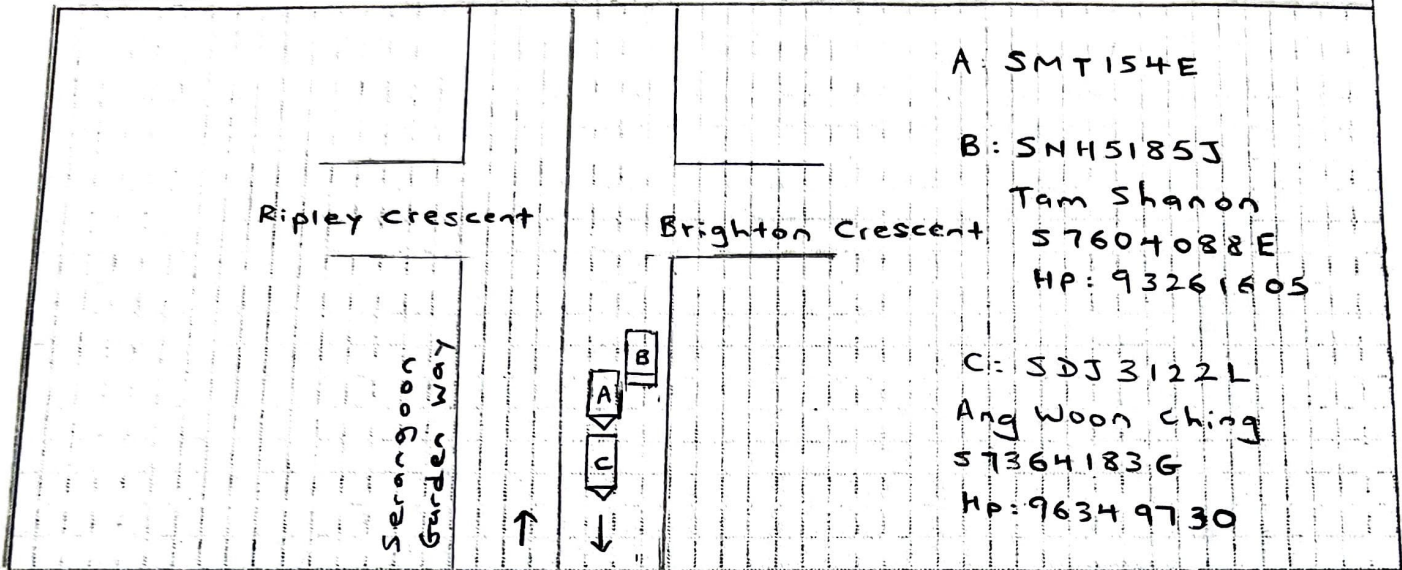

DOA: 28/12/22 9.25am

Traffic was heavy. All vehicle were stationary. All of a

Sudden I felt a huge impact on my rear & realised was

hit by SNH5185J my car was being pushed forward & hit

onto SDJ3122L. It was a chain collision of 3 vehicles.

Nobody injured.

Declaration

I/We declare the foregoing particulars are true in every respect.

[Signature]
Policyholder's Signature / Date & Time

Driver's Signature (if driver is not the policyholder) / Date

(AMK) *[Signature]* 28/12/22
Witnessed by Reporting Centre Personnel
(Name as in NRIC/ID card)