



## VEHICLE INSPECTION REPORT

Report No. : PAS/TP/0390722  
Date of Report : 26/08/2022  
To : Ms Soh Sin Lin, Cynthia  
Date of Assignment : 29/07/2022  
C/o. Blk 3019A Ubi Road 1  
Report requested by : Ms Soh Sin Lin, Cynthia  
#01-30  
Date of Accident : 29/07/2022  
Singapore 408713  
Date of Inspection : 29/07/2022  
Claim No. : Third Party Claim  
Policy No. : -

### PARTICULARS OF DAMAGED VEHICLE

Vehicle Registration No. : SLV1536G  
Engine Capacity (cc) : 1797  
Make & Model : Toyota C-HR (Hybrid)  
Mileage (km) : 63092km  
Date of Registration : 22/12/2017  
Chassis / Frame No. : ZYX102050709  
Colour : Met. Black  
Engine No. : 2ZR8136030

### TYRE CONDITION

Front LH : 7 mm	Front RH : 7 mm
Make : Yokohama	Make : Yokohama
Rear LH : 7 mm	Rear RH : 7 mm
Make : Yokohama	Make : Yokohama

Road wheels Type : Alloy  
(The above represents the approximate remaining life of tyre treads)

### PRE-ACCIDENT CONDITION OF DAMAGED VEHICLE (Static tests only)

General Bodywork : Good  
Paintwork : Good  
Handbrake : Serviceable  
Footbrake : Serviceable  
Steering : Serviceable  
Apparent Engine Modification : Nil

### PLACE OF REPAIRER OFFICE/WORKSHOP

Location : M/s. C. H. Motor Vehicle Repair Training  
Blk 3019A, Ubi Road 1, #01-30, Singapore 408713

### ASSESSMENT

Repairer's Estimate : \$ 13,777.38  
Revised Amount : \$ 9,895.25  
Less Excess : \$ -  
Recommended Reserve : \$ 7,920.00 (Lump Sum)

Estimated Normal Period of Repairs : 8 Working Days

**Disclaimer:** The information contained in this report is intended for exclusive use of the addressee (including any attachments) solely in relation to the loss occurrence in which the assessed vehicle involved. It is confidential and may be protected by legal privilege. No liability or responsibility whatsoever shall be held by PROMINENT APPRAISER SERVICES PTE LTD for any reliance on this report by any third party. If you are not the intended recipient, please contact us immediately to arrange for its return and you should not disseminate, distribute, copy any information contained herein or use of this communication is strictly prohibited.



# PROMINENT APPRAISER SERVICES PTE LTD

Qualified Loss Adjusters And Motor Appraisers  
Correspondence Mail Address: My Mail Box 886259 Singapore 919191.  
Mobile: 9295 2204 Fax: 6722 8508 Email: pasvos@hotmail.com

Business Reg. 201404434D

Vehicle No : SLV1536G

Report No. : PAS/TP/0390722

## GENERAL REMARKS

WITHOUT PREJUDICE

### THE ASSIGNMENT

The survey was conducted at M/s. C. H. Motor Vehicle Repair Training, Blk 3019A, Ubi Road 1, #01-30, Singapore 408713.

(Subsequent inspections have been conducted)

### POINT OF IMPACT

At the rear portion.

### DAMAGES

The tailgate, rear bumpers, rear end panel, rear floor panel, rear chassis members, rear fenders, rear exhaust silencer, RH taillamp, etc.

*Other parts were also found damaged. (See schedule for details)*

### ADJUSTMENT / RECOMMENDATION

We have inspected thoroughly each and every item on the repairer's estimate against the actual damaged found on the vehicle. We list the breakdown of our findings and our recommendation as per schedule attached.

Our adjusted amount for the cost of repairs is SGD \$9,895.25.

### CONCLUSION

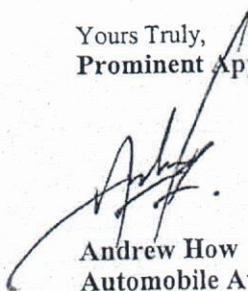
The repairer has agreed to undertake the repairs at a lump sum of SGD \$7,920.00.

This inspection was conducted entirely on a 'Without Prejudice' basis. We have not given an authorization and/or instruction to the repairer to proceed with the repairs.

We hereby reverting the matter to you for your discretion on repairs.

Assuring you of our best services always.

Yours Truly,  
Prominent Appraiser Services Pte Ltd

  
Andrew How  
Automobile Appraiser  
MSAAA  
Licensed Appraiser



# PROMINENT APPRAISER SERVICES PTE LTD

Qualified Loss Adjusters And Motor Appraisers

Correspondence Mail Address: My Mail Box 886259 Singapore 919191.

Mobile: 9295 2204 Fax: 6722 8508 Email: pasvcs@hotmail.com

Business Reg. 201404434D

Vehicle No : SLV1536G

Report No. : PAS/TP/0390722

## APPRAISEMENT SCHEDULE

S/No.	Qty	Parts Descriptions	Condition		Repairer's Estimate (S\$)	Our Assessment (S\$)
1	1 pc	Tailgate	Dented		\$ 1,206.20	\$ ✓ 1,206.20
2	2 pcs	Tailgate hinge R/L	Serviceable	\$ 70.50	\$ 141.00	\$ ✗ -
3	2 pcs	Tailgate support stay R/L	Refit	\$ 249.10	\$ 498.20	\$ ✗ -
4	2 pcs	Rr windscreen side moulding R/L	Necessary	\$ 34.10	\$ 68.20	\$ ✓ 68.20
5	1 pc	Rr windscreen moulding lower	Necessary		\$ 47.30	\$ ✓ 47.30
6	1 pc	Tailgate no.plate garnish	Dented/Repair		\$ 905.10	\$ ✗ -
7	1 pc	Tailgate emblem (Logo)	Necessary		\$ 61.00	\$ ✓ 61.00
8	1 pc	Tailgate emblem (CH-R)	Necessary		\$ 44.70	\$ ✓ 44.70
9	1 pc	Tailgate emblem (Hybrid)	Necessary		\$ 47.00	\$ ✓ 47.00
10	1 pc	Tailgate inner trim	Refit		\$ 288.70	\$ ✗ -
11	1 pc	Tailgate lock assy	Dented/Damaged		\$ 458.50	\$ 389 ✓ 458.50
12	1 pc	Tailgate weatherstrip	Torn/Necessary		\$ 328.90	\$ ✓ 328.90
13	2 pcs	Taillamp R/L <i>7th MEC.</i>	RH Cracked	\$ 652.10	\$ 1,304.20	\$ ✗ 652.10
14	1 pc	Rr bumper	Dented		\$ 720.60	\$ ✓ 720.60
15	1 pc	Rr bumper lower trim	Dented		\$ 389.10	\$ ✓ 389.10
16	1 pc	Rr bumper tow cover	Missing		\$ 17.30	\$ ✓ 17.30
17	4 pcs	Rr bumper ultrasonic sensor	Dented/Damaged	\$ 378.00	\$ 1,512.00	2pcs \$ 600 <del>756.00</del>
18	1 pc	Rr bumper fog lamp cover	Dented/Cracked		\$ 68.10	\$ ✓ 68.10
19	2 pcs	Rr bumper reflector R/L <i>7th MEC.</i>	Refit	\$ 58.80	\$ 117.60	\$ ✗ -
20	2 pcs	Rr bumper reflector garnish R/L <i>7th MEC.</i>	RH Cracked	\$ 88.80	\$ 177.60	\$ ✗ 88.80
21	8 pcs	Rr bumper clip	Cracked/Necessary	\$ 3.20	\$ 25.60	\$ ✓ 25.60
22	2 pcs	Rr bumper support R/L	Cracked/Necessary	\$ 80.70	\$ 161.40	\$ ✓ 161.40
23	1 pc	Rr bumper reinforcement	Dented		\$ 326.00	\$ ✓ 326.00
24	1 pc	Rr end panel	Dented/Distorted		\$ 762.10	\$ ✓ 762.10
25	1 pc	Rr end panel garnish <i>7th MEC.</i>	Refit		\$ 249.90	\$ ✗ -
26	1 pc	Rr blind spot monitor sensor RH	Dented/Damaged		\$ 1,962.40	\$ ✗ 1,962.40
27	1 pc	Rr floor panel	Dented/Repair		\$ 572.10	\$ ✗ -
28	1 pc	Rr exhaust silencer	Dented		\$ 1,455.70	\$ 987 ✓ 1,455.70
29	2 pcs	Rr fender R/L	Dented/Repair			(Refer labour no. 4, 7 & 8)
30	1 pc	Rr floor panel	Dented/Repair			(Refer labour no. 4, 7 & 8)
31	2 pcs	Rr chassis member R/L	Dented/Repair			(Refer labour no. 4, 7 & 8)
					\$ 13,916.50	\$ 9,647.00
Less Discount : 25%					\$ 3,479.13	25% \$ 2,411.75
List Parts Sub-Total :					\$ 10,437.38	\$ 7,235.25
1	1 pc	Rr windscreen sealant	Necessary	80 S/N	\$ 50.00	\$ ✓ 40.00
2	1 pc	Rr end panel sealant	Necessary	80 S/N	\$ 50.00	\$ ✓ 40.00
Special Nett Sub-Total :					\$ 100.00	\$ 80.00
Parts Total :					\$ 10,537.38	\$ 7,315.25



# PROMINENT APPRAISER SERVICES PTE LTD

Qualified Loss Adjusters And Motor Appraisers  
Correspondence Mail Address: My Mail Box 886259 Singapore 919191.  
Mobile: 9295 2204 Fax: 6722 8508 Email: pasvcs@hotmail.com

Business Reg. 201404434D

Vehicle No : SLV1536G

Report No. : PAS/TP/0390722

S/No.	Labour Descriptions	Repairer's Estimate (S\$)	Our Assessment (S\$)
1	To remove and reinstall electrical wiring system for necessary repairs. To check rear electrical wiring system.	\$ 70.00	\$ <del>50.00</del> 30
2	To transfer rear windscreen to new tailgate.	\$ 120.00	\$ 120.00
3	To transfer tailgate component parts to new tailgate. (Include transfer tailgate spoiler & supply sealant/adhesive tape)	\$ 150.00	\$ <del>120.00</del> 80
4	To remove and reinstall rear interior trims, garnishes, etc. for necessary repairs.	\$ 100.00	\$ <del>80.00</del> 60
5	To straighten, repair, realign center exhaust pipe and replace exhaust silencer.	\$ 120.00	\$ 80.00
6	To remove, replace and/or transfer rear reverse sensors to new bumper. (Include replace RHR blind spot monitor and reset/reprogram control units)	\$ 250.00	\$ <del>220.00</del> 250
7	To straighten, repair, realign on affected area and replace damaged parts.	\$ 1,200.00	\$ <del>880.00</del> 800
8	To spray painting, blending on affected and adjacent area.	\$ 1,200.00	\$ <del>1,000.00</del> 800
9	To spray anti-rust coating on new and affected panels.	\$ 30.00	\$ 30.00
Labour Total :		\$ 3,240.00	\$ 2,580.00
Total (Parts & Labour) :		\$ 13,777.38	\$ 9,895.25

2220

### For Lump Sum Repairs

The final adjusted Lump Sum contract amount is \$ 7,920.00

Under normal circumstances, the repairs should be completed within a reasonable period of **8 Working Days**. (Exclude waiting days of PRI, Sunday, Public Holiday and awaiting of shipment for spare parts)

66 Photographs were taken at the time of inspection.

**N.B:** By accepting to carry out the repairs on a contract Lump Sum basis, the repairer shall have the prerogative and discretion to replace the damaged parts with new, used, OEM or reconditioned parts and/or to repair the vehicle on a roadworthy condition to the entire satisfaction of owner.

total: 6987.12  
4/5: 5.6K  
07 Days

*Note: The revised estimate has been adjusted from a visual inspection. Any discrepancies or unseen damages should be notified to the company within 7 days from the date hereof. Otherwise this revised amount shall be deemed as valid.*