

REC BY: T. J. M.

REF:

INC

ASSIGNMENT

From: _____ Date: _____

Estimated cost: _____

OD / TP / VS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: _____

at Workshop no: _____

of _____

Insured: _____

Policy No: _____

Claims No: _____


Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

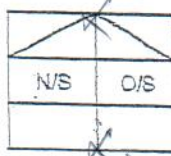

Bal. or Market Value: _____

IDAC Accident Report: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lump Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS WP

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SHF 362D Yr Regn: 2017, Dec

Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Toyota Prius C.D. 1798

Colour: Maroon A/C: Insured / Std / NI / NA

Sp. Reading: 57 5842 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: STOK B3F U603 576608

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 195/65R15

R: 2

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / DHTSU / PIR / SUMI /

TOYO / YOKO, etc. Gift

Front

R/Bal. 6 mm

L/Bal. 6 mm

D.O.A. _____ D.O.I. 19/01/23

Survey held at SMRT WL

Des. of Damages: Front / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Repair Limit \$17,500

Date/Time, File Pass to?

☐ : Prel. Report

1)

☐ : Final Report

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee: _____

Transportation: _____

S + RS. \$ _____

Photos _____

Others _____

Add Fee: ☐ : Site Insp (\$ _____)

☐ : Interview (\$ _____)

☐ : Tech. Invs (\$ _____)

☐ : Weekend (\$ _____)

Report Format: _____

Lump Sum / I.B.R. / ?

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission 26/02/2021 13:51 (SGT)
Exact Location of Accident 25/02/2021 13:05 (SGT)
Additional Location Information Lor 2 Toa Payoh, Singapore
Country/State of Loss Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SMH7584P
INSURED/POLICYHOLDER
Is company? No
Name Of Registered Owner KOH WEN CONG
NRIC No SXXXX218D
Email Address KOHWENCONG@GMAIL.COM
Mobile Phone No (Phone) +65-91088493
Alternative Phone No +65-91088493

VEHICLE PARTICULARS

Manufacturer Toyota
Model Corolla
Variant
Exact purpose for which vehicle was being used at time of accident Private use
Are you claiming under your own insurance policy for repair to No - Claiming third party
Vehicle Category Private car

INSURANCE COMPANY

Name of Insurance Company NTUC
Type of Coverage Comprehensive
Fleet Policy No
Policy Number 5116408895
Cover Note Number -

DRIVER

Name of Driver KOH WEN CONG
NRIC No SXXXX218D
Date Of Birth 03/09/1990
Occupation Indoor



Case Details

Case Reference Number : TAX/01/23/2044
 Type of Repair : Accident Repair
 Vehicle Registration Number : SHF362D

Company Type : Strides Taxi Pte Ltd
 Estimation ID : EST-20337-ID
 Assigned By : Taxi Claims Manager Team

Insurance Company Name : income insurance limited
 Accident Date and Time : 18/01/2023 08:50 AM
 Vehicle Age(In Months) : -

Documents / Photographs

[View Documents / Photographs](#)

Total Documents: 0

Estimation Details

Spare Part's Cost Detail

BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	SMRT Recommendation					Repair/ Replace	Surveyor Quantity	Surveyor Approval			Remarks
						List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Surveyor Final Price(\$)			Repair/Replace			
Standard	Main			COVER, FR BUMPER	1	560.30	560.30	25.00	420.22	Replace	1	420.22	Replace	▼	de	
Standard	Main			SUPPORT, FR BUMPER RH	1	86.20	86.20	25.00	64.65	Replace	1	64.65	Replace	▼	de	
Standard	Main			SUPPORT, FR BUMPER LH	1	86.20	86.20	25.00	64.65	Replace	1	64.65	Replace	▼	de	
Standard	Main			COVER, FR BUMPER RH	1	31.80	31.80	25.00	23.85	Replace	1	0.00	Repair	▼	Ry	
Standard	Main			COVER, FR BUMPER LH	1	31.80	31.80	25.00	23.85	Replace	1	0.00	Repair	▼	Ry	
Standard	Main			BRACKET, FR BUMPER	1	111.80	111.80	25.00	83.85	Replace	1	83.85	Replace	▼	de	
Standard	Main			NUMBER PLATE	1	35.00	35.00	0.00	35.00	Replace	1	35.00	Replace	▼	de	
Standard	Main			NUMBER PLATE FRAME	1	25.00	25.00	0.00	25.00	Replace	1	25.00	Replace	▼	bt	
Standard	Main			REINFORCEMENT FRONT UPPER	1	773.90	773.90	25.00	580.43	Replace	0	0.00	Check	▼	?	
Standard	Main			ABSORBER, FR BUMPER	1	85.90	85.90	25.00	64.43	Replace	1	64.43	Replace	▼	de	
Standard	Main			EXTENSION SUB-ASSY, LH	1	129.90	129.90	25.00	97.43	Replace	0	0.00	Check	▼	?	
Standard	Main			EXTENSION SUB-ASSY, RH	1	129.90	129.90	25.00	97.43	Replace	0	0.00	Check	▼	?	
Standard	Main			REINFORCEMENT FRONT LOWER	1	265.90	265.90	25.00	199.42	Replace	0	0.00	Check	▼	?	
Standard	Main			ABSORBER, FR BUMPER LOWER	1	143.60	143.60	25.00	107.70	Replace	0	0.00	Check	▼	?	
Standard	Main			SEAL, HOOD TO FR END	1	55.80	55.80	25.00	41.85	Replace	0	0.00	Check	▼	?	
Standard	Main			EMBLEM ASSY FRONT	1	98.70	98.70	25.00	74.03	Replace	1	74.03	Replace	▼	del	

Total Spare Part Cost 48,618.07

Surveyor Total 13,549.98

Lump Sum Discount (%) 20.00

Lump Sum Dis (%) 20.00

Final Spare Part Cost 38,894.46

Final Sur Total 10,839.98

BOM Type	Costing Type	Portion	Material Number	SMRT Recommendation							Surveyor Approval			
				Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
Standard	Main			GRILLE, RADIATOR	1	183.90	183.90	25.00	137.93	Replace	0	0.00	Check	?
Standard	Main			GRILLE SUB-ASSY	1	374.40	374.40	25.00	280.80	Replace	1	280.80	Replace	OK
Standard	Main			CLIPS PIECE, FRT & RR BUMPER	10	4.80	48.00	25.00	36.00	Replace	10	36.00	Replace	OK
Standard	Main			RETAINER, FR BUMPER, LH & RH	1	9.50	9.50	25.00	7.13	Replace	1	7.13	Replace	OK
Standard	Main			COVER ASSY, ENGINE	1	201.00	201.00	25.00	150.75	Replace	0	0.00	Check	?
Standard	Main			COVER ASSY, ENGINE UNDER CENTER SET	1	511.20	511.20	25.00	383.40	Replace	0	0.00	Check	?
Standard	Main			COVER, ENGINE UNDER SIDE RH	1	86.20	86.20	25.00	64.65	Replace	0	0.00	Check	?
Standard	Main			COVER, ENGINE UNDER SIDE LH	1	86.20	86.20	25.00	64.65	Replace	0	0.00	Check	?
Standard	Main			LAMP ASSY, FOG, RH	1	1,029.90	1,029.90	10.00	926.91	Replace	0	0.00	Check	?
Standard	Main			LAMP ASSY, FOG, LH	1	1,029.90	1,029.90	10.00	926.91	Replace	0	0.00	Check	?
Standard	Main			UNIT, HEADLAMP, LH	1	2,852.40	2,852.40	10.00	2,567.16	Replace	1	2,567.1	Replace	OK
Standard	Main			UNIT, HEADLAMP, RH	1	2,852.40	2,852.40	10.00	2,567.16	Replace	1	2,567.1	Replace	OK
Standard	Main			COMPUTER SUB-ASSY, HEADLAMP, LH NO.1	1	1,039.90	1,039.90	10.00	935.91	Replace	0	0.00	Check	?
Standard	Main			COMPUTER SUB-ASSY, HEADLAMP, RH NO.1	1	1,039.90	1,039.90	10.00	935.91	Replace	0	0.00	Check	?
Standard	Main			HOOD SUB-ASSY	1	1,066.30	1,066.30	25.00	799.72	Replace	1	799.72	Replace	OK
Standard	Main			INSULATOR, HOOD	1	444.40	444.40	25.00	333.30	Replace	1	333.30	Replace	OK
Standard	Main			COVER, RADIATOR	1	254.70	254.70	25.00	191.02	Replace	0	0.00	Check	?
Standard	Main			INSULATOR, HOOD CLIP	6	3.10	18.60	25.00	13.95	Replace	6	13.95	Replace	OK
Standard	Main			HINGE ASSY, HOOD, RH	1	63.70	63.70	25.00	47.78	Replace	1	47.78	Replace	OK
Standard	Main			HINGE ASSY, HOOD, LH	1	63.70	63.70	25.00	47.78	Replace	1	47.78	Replace	OK
Standard	Main			CABLE ASSY, HOOD	1	59.50	59.50	25.00	44.63	Replace	0	0.00	Check	?
Standard	Main			SUPPORT ASSY, HOOD	1	47.80	47.80	25.00	35.85	Replace	0	0.00	Not Give	OK
Standard	Main			HOLDER, HOOD STAY	1	18.60	18.60	25.00	13.95	Replace	0	0.00	Not Give	OK
Standard	Main			LEVER SUB-ASSY, HOOD	1	80.60	80.60	25.00	60.45	Replace	0	0.00	Not Give	OK
Total Spare Part Cost										48,618.07		Surveyor Total		
Lump Sum Discount (%)										20.00		Lump Sum Dis (%)		
Final Spare Part Cost										38,894.46		Final Sur Total		
												13,549.98		
												10,839.98		

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
Standard	Main			BOLT, HOOD LOCK	1	11.20	11.20	25.00	8.40	Replace	0	0.00	Not Give	Xun
Standard	Main			LOCK ASSY, HOOD	1	146.10	146.10	25.00	109.57	Replace	1	109.57	Replace	bt
Standard	Main			BRACE, HOOD LOCK SUPPORT	1	84.40	84.40	25.00	63.30	Replace	1	63.30	Replace	bt
Standard	Main			FRONT REINFORCEMENT SIDE RH	1	144.30	144.30	25.00	108.23	Replace	0	0.00	Check	?
Standard	Main			FRONT REINFORCEMENT SIDE LH	1	144.30	144.30	25.00	108.23	Replace	0	0.00	Check	?
Standard	Main			FRONT PLATE, FR SUSPENSION	1	10.50	10.50	25.00	7.88	Replace	0	0.00	Check	?
Standard	Main			SUPPORT S/A UPPER,	1	408.50	408.50	25.00	306.38	Replace	1	306.38	Replace	bt
Standard	Main			SUPPORT S/A RH	1	265.10	265.10	25.00	198.83	Replace	1	198.83	Replace	bt
Standard	Main			SUPPORT S/A LH	1	265.10	265.10	25.00	198.83	Replace	1	198.83	Replace	bt
Standard	Main			SUPPORT SUB-ASSY LOWER	1	443.50	443.50	25.00	332.63	Replace	0	0.00	Check	?
Standard	Main			SUPPORT, RADIATOR UPPER RH	1	85.20	85.20	25.00	63.90	Replace	1	63.90	Replace	bt
Standard	Main			SUPPORT, RADIATOR UPPER LH	1	85.20	85.20	25.00	63.90	Replace	1	63.90	Replace	bt
Standard	Main			WIPER WASHER INLET	1	72.30	72.30	25.00	54.22	Replace	0	0.00	Check	?
Standard	Main			WIPER WASHER JAR	1	236.90	236.90	25.00	177.68	Replace	0	0.00	Check	?
Standard	Main			MOTOR AND PUMP ASSY, WINDSHIELD WASHER	1	316.40	316.40	10.00	284.76	Replace	0	0.00	Not Give	Xun
Standard	Main			GUIDE, RADIATOR AIR,	1	122.10	122.10	25.00	91.57	Replace	1	91.57	Replace	de
Standard	Main			SEAL, RADIATOR GRILLE	2	45.50	91.00	25.00	68.25	Replace	0	0.00	Check	?
Standard	Main			WIPER GARNISH LOUVER SUB-ASSY	1	742.70	742.70	25.00	557.03	Replace	0	0.00	Check	?
Standard	Main			WIPER GARNISH SHIELD, COWL WATER , RH	1	21.30	21.30	25.00	15.98	Replace	0	0.00	Check	?
Standard	Main			WIPER GARNISH SHIELD, COWL WATER , LH	1	21.30	21.30	25.00	15.98	Replace	0	0.00	Check	?
Standard	Main			SEAL, RADIATOR TO RH	1	32.10	32.10	25.00	24.08	Replace	0	0.00	Check	?
Standard	Main			SEAL, RADIATOR TO LH	1	32.10	32.10	25.00	24.08	Replace	0	0.00	Check	?
Standard	Main			GUIDE, RADIATOR AIR , RH	1	70.70	70.70	25.00	53.03	Replace	0	0.00	Check	?
Total Spare Part Cost									48,618.07	Surveyor Total 13,549.98				
Lump Sum Discount (%)									20.00	Lump Sum Dis (%)				
Final Spare Part Cost									38,894.46	Final Sur Total 10,839.98				

SMRT Recommendation										Surveyor Approval				
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
Standard	Main			GUIDE, RADIATOR AIR , LH	1	75.90	75.90	25.00	56.93	Replace	0	0.00	Check	?
Standard	Main			GROMMET (FOR RADIATOR LOWER SUPPORT)	2	16.60	33.20	25.00	24.90	Replace	0	0.00	Check	?
Standard	Main			CUSHION, (FOR RADIATOR UPPER SUPPORT)	2	12.80	25.60	25.00	19.20	Replace	0	0.00	Check	?
Standard	Main			GUIDE, RADIATOR AIR , UPPER	1	57.90	57.90	25.00	43.43	Replace	0	0.00	Check	?
Standard	Main			RADIATOR ASSY	1	2,397.40	2,397.40	25.00	1,798.05	Replace	0	0.00	Check	?
Standard	Main			FAN RADIATOR , RH	1	304.10	304.10	25.00	228.08	Replace	0	0.00	Check	?
Standard	Main			FAN RADIATOR , LH	1	236.90	236.90	25.00	177.68	Replace	0	0.00	Check	?
Standard	Main			FAN SHROUD RADIATOR	1	286.80	286.80	25.00	215.10	Replace	0	0.00	Check	?
Standard	Main			MOTOR, COOLING FAN , RH	1	579.90	579.90	10.00	521.91	Replace	0	0.00	Check	?
Standard	Main			MOTOR, COOLING FAN , LH	1	708.40	708.40	10.00	637.56	Replace	0	0.00	Check	?
Standard	Main			COOLANT	4	12.32	49.28	0.00	49.28	Replace	0	0.00	Check	?
Standard	Main			AIR CON COMPRESSOR ASSY	1	5,160.70	5,160.70	25.00	3,870.52	Replace	0	0.00	Not Give	Run
Standard	Main			TUBE & ACCESSORY	1	751.00	751.00	25.00	563.25	Replace	0	0.00	Check	?
Standard	Main			AIR CON CONDENSER ASSY	1	1,928.00	1,928.00	25.00	1,446.00	Replace	0	0.00	Check	?
Standard	Main			HOSE SUB-ASSY, DISCHARGE	1	436.20	436.20	25.00	327.15	Replace	0	0.00	Check	?
Standard	Main			HOSE SUB-ASSY, SUCTION	1	699.80	699.80	25.00	524.85	Replace	0	0.00	Check	?
Standard	Main			PIPE SUB-ASSY, SUCTION	1	504.10	504.10	25.00	378.08	Replace	0	0.00	Check	?
Standard	Main			BRACKET, COOLER REFRIGERANT HOSE, NO.1	1	17.20	17.20	25.00	12.90	Replace	0	0.00	Check	?
Standard	Main			BRACKET, COOLER REFRIGERANT HOSE, NO.2	1	24.50	24.50	25.00	18.38	Replace	0	0.00	Check	?
Standard	Main			INLET, AIR CLEANER, NO 3	1	45.60	45.60	25.00	34.20	Replace	1	34.20	Replace	one ✓
Standard	Main			INLET, AIR CLEANER, NO 2	1	122.10	122.10	25.00	91.57	Replace	1	91.57	Replace	one ✓
Total Spare Part Cost									48,618.07	Surveyor Total		13,549.98		
Lump Sum Discount (%)									20.00	Lump Sum Dis (%)				
Final Spare Part Cost									38,894.46	Final Sur Total		10,839.98		

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
Standard	Main			INLET, AIR CLEANER, NO 1	1	168.40	168.40	25.00	126.30	Replace	1	126.30	Replace	ma ✓
Standard	Main			CLAMP (FOR AIR CLEANER INLET, NO.1)	2	9.30	18.60	25.00	13.95	Replace	0	0.00	Check	?
Standard	Main			HOSE, AIR CLEANER, NO.1	1	80.30	80.30	25.00	60.22	Replace	0	0.00	Check	?
Standard	Main			CLAMP (FOR AIR CLEANER INLET, NO.1)	2	9.30	18.60	25.00	13.95	Replace	0	0.00	Check	?
Standard	Main			CLAMP (FOR AIR CLEANER HOSE, NO.2)	1	11.70	11.70	25.00	8.77	Replace	0	0.00	Check	?
Standard	Main			TUBE, UNION (FOR AIR CLEANER HOSE)	1	25.30	25.30	25.00	18.98	Replace	0	0.00	Check	?
Standard	Main			RESONATOR, INTAKE AIR	1	16.70	16.70	25.00	12.52	Replace	0	0.00	Check	?
Standard	Main			CLAMP (FOR RESONATOR INTAKE AIR)	1	9.30	9.30	25.00	6.98	Replace	0	0.00	Check	?
Standard	Main			BRACKET, AIR CLEANER	1	34.80	34.80	25.00	26.10	Replace	0	0.00	Check	?
Standard	Main			AIR CLEANER ASSY	1	1,242.00	1,242.00	25.00	931.50	Replace	1	931.50	Replace	ma ✓
Standard	Main			BATTERY	1	1,584.90	1,584.90	10.00	1,426.41	Replace	0	0.00	Not Give	Xun
Standard	Main			WIRE, ENGINE ROOM MAIN	1	7,942.90	7,942.90	10.00	7,148.61	Replace	0	0.00	Not Give	Xun
Standard	Main			WIRE, ENGINE, NO.3	1	335.10	335.10	10.00	301.59	Replace	0	0.00	Not Give	Xun
Standard	Main			WIRE, AIR CONDITIONER	1	576.30	576.30	10.00	518.67	Replace	0	0.00	Not Give	Xun
Standard	Main			FENDER SUB-ASSY, FR, RH	1	1,060.70	1,060.70	25.00	795.53	Replace	1	795.53	Replace	bt ✓
Standard	Main			EMBLEM, SIDE PANEL (HYBRID)	1	59.10	59.10	25.00	44.33	Replace	1	44.33	Replace	wh ✓
Standard	Main			LINER, FR FENDER, RH	1	223.50	223.50	25.00	167.63	Replace	0	0.00	Check	?
Standard	Main			PAD, FR WHEEL RH	1	65.00	65.00	25.00	48.75	Replace	0	0.00	Check	?
Standard	Main			FENDER SUB-ASSY, FR, LH	1	1,060.70	1,060.70	25.00	795.53	Replace	1	795.53	Replace	bt ✓
Standard	Main			EMBLEM, SIDE PANEL (HYBRID)	1	59.10	59.10	25.00	44.33	Replace	1	44.33	Replace	wh ✓
Standard	Main			LINER, FR FENDER, LH	1	219.10	219.10	25.00	164.33	Replace	0	0.00	Check	?
Standard	Main			PAD, FR WHEEL LH	1	65.00	65.00	25.00	48.75	Replace	0	0.00	Check	?
Standard	Main			PANEL SUB-ASSY, FRONT DOOR LH	1	1,407.80	1,407.80	25.00	1,055.85	Replace	1	0.00	Repair	Rt
Total Spare Part Cost									48,618.07	Surveyor Total 13,549.98				
Lump Sum Discount (%)									20.00	Lump Sum Dis (%)				
Final Spare Part Cost									38,894.46	Final Sur Total 10,839.98				

SMRT Recommendation										Surveyor Approval				
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
Standard	Main			STICKER STRIDES TAXI (DOOR)	1	60.00	60.00	0.00	60.00	Replace	1	60.00	Replace	✓
Standard	Main			COVER, RR BUMPER ASSY	1	478.90	478.90	25.00	359.17	Replace	1	359.17	Replace	✓
Standard	Main			REAR BUMPER REINFORCEMENT	1	360.10	360.10	25.00	270.08	Replace	1	270.08	Replace	✓
Standard	Main			PAD, RR BUMPER, RH & LH, 1	2	4.30	8.60	25.00	6.45	Replace	2	6.45	Replace	✓
Standard	Main			PAD, RR BUMPER, RH & LH, 2	2	4.30	8.60	25.00	6.45	Replace	2	6.45	Replace	✓
Standard	Main			PAD, RR BUMPER, RH & LH, 3	2	4.30	8.60	25.00	6.45	Replace	2	6.45	Replace	✓
Standard	Main			PAD, RR BUMPER, CTR	1	2.50	2.50	25.00	1.88	Replace	1	1.88	Replace	✓
Standard	Main			SEAL, RR BUMPER ARM, RH & LH	1	12.30	12.30	25.00	9.23	Replace	1	9.23	Replace	✓
Standard	Main			STOPPER, RR BUMPER, RH & LH	1	4.80	4.80	25.00	3.60	Replace	0	0.00	Check	?
Standard	Main			RETAINER, RR BUMPER, RH	1	127.40	127.40	25.00	95.55	Replace	0	0.00	Check	?
Standard	Main			RETAINER, RR BUMPER, LH	1	127.40	127.40	25.00	95.55	Replace	1	95.55	Replace	✓
Standard	Main			SEAL, RR BUMPER, LH	1	95.50	95.50	25.00	71.63	Replace	0	0.00	Check	?
Standard	Main			CLIPS PIECE, FRT & RR BUMPER	10	4.80	48.00	25.00	36.00	Replace	10	36.00	Replace	✓
Standard	Main			GUARD, RR BUMPER, LOWER	1	623.50	623.50	25.00	467.63	Replace	1	467.63	Replace	✓
Standard	Main			FILLER, RR BUMPER, LH	1	168.60	168.60	25.00	126.45	Replace	1	126.45	Replace	✓
Standard	Main			COVER, GUARD RR BUMPER LOWER	1	16.70	16.70	25.00	12.52	Replace	1	12.52	Replace	✓
Standard	Main			SENSOR REVERSE	1	180.00	180.00	0.00	180.00	Replace	1	180.00	Replace	✓
Standard	Main			ANTENNA, ELECTRICAL KEY	1	78.00	78.00	25.00	58.50	Replace	0	0.00	Check	?
Standard	Main			REAR BUMPER GROMMET SCREW	1	2.20	2.20	25.00	1.65	Replace	0	0.00	Check	?
Standard	Main			LENS & BODY, REAR COMBINATION LAMP, LH	1	489.00	489.00	10.00	440.10	Replace	0	0.00	Check	?
Standard	Main			LENS & BODY ASSY, RR BUMPER, LH	1	544.40	544.40	10.00	489.96	Replace	0	0.00	Check	?
Standard	Main			COVER, REAR FLOOR UNDER, LH	1	261.60	261.60	25.00	196.20	Replace	0	0.00	Check	?
Total Spare Part Cost									48,618.07	Surveyor Total 13,549.98				
Lump Sum Discount (%)									20.00	Lump Sum Dis (%)				
Final Spare Part Cost									38,894.46	Final Sur Total 10,839.98				

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	Remarks
Standard	Main			COVER, REAR FLOOR UNDER, RH	1	189.20	189.20	25.00	141.90	Replace	0	0.00	Check	?
Standard	Main			COVER, REAR FLOOR UNDER CENTER	1	249.10	249.10	25.00	186.83	Replace	0	0.00	Check	?
Standard	Main			PANEL SUB-ASSY, FENDER REAR LH	1	943.10	943.10	25.00	707.33	Replace	0	0.00	Not Give	Xun
Standard	Main			LINER, REAR FENDER, LH	1	151.10	151.10	25.00	113.32	Replace	0	0.00	Check	?
Standard	Main			TAIL GATE PANEL SUB-ASSY, BACK DOOR	1	1,238.40	1,238.40	25.00	928.80	Replace	0	0.00	Not Give	Xun
Standard	Main			TAIL GATE WEATHERSTRIP, BACK DOOR	1	402.50	402.50	25.00	301.88	Replace	1	301.88	Replace	cut
Standard	Main			TAIL GATE BACK DOOR OUTSIDE GARNISH SUB-ASSY	1	992.30	992.30	25.00	744.22	Replace	1	0.00	Repair	Ry
Standard	Main			NAME PLATE (HYBRID), LUGGAGE COMPARTMENT DOOR	1	59.10	59.10	25.00	44.33	Replace	1	44.33	Replace	nee
Standard	Main			NAME PLATE (PRIUS), LUGGAGE COMPARTMENT DOOR	1	59.10	59.10	25.00	44.33	Replace	1	44.33	Replace	nee
Standard	Main			STRIDES LOGO	1	7.80	7.80	0.00	7.80	Replace	1	7.80	Replace	nee
Standard	Main			STICKER DECAL 6555 8888	1	21.60	21.60	0.00	21.60	Replace	1	21.60	Replace	nee
Standard	Main			END PANEL SUB-ASSY, BODY LOWER BACK	1	707.10	707.10	25.00	530.33	Replace	0	0.00	Check	?
Standard	Main			SPARE TYRE PANEL, PAN, REAR FLOOR	1	630.30	630.30	25.00	472.72	Replace	0	0.00	Not Give	Xun
Standard	Main			SEALANT SIKAFLEX	1	37.00	37.00	0.00	37.00	Replace	0	0.00	Check	?
Standard	Main			STICKER PETROL ONLY	1	7.80	7.80	0.00	7.80	Replace	0	0.00	Not Give	Xun
Total Spare Part Cost									48,618.07	Surveyor Total 13,549.98				
Lump Sum Discount (%)									20.00	Lump Sum Dis (%)				
Final Spare Part Cost									38,894.46	Final Sur Total 10,839.98				

Labour's Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO REPAIR FRONT PORTION	2,028.00	700.00	
2	Main	TO REPAIR REAR PORTION	1,690.00	500.00	
Total:			3,718.00	1,200.00	

Spray Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TO RESPRAY FRONT BUMPER	378.00	200.00	
2	Main	TO RESPRAY FRONT HOOD	378.00	200.00	
3	Main	TO RESPRAY FRONT SUPPORT PANEL	180.00	100.00	
4	Main	TO RESPRAY FRONT FENDER RH	378.00	200.00	
5	Main	TO RESPRAY FRONT FENDER LH	378.00	200.00	
6	Main	TO RESPRAY FRONT DOOR LH	378.00	200.00	
7	Main	TO RESPRAY REAR FENDER LH	378.00	0.00	
8	Main	TO RESPRAY TAIL GATE	378.00	0.00	
9	Main	TO RESPRAY TAILGATE OUTSIDE GARNISH	180.00	100.00	
10	Main	TO RESPRAY REAR SPARE TYRE PANEL	180.00	0.00	
11	Main	TO RESPRAY REAR PANEL	180.00	0.00	
12	Main	TO RESPRAY REAR BUMPER	378.00	200.00	
13	Main	TO RESPRAY BUMPER BEAM	180.00	0.00	
Total:			3,924.00	1,400.00	

Other Cost Detail

S.No.	Costing Type	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	Main	TOWING CHARGE	56.00	0.00	RQE INVIOCE
2	Main	TO WASH AND VACUUM	60.00	0.00	
3	Main	TO CHECK WIRING AND SYSTEM FUNCTION	120.00	30.00	
4	Main	TO APPLY RUST-PROOFING ON AFFECTED AREA	200.00	50.00	
5	Main	TO TOP UP A/C GAS	120.00	100.00	
6	Main	TO TEST AND REFIX REVERSE SENSOR SYSTEM	120.00	30.00	
7	Main	TO REPLACE SUNDRY PARTS	100.00	0.00	
8	Main	TO CONDUCT RADIATOR PRESSURE CHECK	120.00	0.00	
Total:			896.00	210.00	

Summary

	Estimator Assessment(\$)	Surveyor Assessment(\$)
Total Spare Part Detail	38,894.46	
Total Labour Cost	3,718.00	10,839.98
Total Spray Painting	3,924.00	1,200.00
Other	896.00	1,400.00
Overall Total	47,432.46	210.00
Lump Sum Repair Option		13,649.98
Lump Sum Total	47,450.00	☒
Surveyor Approved Amount		13,650.00
No of Repair Days*	16	13,650.00
Remarks		9
Surveyor Name		REQ NBV / AFTER PAINT PHOTOS, FOR CHECK ITEM and REPLACE ITEM. PLEASE CALL SURVEYOR TAUFIKH, HP 0740 67401 EMAIL: taufikh@lkkauto.com
Signature		Taufikh
Survey Date	19/01/2023	

Taufikh 97495749
 WP 19/1/23 @ 330pm
 L/S Repair after repair
 09 days
 Taufikh @ lkk auto.com

- LKK Auto Consultants** hence notify the Repairer of the following:
- To resurvey before/after spray painting
 - To display damaged part(s) during resurvey
 - Parts prices are subject to confirmation
 - Third party survey is on a "Without Prejudice" basis
 - No illegal modification(s) is allowed
 - Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Balance : 2 yrs 11 mth = 35 mths

Purchase Value: ~~1800~~ \$87059.59 - 3000

$\div 96$

= 875.62

$875.62 \times 35 = 30646.70$

$30646.70 + 3000 = 33646.70$

Nett Value: $33646.70 - 15877$

= \$17,769.70

Repair limit \$17,500

