

(09/11/13) wef

ASS. REC. BY: John

REF:

CS/AIS 23001045/Rvp3

8980

ASSIGNMENT

From:

Date:

Estimated Cost:

OB / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

SJS 300R

at Workshop m/s

PERFORMANCE

of

303, ALEXANDRA RD

Insured:

AIS

Policy No.

SP2003645106-01

Claims No.

202332004616

Sum Insured:

Excess:

FBA 0

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its

repair at the time of inspection.

Bal. or Market Value:

204K

IDAC Accident Rpt:

Consistent?: Yes or No

GIA / PR Seen:

Consistent?: Yes or No

Est. Repairs:

days

Res.:

Yes or No

Lum Sum:

%

3 Val.:

Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Date / Time

Action / Instruction

REPAIR LIMIT - 122K

6/6/23

Final fig \$20,752.10 confirmed by email (red 14,532.85, 41%)

Veh No:

SJS 300R

Yr Regn:

2020 / PSL

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

B.M.W 520I ADAP LED HL c.c 1998

Colour

Brown

A/C:

Insured / Std / NI / NA

Sp. Reading

48313

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

WBA72A1050WW98359

Gen. Cond: Good / Fair / Poor / Burnt

Steering: in order / Jammed / Leaked / Burnt orBrake: in order / Jammed / Leaked / Burnt orModi: Nil / SRim / STD / VRim or

Tyre Size:

F:

225/35R20

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal.

6

mm

Rear

R/Bal.

6

mm

L/Bal.

6

mm

L/Bal.

6

mm

D.O.A.

16/01/23

D.O.I.

06/02/23

Survey held at

PERFORMANCE

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date/Time, File Pass to?

☐

: Preli. Report

1)

☐

: Final Report

Date/Time, File Return to?

2) 7/6/23-typist

Days Of Repair: 10

Resurvey No. of Trip:

Survey Fee:

Transportation:

) S + RS, SI

) Photos

) Others

TOTAL

Report Format: Merimen

Lump Sum / I.B.I.: (\$ 20,752.10)

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech. Invs (\$

☐

: Weekend (\$

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	16/01/2023 18:36 (SGT)
Reported by	Driver
Date of Accident	16/01/2023 15:10 (SGT)
Exact Location of Accident	Singapore
Additional Location Information	WOODLANDS AVE 10 TOWARDS SEMBAWANG
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SJS300R
INSURED/POLICYHOLDER	
Is company?	No
Name Of Registered Owner	LYNETTE TAN LI PING
NRIC No	S1794878D
Email Address	simjaryl@gmail.com
Mobile Phone No	(Phone) +65-96818381
Alternative Phone No	-

VEHICLE PARTICULARS

Manufacturer	BMW
Model	520I ADAP LED HL
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Private car
Transmission	Auto
CC	1998

INSURANCE COMPANY

Name of Insurance Company	Allianz Insurance Singapore Pte. Ltd.
Policy Number / Cover Note Number	SP2003645106-01

DRIVER

Name of Driver	SIM HUI JIE, JARYL
NRIC No	S9036749H
Date Of Birth	02/10/1990
Occupation	Indoor

Date Of Driving Pass	10/03/2009
Driving experience	13 YEARS AND 10 MONTHS
Gender	Male
Mobile Number	(Phone) +65-92273000
Alt. Phone Number	-
Email Address	simjaryl@gmail.com
Address	8 CHENG SOON GARDEN
Address complement	-
Postcode	599788
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Child
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collision - Head to Rear
Weather Conditions	DRIZZLING
Road Surface	Wet

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	2
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No
Translator's name	-
Translator's ID	-
Translator's phone number	-
Translator's email	-
Original language used in the statement	-

PASSENGER 1

Name	SPOUSE
Gender	Female

DETAILS OF POLICE ACTION

Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

REFER SKETCH ATTACHED

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	Yes

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	GBJ5070M
Vehicle Manufacturer	-
Vehicle Model	-
Vehicle Variant	-

Vehicle Colour	-
Vehicle Category	Commercial vehicle
Name of Driver	SIM SWEE HONG
NRIC No	S1730081D
Contact Number	(Phone) +65-82448853
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

SKETCH PLAN

SJS 300R

ALLIANZ

DATE OF ACC 16/01/23 3:10PM

IMPORTANT NOTICE

1. Please read the important notice on the reverse of this form carefully.
2. The Policyholder's completion of this form is a condition for the claim to be paid.
3. Insurers' agents must ensure that the information provided is accurate and complete. Any false information provided may result in the claim being denied and the insurer's liability to compensate for the policyholder's loss.
4. The issue and acceptance of this form by the insurer's agent does not constitute an admission of liability by the insurer or the insurer's agent.
5. **Any false reporting may be referred to the Traffic Police Department for investigation.**
6. The report will be forwarded by the insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

E. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore (GIA) may be permitted to collect, use, disclose and/or process my personal data/personal information set out in this form and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurers who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police) for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims, including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes").
- (b) All insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms may be permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) My Personal Information may be disclosed by any of the Insurers and/or GIA to their third-party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

16/1/2023

16/1/23

Policyholder's Signature / Date & Time

Driver's Signature (if driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Person (Name as in RUCID card)

Sketch Plan

PLEASE TURN OVER

Describe Circumstances of the Accident


NOTE: PLEASE TAKE NOTE THAT ALL CLAIMS MUST BE MADE WITHIN 30 DAYS OF THE ACCIDENT DATE.

Claim under your Own Comprehensive policy. Pls check your policy for more information.

☐ Claim Own Policy ☐ Claim Third party ☐ Reporting Only

☒ Claim OF TP at other workshop ()

Sketch Plan

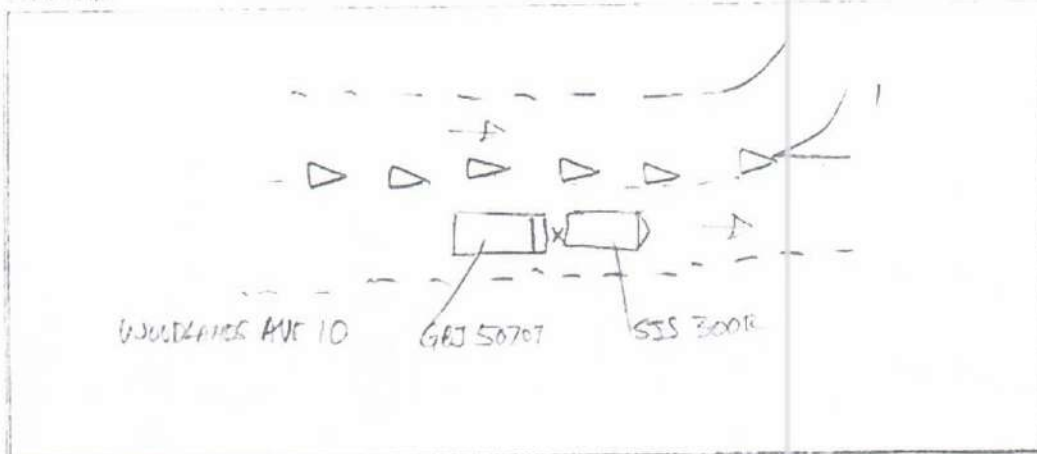

WE were traveling along woodlands Ave 10 going towards the to Food Xchange @ Admiralty. It was red light so we stop at the car. It was drizzling. Once we come to a stop, about a few seconds later, we felt a bang at the boot of the car and saw that a lorry (GBJ 50707) has barged us / hit us from behind and caused damage to our car.

Declaration

(We declare the foregoing particulars are true in every respect)

Policyholder's Signature, Type & Date

Driver's Signature (must be in full policy card) Type & Date

Witnessed by Reporting Centre Person (Name in full on ID card) Type & Date

Performance Motors Limited

A Sime Darby Motors Company
Co. Reg. No. 197401559W GST Reg. No M2-0020081-X
Toll-Free Number (1800-2255269)

303, Alexandra Road
Sime Darby Performance Centre
Singapore 159941
Fax. 64747770

280, Kampong Arang Road
East Coast Centre
Singapore 438180
Fax. 63449773

315, Alexandra Road
Sime Darby Business Centre
Singapore 159944
Fax. 64796501 (AfterSales)
64796524 (Motorrad)



GST REG. NO : M2 - 0020081 X

E S T I M A T E

20 JAN 2023

Estimate No. : b1 64751
Date Estimated : 20/01/2023
Prepared By : Inthiran A/L Thurasamy

Page No. : 1 of 5

- ESTIMATE REPAIR FOR -

Lynette Tan Li Ping
8 Cheng Soon Garden

- ACCOUNT -

40000

Cash Sales - Service
Singapore

Singapore 599788

REGN. NO.	CHASSIS NO.	REGN. DATE	MODEL
SJS300R	WBA72AG050WW98359	28/12/2020	520i Sedan

MILEAGE
38286

DESCRIPTION

To replace rear bumper, boot lid, tail panel, knocking and pulling rear left rear left fender. ~~850 X 7~~

To painting rear bumper, boot lid, tail panel, rear rh fender.

To remove and install rear hat-tray, rear seat, carpet and roof top lining to facilitate repair.

To remove and install boot compartment carpet and garnish to facilitate repair.

To check electrical wiring system and lighting at the rear section for proper function.

To remove old PDC assembly, replace damaged parts and reconnect to new bumper including conduct check for proper function.

To replace bootlid smart opener control unit, top and bottom sensor line including program and conduct check for proper function.

To carry out body cavity preservation.
(Per panel).

To carry out body cavity preservation.
(For cut panel).

Sundries.

VALUE6800 ~~5950~~ 7,650.003323 ~~2823~~ 3,857.00

nn X 873.00

~~257~~ 271.00~~168~~ 177.00~~168~~ 177.00

X11 627? 681.00

~~112~~ 118.00~~504~~ 531.00~~150.00~~

Total Labour 1: 14,465.00

DESCRIPTION

COMPLETE TAIL TRIM
TAILGATE ALUMINIUM

QTY**PRIC****VALUE**

1

890.05

890.05

1

1,901.25

1,901.25

Performance Motors Limited

A Sime Darby Motors Company
Co. Reg. No. 197401559W GST Reg. No M2-0020081-X
Toll-Free Number (1800-2255269)

303, Alexandra Road
Sime Darby Performance Centre
Singapore 159941
Fax: 64747770

280, Kampong Arang Road
East Coast Centre
Singapore 438180
Fax: 63449773

315, Alexandra Road
Sime Darby Business Centre
Singapore 159944
Fax: 64796601
64796626



GST REG. NO : M2 - 0020081

ESTIMATE

LKK Auto Consultants hence notify

the Repairer of the following:

- To resurvey before/after spray painting
- To inspect damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature: Page No. : 2 of 5

Date:

Estimate No. : b1 64751
Date Estimated : 20/01/2023
Prepared By : Inthiran A/L Thurasamy

REGN. NO.	CHASSIS NO.	REGN. DATE	MODEL	MILEAGE
SJS300R	WBA72AG050WW98359	28/12/2020	520i Sedan	38286

DESCRIPTION	QTY	PRIC	VALUE
LH TRUNK LID HINGE <i>7bf</i>	1	134.75	✓134.75
RH TRUNK LID HINGE <i>7bf</i>	1	134.75	✓134.75
REAR BUMPER CARRIER <i>7bf</i>	1	608.95	✓608.95
REAR BUMPER TRIM STRIP <i>scf</i>	1	80.10	✓80.10
REAR BUMPER BOTTOM TRIM PANEL <i>scf</i>	1	317.05	✓317.05
REAR CENTRE GUIDE <i>7bf</i>	1	179.90	✓179.90
REAR LH GUIDE <i>7bf</i>	1	179.90	✓179.90
REAR BUMPER BOTTOM REINFORCEMENT <i>7bf</i>	1	171.90	✓171.90
REAR BUMPER TRIM PANEL (PDC/PMA) <i>7bf</i>	1	1,664.50	✓1,664.50
EMBLEM GROMMET <i>7bf</i>	2	0.95	✓1.90
LETTERING 520i <i>7bf</i>	1	65.60	✓65.60
PLAQUE 74MM <i>7bf</i>	1	72.85	✓72.85
BOOT LID/TAILGATE PUSH BOTTON (RFK) <i>7bf</i>	1	39.95	✓39.95
LOCK TRUNK LID <i>7bf</i>	1	233.75	✓233.75
LOADING SILL COVER <i>7bf</i>	1	100.65	✓100.65
REAR SILENCER HEAT INSULATOR <i>7bf</i>	1	193.80	✓193.80
UNDERBODY PANELLING REAR <i>7bf</i>	1	51.20	✓51.20
PLUG BLACK D=5MM <i>7bf</i>	6	0.95	✓5.70
CONTROL UNIT SMART OPENER <i>7bf</i>	1	514.25	✓514.25
SENSOR LEAD SMART OPENER TOP <i>7bf</i>	1	53.50	✓53.50
SENSOR LEAD SMART OPENER BOTTOM <i>7bf</i>	1	53.50	✓53.50
REAR LH LIGHT TAILGATE LED <i>7bf</i>	1	408.00	✓408.00
REAR LH LIGHT SIDE PANEL LED <i>7bf</i>	1	582.85	✓582.85
REAR RH LIGHT SIDE PANEL LED <i>7bf</i>	1	582.85	✓582.85
REAR RH LIGHT TAILGATE LED <i>7bf</i>	1	390.25	✓390.25
LH GUTTER STRIP <i>7bf</i>	1	48.80	✓48.80
RH GUTTER STRIP <i>7bf</i>	1	48.80	✓48.80
BLIND RIVET AVIBVLB <i>7bf</i>	40	0.55	✓22.00
SCREW (SF PLUS M5X15) <i>7bf</i>	5	0.60	✓3.00
(DG) CLEANER R1 (100ML) <i>7bf</i>	1	26.15	✓26.15
PUNCH RIVET N4 <i>7bf</i>	25	0.55	✓13.75
(DG/SL) BODY ADHESIVE K5 (195 ML) <i>7bf</i>	1	364.15	✓364.15
(SL/DG) SEALANT D2 290ML <i>7bf</i>	1	32.10	✓32.10

Total Parts : 10,172.45

Claims OD / 3rd Party / Uninsured losses / Direct Settlement

Regn No. Claim No.

Date & Time 06/02/23 @ 10:20 Excess \$3

Surveyor's Name RASME Sign

Surveyor's Tel 90010067 Authorised Yes (No)

Authorised Date Time

RESURVEY PARTS PHOTO BY SURVEYOR Yes / No PML Yes / No

Surveyor's E-mail

No. of Working Days Recommend 10 days

Labour 1	:	14,465.00
Parts	:	10,172.45
Labour 2	:	0.00
Excess	:	0.00
Total GST @ 8%	:	1,971.00
Grand Total	:	26,608.45



** THIS ESTIMATE IS VALID FOR A PERIOD OF 30 DAYS ONLY **
** PRICE FOR PARTS ARE SUBJECTED TO CHANGE WITHOUT PRIOR NOTICE **

Performance Motors

BMW Dealer



Supplementary

Estimate No. : b1 64751
Date Estimated : 20/01/2023
Prepared By : Inthiran A/L Thurasamy

Page No. :

- ESTIMATE REPAIR FOR -

Lynette Tan Li Ping
8 Cheng Soon Garden

Singapore 599788

- ACCOUNT - 224093

Allianz Insurance Singapore Pte. Ltd.
79 Robinson Road
#09-01
Singapore 068397

REGN. NO.	CHASSIS NO.	REGN. DATE	MODEL	M LEAGE
SJS300R	WBA72AG050WW98359	28/12/2020	520i Sedan	38286

DESCRIPTION	ORIGINAL PRICE	DISC. %	NETT
-------------	----------------	---------	------

** To replace rear bumper and attachments, tail end panel, boot lid, LH/RH trunk lid hinges, rear centre guide, rear underbody panelling, rear LH/RH tailgate LED lights, rear LH/RH side panel LED lights include making good the trunk floor plate and knocking out dents caused by the accident

6,800.00 0.00 6,800.00

* To spray paint rear bumper, boot lid, tail end panel, LH/RH trunk lid hinges and trunk floor plate

3,323.00 0.00 3,323.00

* To transfer lock mechanism from old to new boot lid include conducting checks on new boot lid central locking system for proper function

504.00 0.00 504.00

DESCRIPTION	UNIT PRICE	QTY	DISC. %	NETT
-------------	------------	-----	---------	------

# EXPANDING NUT	2.85	2.00	0.00	5.70
# EXPANDING NUT	1.05	2.00	0.00	2.10
# GROMMET	0.80	2.00	0.00	1.60
# SNAP LOCKING COUPLING	0.95	1.00	0.00	0.95
# SNAP LOCKING COUPLING	0.95	3.00	0.00	2.85

SUPPLEMENTARY ITEMS

Total Labour :	10,627.00
Total Parts :	13.20
Total Labour & Parts (before GST) :	10,640.20

Performance Motors Limited.
Sime Darby Performance Centre, 303 Alexandra Road

Tel: 1800-2255-269
Co Reg No. 197401559W

A Sime Darby Motors Company