



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2302810

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 05/05/2023
Reference CC3/CTI23001188/Sya3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SHC 3332L
Insured Veh. GZ 7291K
Claim No. SNM23D200509/C02
Policy No. DMCVNSNW00011552200
Accident Date 17/01/2023
Inspection Date 18/01/2023

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC3/CTI23001188/Sya3q2 Date: 05/05/2023 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GZ 7291K	Veh. Inspected	SHC 3332L	
Policy No.	DMCVNSNW00011552200	Coverage (\$)	0.00	
Claim No.	SNM23D200509/C02	Excess (\$)	0.00	
Assign From		Assign Date	18/01/2023	
2. Vehicle Particulars & Condition				
Make & Model	HYUNDAI IONIQ	c.c	1580	
Engine No.	HIDDEN	Year of Reg.	2019	
Chassis No.	KMHC851CVKU134059	Colour	BLUE	
Odometer	438317 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	WEST LAKE	5 mm	
L/H Front Tyre	195/65 R15	WEST LAKE	5 mm	
R/H Rear Tyre	195/65 R15	WEST LAKE	5 mm	
L/H Rear Tyre	195/65 R15	WEST LAKE	5 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	17/01/2023	Inspection Date	18/01/2023	
Survey held at	COMFORTDELGRO ENGINEERING PTE LTD 59 LOYANG DRIVE SINGAPORE 508969			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 3332L

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BUMPER	SCRATCHED	459.40	459.40
1	REAR BUMPER REINFORCEMENT	NOT NECESSARY	394.80	-
2	REAR BUMPER REINFORCEMENT BRACKET LH/RH @ \$138.10	NOT NECESSARY	276.20	-
2	REAR BUMPER SIDE BRACKETS LH/RH @\$55.80	NOT NECESSARY	111.60	-
1	REAR BUMPER CENTRE MOULDING	CRACKED	451.25	451.25
1	REAR BUMPER LOWER CENTRE MOULDING	SCRATCHED	155.00	155.00
1	REAR BUMPER TOW COVER	NOT NECESSARY	98.80	-
2	REAR BUMPER REFLECTOR LH/RH @\$41.45	SCRATCHED	82.90	82.90
10	REAR BUMPER CLIPS @\$2.20	NECESSARY	22.00	22.00
1	REAR SMART KEY ANTENNA	NOT NECESSARY	40.50	-
1	REAR FOGLAMP	NOT NECESSARY	201.50	-
1	BOOTLID	DENTED	2,549.70	2,549.70
1	BOOTLID (HYBRID)	NECESSARY	24.30	24.30
1	BOOTLID (LONIQ)	NECESSARY	31.30	31.30
1	BOOTLID (H EMBLEM)	NECESSARY	28.00	28.00
1	BOOTLID SPOILER	NOT NECESSARY	665.40	-
1	BOOTLID THIRD BRAKE LAMP	NOT NECESSARY	385.60	-
1	BOOTLID LOWER GLASS (BLACK)	BROKEN	584.90	584.90
2	BOOTLID LAMP LH/RH @\$822.00	NOT NECESSARY	1,644.00	-
2	BOOTLID RH/LH @\$935.40	NOT NECESSARY	1,870.80	-
	LESS 20% DISCOUNT		-2,015.59	-877.75
			8,062.36	3,511.00
<u>SPECIAL NETT ITEMS</u>				
1	REVERSE SENSOR (SN)	SCRATCHED	180.00	180.00
1	REAR NO PLATE WITH TRIM COVER (SN)	CRACKED	55.00	55.00
1	BOOTLID (COMFORTDELGRO) (SN)	NECESSARY	30.00	30.00
1	BOOTLID (65521111) (SN)	NECESSARY	30.00	30.00
1	BOOTLID (ZIG) (SN)	NECESSARY	40.00	40.00
1	BOOTLID ADV STICKER (SN)	NECESSARY	100.00	100.00
2	REAR FENDER ADV .STICKER RH/LH @\$100.00 (SN)	NECESSARY	200.00	200.00

Report Ref No. CC3/CTI23001188/Sya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	REAR WINDSCREEN SEALANTS @\$46.00(SN)	NECESSARY	92.00	92.00
			727.00	727.00
	LABOUR			
	PANEL BEATING.		1,200.00	700.00
	SPRAY PAINTING CHARGE.		600.00	500.00
	REMOVE/REFIX REVERSE SENSOR .		120.00	30.00
	CHECK LIGHTINGS,		60.00	30.00
	TUFF KOTE.	NOT NECESSARY	60.00	-
	R/I WINDSCREEN GLASS .		240.00	240.00
	TOWING FEE.		60.00	60.00
			2,340.00	1,560.00
GRAND TOTAL			11,129.36	5,798.00
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				4,650.00

Report Ref No. CC3/CTI23001188/Sya3q2

S MOHAMED IRFAN BIN MOHAMED IQBAL

Asst. Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHC 3332L

INSPECTION

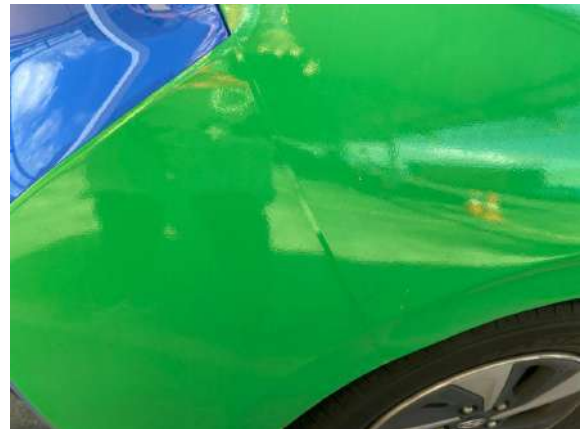




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

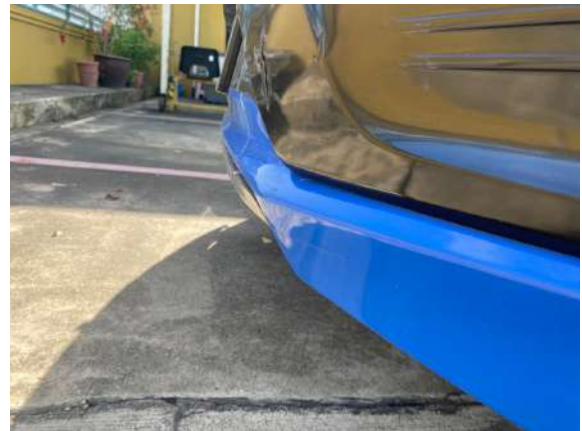




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

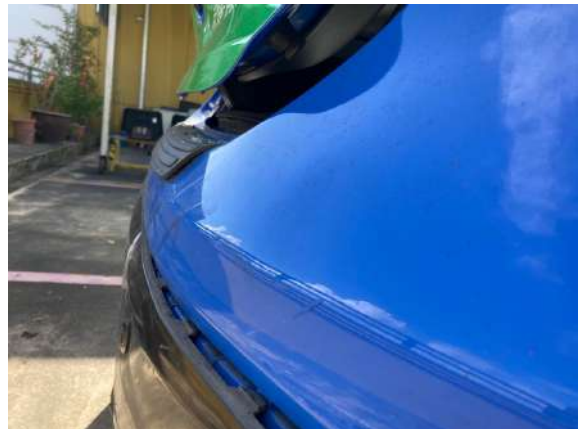




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

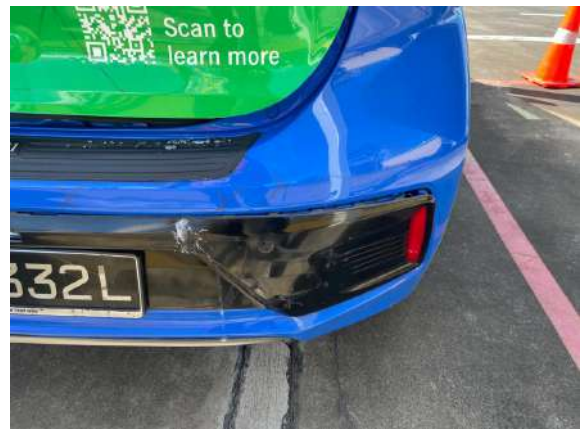



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

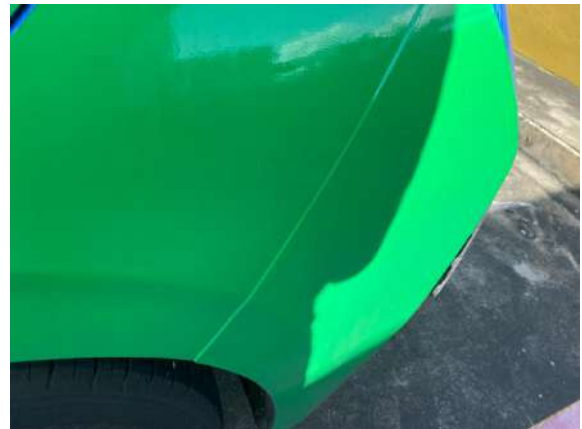



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHC 3332L

RE-INSPECTION

