

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: SLD 996STat Workshop m/s MOVAof FRN 400thInsured: AB

Policy No. _____

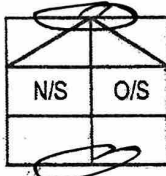
Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.Bal. or Market Value: 59k

IDAC Accident Report: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lam Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Date / Time Action / Instruction

Repair 4m 11 - 28kVeh No: SLD 996ST Yr Regn: 2016 JulyType: (M) Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: TOYOTA WEL 1.8 Cvt c.c. 1798Colour: MAROON A/C: Insured / Std / NI / NASp. Reading: 104299 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: JD DG 20W 70J 004521Gen. Cond: Good / Fair / Poor / BurntSteering: (In) order / Jammed / Leaked / Burnt orBrake: (In) order / Jammed / Leaked / Burnt orModi: Nil / S/Rim / STD A/Rim orTyre Size: F: 195/65R15R: -

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / (YOKO) or

Front

Rear

R/Bal. 6 mm R/Bal. 6 mmL/Bal. 6 mm L/Bal. 6 mmD.O.A. 23/01/23 D.O.I. 02/02/23Survey held at MOVA CFYDes. of Damages (F) / (R) / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date/Time, File Pass to?



: Preli. Report

1)

Date/Time, File Return to?



: Final Report

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee: _____

Transportation: _____

S + RS, SI

Photos

Others

Add Fee: ☐ : Site Insp (\$ _____)☐ : Interview (\$ _____)☐ : Tech. Invs (\$ _____)

Report Format : _____

Lump Sum / I.B.I. (\$) _____

Main Office : No. 22, Jalan Kilang, Singapore 159419
Tel: 6476 3333 Fax: 6271 5891

Service Centre : Block 100B, Bukit Merah Lane 3,
#01-04/06/08/115, Singapore 159722
Tel: (65) 6476 3333 (8 Lines) **Fax:** (65) 6270 8314
www.mova.com.sg
GST Reg. No: M2-0088884-2

Mova Spray Centre
2K Oven Spray Painting System

Power-M Automotive Pte Ltd
Specialise In Car Air-con Services,
Car Audio & Hi-Fi System.

Hilton Car Rental Centre

Hilton Auto Trading
Dealing In New/Used Cars, Hire Purchase & Insurance.



**TP INSURER:
UNKNOWN**

Allianz Insurance Singapore Pte. Ltd. (HQ)

Singapore

PARTICULARS OF CLAIM

Claim Type:	THIRD PARTY	Ref. No:	
Policy No:		Date of Loss:	23/01/2023
Vehicle Reg. No.:	SLD9965T	Driveable?	
Party At Fault:	UNKNOWN		
Make/Model:	TOYOTA WISH, 1.8 CVT (A)	Vehicle Reg. Date:	04/07/2016
Vehicle Colour:	RED		
Engine No:	2ZR1790344	Chassis No:	JTDGG20W70J004521
Odometer:	0 KM		
Paint Type:			
Total Loss?	NO		
Est. Duration of Repair (day)	15		
Present Location:	MOVA AUTOMOTIVE PTE LTD (BUKIT MERAH)		

COST OF CLAIMS

Parts	10,444.50
Miscellaneous Items	500.00
Labour	5,330.00
Paintwork Labour	0.00
Towing	0.00
Gross Total (\$)	16,274.50
+ GST 8.00% (\$)	1,301.96
Nett Amount (\$)	17,576.46

This claim is handled by: BRIAN

Generated using Merlmen e-Claims Internet Estimation & Adjusting System

REPAIR DETAILS

Estimate Report

Reference

Part Source: MRM-SG

Version: 1.0 (Last Synchronised: 01 Feb 2023)

Parts: M1-MPV

TOYOTA WISH 1.8 CVT (A) (Catalogue:Merimen Singapore 1.0)
(Price-denominated Standard List)

Labour: Repairer's

Print Code: (Unsubmitted, no print-code for SLD9965T)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Estimates on Parts

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1		*BONNET <i>bt</i>			
2	2		*BONNET HINGE LH/RH <i>bt</i>	0.00	0.00	*450.00 F
3	1		*BONNET INSULATOR <i>new</i>	0.00	0.00	*100.00 F
4	10		*BONNET INSULATOR CLIPS <i>new</i>	0.00	0.00	*210.00 F
5	1		*BONNET LOCK <i>new</i>	0.00	0.00	*20.00 F
6	1		*TOYOTA LOGO <i>new</i>	0.00	0.00	*65.00 F
7	2		*FRONT FENDER LH/RH <i>bt</i>	0.00	0.00	*35.00 F
8	2		*HEADLAMP LH/RH <i>con</i>	0.00	0.00	*800.00 F
9	1		*FRONT GRILLE <i>con</i>	0.00	0.00	*1,160.00 F
10	1		*FRONT GRILLE CHROME TRIM <i>con</i>	0.00	0.00	*200.00 F
11	1		*SUPPORT PANEL <i>bt</i>	0.00	0.00	*50.00 F
12	1		*SUPPORT PANEL TOP GARNISH <i>de</i>	0.00	0.00	*730.00 F
13	8		*SUPPORT PANEL TOP GARNISH CLIPS <i>new</i>	0.00	0.00	*90.00 F
14	1		*FRONT BUMPER <i>new</i>	0.00	0.00	*16.00 F
15	2		*FRONT BUMPER RETAINER LH/RH <i>new</i>	0.00	0.00	*360.00 F
16	10		*FRONT BUMPER CLIPS <i>new</i>	0.00	0.00	*100.00 F
17	2		*FRONT BUMPER LOWER GRILLE LH/RH <i>con</i>	0.00	0.00	*20.00 F
18	1		*BRACE PANEL <i>bt</i>	0.00	0.00	*130.00 F
19	1		*FRONT BUMPER SPONGE <i>con</i>	0.00	0.00	*50.00 F
20	1		*FRONT BUMPER REINFORCEMENT <i>bt</i>	0.00	0.00	*100.00 F
21	1		*BATTERY TOP BRKT <i>bt</i>	0.00	0.00	*180.00 F
22	1		*AIR CLEANER INTAKE DUCT CLIPS <i>new</i>	0.00	0.00	*58.00 F
23	1		*A/C CONDENSER <i>bt</i>	0.00	0.00	*2.00 F
24	1		*RADIATOR ?	0.00	0.00	*650.00 F
25	2		*RADIATOR AIR GUIDE LH/RH ?	0.00	0.00	*680.00 F
26	2		*RADIATOR COOLANT HOSE INLET/ OUTLET ?	0.00	0.00	*80.00 F
27	1		*HORN X	0.00	0.00	*90.00 F
28	1		*RADIATOR FAN COWLING <i>con</i>	0.00	0.00	*90.00 F
29	1		*RADIATOR FAN MOTOR ?	0.00	0.00	*150.00 F
30	1		*RADIATOR FAN BLADE ?	0.00	0.00	*230.00 F
31	1		*A/C FAN MOTOR ?	0.00	0.00	*120.00 F
32	1		*A/C FAN BLADE ?	0.00	0.00	*230.00 F
33	2		*TAILGATE GLASS SEAL LH/RH <i>new</i>	0.00	0.00	*98.00 F
34	1		*TAILGATE <i>bt</i>	0.00	0.00	*66.00 F
35	1		*TOYOTA LOGO <i>new</i>	0.00	0.00	*700.00 F
36	1		*TAILGATE OUTER HANDLE CHROME TRIM <i>con</i>	0.00	0.00	*40.00 F
37	2		*TAILLAMP INNER LH/RH <i>con</i>	0.00	0.00	*180.00 F
38	2		*TAILLAMP OUTER LH/RH X	0.00	0.00	*320.00 F
39	1		*VALVE MATIC EMBLEM <i>new</i>	0.00	0.00	*340.00 F
40	1		*REAR BUMPER <i>con</i>	0.00	0.00	*45.00 F
41	2		*REAR BUMPER RETAINER LH/RH X	0.00	0.00	*340.00 F
42	10		*REAR BUMPER CLIPS <i>new</i>	0.00	0.00	*100.00 F
				0.00	0.00	*20.00 F

F=Franchise part.

Sub Total (\$\$)	9,495.00
+ Margin on L,N Items 10.00% (\$\$)	949.50
Total Parts (\$\$)	10,444.50

Report was unsubmitted during this print-out.
Generated using Merimen e-Claims IEAS

Estimates on Miscellaneous Items

No Qty Particulars

Amount

Miscellaneous Items

1	1	A/C GAS	30	50.00
2	1	COOLANT	40	80.00
3	1	COOLANT	X	80.00
4	1	FRONT NUMBER PLATE		40.00
5	1	REVERSE SENSOR		200.00
6	1	TAILGATE GLASS PRIMER		30.00
7	1	TAILGATE GLASS SEALANT		40.00

Sub Total (\$\$) 500.00

Estimates on Labour

No Particulars

Lab.Type

Amount

Labour Items

1	TO CUT/ WELD/ PANEL BEAT FRONT SUPPORT PANEL, LH/RH FRONT FENDER & REALIGN ALL THE CONNECTION	New	800	850.00
2	TO SPRAY PAINT ON FRONT BONNET, BOTH LH+RH FRONT FENDER, FRONT BUMPER, SUPPORT PANEL, LH+RH FRONT DOOR	New	1400	1,700.00
3	TO REPLACE TAILGATE, REAR BUMPER, PANEL BEAT, REALIGN REAR END PANEL & REAR FENDER	New	400	850.00
4	TO SPRAY PAINT ON TAILGATE, REAR BUMPER, REAR END PANEL & REAR FENDER	New	400	950.00
5	TO APPLY ANTI RUST PROOFING ON AFFECTED AREAS	New	60	100.00
6	TO APPLY BODY SEALANT ON CUTTING AREAS	New	60	100.00
7	TO REMOVE & REFIT TAILGATE GLASS	New	120	150.00
8	TO TRANSFER TAILGATE INNER TRIM, LOCK, WIPER MOTOR TO NEW TAILGATE	New	60	150.00
9	TO REMOVE & REPLACE A/C CONDENSER & RADIATOR	New	120	180.00
10	TO ADJUST FOCUS HEADLAMP	New	30	40.00
11	TO CONDUCT WATER LEAK TEST AFTER REPAIR	New	30	80.00
12	TO REMOVE & INSTALL REVERSE CAMERA & SETTING UP ON HEAD UNITS	New	60	80.00
13	TO CONDUCT WIRING CHECK & RECTIFY WIRING FAULT AND RESET SYSTEM AFTER REPAIR	New	60	100.00

Gross Labour Cost (\$\$) 5,330.00

Report was unsubmitted during this print-out.
Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Repair
Hy 90010068

12 days

P/P

02/02/23 @ 1200

Reqs before paint

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Owner ID Type:	Singapore NRIC
Owner ID:	120G
Vehicle No.:	SLD9965T
Vehicle to be Exported:	No
Intended Deregistration Date:	03 Feb 2023
Vehicle Make:	TOYOTA
Vehicle Model:	WISH 1.8 CVT
Primary Colour:	Red
Manufacturing Year:	2016
Engine No.:	2ZR1790344
Chassis No.:	JTDGG20W70J004521
Maximum Power Output:	105.0 kW (140 bhp)
Open Market Value:	\$19,953.00
Original Registration Date:	04 Jul 2016
First Registration Date:	04 Jul 2016
Transfer Count:	0
Actual ARF Paid:	\$19,953.00
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	03 Jul 2026
PARF Rebate Amount:	\$12,969.00
COE Expiry Date:	03 Jul 2026
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$51,010.00
COE Rebate Amount:	\$17,428.00
Total Rebate Amount:	\$30,397.00

The information contained herein is correct as at 03 Feb 2023

OK

Toyota Wish 1.8A

Overview

Financial

Accessories

Similar

Research

Photos

Map



Price	\$61,800		
Depreciation ⓘ	\$14,510 /yr View models with similar depre	Reg Date	31-Aug-2016 (3yrs 6mths 27days COE left)
Mileage	93,179 km (14.5k /yr)	Manufactured ⓘ	2016
Road Tax ⓘ	\$976 /yr	Transmission	Auto
Dereg Value ⓘ	\$33,652 as of today (change)	OMV ⓘ	\$19,955
COE ⓘ	\$58,201	ARF ⓘ	\$19,955
Engine Cap	1,798 cc	Power	105.0 kW (140 bhp)
Curb Weight ⓘ	1,360 kg	No. of Owners ⓘ	2