

ASS. REC. BY:

REF:

C12 / 23001362/KP

C

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

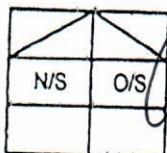

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

06

days

Res.: Yes or No

Lum Sum:

1.3.1

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SMA 9100

Yr Regn:

07, 21

Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Toyota

c.c

1798

Colour

M. Silver

A/C:

Insured / Std / NI / NA

Sp. Reading

10074

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

JTDKB31E4 703 91622

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: Nil / S/Rlm / STD A/Rlm or

Tyre Size:

F: Wanki 195/65R15

R: Sailun

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI / TOYO / YOKO or

Front

Rear

R/Bal.

4

mm

R/Bal.

7

mm

L/Bal.

4

mm

L/Bal.

7

mm

D.O.A.

6/1/23

D.O.I.

6/2/2023

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

O/S body

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

8/12 84349.11 C. K. K.

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation

S - RS. SI

Fees

Others

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Report Format :

Lump Sum / I.B.I. (\$

TOTAL

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SNA9190D

Not Notion
 Return B4 part
 @ 4349.11

LAD2301-007

Vehicle No.:

Chassis No.:

UEN No.:

06 FEB 2023

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

Date of Registration:

SNA9190D

JTDKB3FU703091622

201603575K

TOYOTA

PRIUS **GEN 4**

06/01/2023

SLF2211X/CHINA

22/07/2021

PART		LIST	
1	PANEL SUB-ASSY, FRONT DOOR, RH	\$	1,641.36 ✓
1	FRAME SUB-ASSY, FRONT DOOR OUTSIDE HANDLE, RH	\$	243.81 X
1	HANDLE ASSY, FRONT DOOR, OUTSIDE RH	\$	493.40 X
1	MOTOR ASSY, POWER WINDOW REGULATOR, RH	\$	1,161.83 X
1	WEATHERSTRIP, FRONT DOOR OPENING TRIM, RH	\$	404.57 X
1	HINGE ASSY, FRONT DOOR, LOWER RH	\$	139.86 X
1	HINGE ASSY, FRONT DOOR, UPPER RH	\$	123.06 X
1	REGULATOR SUB-ASSY, FRONT DOOR WINDOW, RH	\$	300.62 X
1	TAPE, BLACK OUT, NO.2 FRT RH	\$	55.02 ✓
1	TAPE, BLACK OUT, NO.1 FRT RH	\$	16.91 —
1	TAPE, BLACK OUT, NO.3 FRT RH	\$	33.29 —
1	PANEL SUB-ASSY, REAR DOOR, RH	\$	1,634.33 X
1	FRAME SUB-ASSY, REAR DOOR OUTSIDE HANDLE, RH	\$	243.81 X
1	HANDLE ASSY, REAR DOOR OUTSIDE, RH	\$	123.06 X
1	WEATHERSTRIP, REAR DOOR OPENING TRIM, RH	\$	369.60 X
1	MOTOR ASSY, POWER WINDOW REGULATOR, REAR RH	\$	1,161.83 X
1	REGULATOR SUB-ASSY, REAR DOOR WINDOW, RH	\$	260.51 X
1	TAPE, BLACK OUT, NO.2 REAR RH	\$	44.00 X
1	TAPE, BLACK OUT, NO.3 REAR RH	\$	19.43 X
1	TAPE, BLACK OUT, NO.1 REAR RH	\$	27.62 X
1	HINGE ASSY, REAR DOOR, LOWER RH	\$	109.62 X
1	HINGE ASSY, REAR DOOR, UPPER RH	\$	124.74 X
1	LINER, FRONT FENDER, RH	\$	255.36 X
1	FENDER SUB-ASSY, FRONT RH	\$	1,236.69 ✓
1	EMBLEM, SIDE PANEL, RH	\$	68.88 ✓

Trans-cab Auto Services Pte Ltd**LAD2301-007**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SNA9190D

1	BRACE SUB-ASSY, FENDER APRON, RH	\$	<i>sn</i>	368.24	X
1	APRON ASSY, FRONT FENDER, RH	\$	<i>sn</i>	222.71	X
1	MIRROR ASSY, OUTER REAR VIEW, RH	\$	<i>sn</i>	1,814.09	X
1	MOULDING ASSY, BODY ROCKER PANEL, RH	\$	<i>sn</i>	624.54	X
1	RIM	\$	<i>sn</i>	1,995.11	X
1	JAR ASSY, WINDSHIELD WASHER	\$	<i>sn</i>	276.15	X

TOTAL \$ 15,594.05**25% \$ 3,898.51****\$ 11,695.54****Special Nett**

1	DOOR STICKER TRANSCAB	\$	<i>na</i>	100.00	} X
1	DOOR STICKER TEL. NO	\$	<i>na</i>	100.00	
1	DOOR TRIM CLIP	\$	<i>na</i>	75.00	
1	DOOR WEATHERSTRIP CLIP	\$	<i>na</i>	80.00	
1	FENDER LINER CLIP	\$	<i>na</i>	65.00	
1	ROCKER MOULDING CLIP	\$	<i>na</i>	65.00	
1	TYRE	\$	<i>na</i>	350.00	

TOTAL \$ 835.00**TOTAL PARTS \$ 12,530.54****LABOUR**To Rust-Proofing and apply undercoat Of The Affected Areas. \$ 240.00 *bol*To remove and refit interior fittings, trimings, garnish, fittings and other, to enable repair. \$ *na* 380.00 XTo check steering geometry and computer wheel alignment \$ *na* 220.00 XTo transfer of door fittings, attachment and perform water seepage test. \$ 170.00 *bol*

Trans-cab Auto Services Pte Ltd**LAD2301-007**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SNA9190D

To check steering geometry and computer wheel alignment	\$	220.00	220.00 X
To transfer of tire, rim and on wheel balancing.	\$	170.00	170.00 X
To Transfer Of Fender Fittings, Attachments And Perform Water Seepage Test.	\$	170.00	170.00 X
Panel Beating, Knocking And Straightening The Necessary Portion, Remove And Renewal Of Parts, Adjust And Realign The Same	\$	1,600.00	1,600.00 600
Putty And Spray Painting Of The Affected Portion.	\$	1,600.00	1,600.00 1320
To transfer of tire, rim and on wheel balancing.	\$	170.00	170.00 X
To Check Electrical Lighting Concerned.	\$	170.00	170.00 201
TOTAL	\$	5,110.00	
Over All Total	\$	17,640.54	

(PART-BY-PART) Repair Days**6 Days** ✓**LKK Auto Consultants hence notify the Repairer of the following:**

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: