Reg. No: 52941122M

470 Segar Road #09-232 Singapore 670470 Email: ktoaa@singnet.com.sg HP: 98505311

ACCIDENT DAMAGED VEHICLE INSPECTION REPORT

M/S: Mohamed Sanip Bin Jasmawi

C/O Occi Sono Motor.Com

25 Kaki Bukit Road 4 #01-38

(Synergy KB) Singapore 417800

Date

: 30 December 2019

Our Ref

: TP/OCCI/FBA6091T/8293

REFERENCE PARTICULARS

Date of Accident

: 13 June 2019

Date of Inspection

: 14 August 2019

Type of Inspection : Third Party Claim

Date of Re-Inspn

VEHICLE PARTICULARS

Registration No

: FBA 6091 T

Make : Honda

Model

: CB400

: 2006 (COE Expiry 29/06/2026)

Engine No

: NC23E3100119

Chassis No Odometer

: JH2NC39986M200102 1 ~

Colour

: Blue

CONDITION OF VEHICLE (STATIC CHECKS AT TIME OF INSPECTION ONLY)

Engine condition

: Good

General Body Work: Good

Front brake

: Affected

Steering

: Affected

Rear brake

Year

: Serviceable

Lightings

: Serviceable

TYRE CONDITION (Remaining estimated life of tyre in mm)

Make

Size

Thread Balance

Front

: Michelin

120/60ZR17

3 mm

Rear

: Michelin

160/60ZR17

4 mm

GENERAL DESCRIPTION OF DAMAGES

The motorcycle sustained damage at the front & left side portion.

For details, refer to assessment for repairs and photographs attached.

ASSESSMENT SUMMARY

Our assessment of the repair costs to pre-accident condition was \$4,300.00 nett at lump sum basis. (Subject to GST if applicable)

Under normal circumstances, estimated period required for repairs: Five (5) working days.

Enclosed Twenty-Four (24) photographs depicting damage to the vehicle.

Inspection conducted at : Occi Sono Motor.Com

25 Kaki Bukit Road 4 #01-38 (Synergy KB) Singapore 417800

In accordance to your instruction, we have not authorise repairs and inspection was conducted strictly on a "WITHOUT PREJUDICE BASIS".

Our Ref : TP/OCCI/FBA6091T/8293

ASSESSMENT OF REPAIRS AND SPARE PARTS COSTS

DESCRIPTION OF PARTS AND NATURE OF REPAIRS

	Access to the contract of the	QTY	ASSESSED		ORIGINAL		REVISED
0	SPARE PARTS	PC/SET	CONDITION	-	QUOTATION		QUOTATION
1	Handle bar	1	Bent	\$	120.00	\$	120.00
2	Handle bar balancer LH	1	Grazed	\$	20.00	\$	20.00
3	Clutch lever	1	Grazed	\$	28.00	\$	28.00
4	View mirror LH	1 set	Grazed	\$	120.00	\$	120.00
5	Meter assy	1	Cracked	\$	925.00	\$	925.00
6	Headlamp assy	1	Missing	\$	260.00	\$	260.00
7	Headlamp rim	1	Missing	\$	68.00	\$	68.00
8	Headlamp housing	1	Cracked	\$	75.00	\$	75.00
9	Headlamp stay	1	Bent	\$	85.00	\$	85.00
0	Front signal lamp LH	1	Broken	\$	65.00	\$	65.00
1	Front fender	1	Cracked	\$	216.00	\$	216.00
2	Fork inner tubes L/R @ \$215.00	2	Bent	\$	430.00	\$	430.00
3	Fork under bracket	1	Bent	\$	245.00	\$	245.00
4	Front wheel rim	1	Grazed/Warped	\$	750.00	\$	750.00
5	Front brake disc L/R @ \$445.00	2	LH only (Warped)	\$	890.00	\$	445.00
6	Fuel tank	1	Dented	\$	890.00	\$	890.00
7	Engine cover LH	1	Grazed	\$	120.00	\$	120.00
8	Engine cover gasket LH	1	Necessary	\$	8.00	\$	8.00
9	Gear shift pedal	1	Bent	\$	68.00	\$	68.00
0	Front footrest LH	1	Grazed	\$	55.00	\$	55.00
l	Footrest bracket LH	1	Serviceable	\$	158.00	40	~
2	Rear footrest LH	1	Grazed	\$	28.00	\$	28.00
3	Rear cowling	ì	Grazed	\$	285.00	\$	285.00
4	Rear signal lamp LH	î	Broken	\$	65.00	\$	65.00
		`	POS CATAGO	\$	5,974.00	\$	5,371.00
			Less 10%		597.40	\$	537.10
			1000 1000	\$	5,376.60	\$	The second secon
()	S/NETT ITEM			10	3,370.00	3	4,833.90
5	Fuel tank emblem	1 set	Necessary	\$	58.00	\$	58.00
6	Steering upper/lower cone bearing	1 set	Necessary	\$	60.00	\$	60.00
7	Front number plate	1	Bent	\$	10.00	\$	
8	Fork oil seal & duct cover L/R @ \$30.00	2	Necessary	\$			10.00
9	Fork oil	1	Necessary	\$	60.00 30.00	\$	60.00
	1 611 611		Parts Total:	\$	5,594.60	<u>\$</u>	30.00
			rares rotar;	39	3,334.00	3	5,051.90
C	LABOUR CHARGES						
0	Transportation charge. (2 Trips)			\$	80.00	40	90.00
31	Replace, realign & adjust above damaged pr	arte		3	00.00	\$	80.00
	Rim balancing, check wiring, re-connection & lighting system.				450.00	ets.	200.00
	som manner every mante re-connection & usually		g system. Labour Total:	\$	450.00	\$	300.00
			ranant total:	\$	530.00	S	380.00
		Total Parts and Labour		\$	6,124.60	\$	5,431.90
	FINAL LUMP SUM ADJUSTMENT					\$	4,300.00
						_	THE RESERVE AND ADDRESS OF THE PARTY OF THE

VEHICLE NO: FBA 6091 T MAKE/MODEL: HONDA CB400

Our Ref : TP/OCCI/FBA6091T/8293


REMARKS

The repairer has agreed to undertake repair the vehicle at a lump sum basis of \$4,300.00 nett corresponding to replacement of parts and labour charges. We now revert for your decision on the above claim.

Yours faithfully KTO Automobile Assessors

Ong Ah Keng (CAE, AMIMI, MSAAA)


Automotive Appraiser

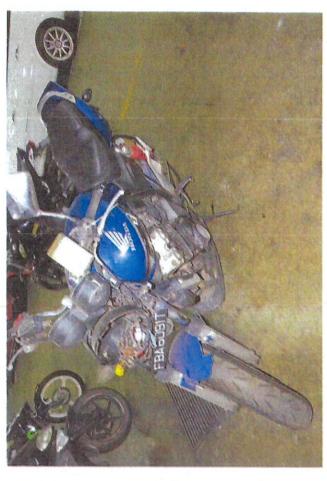


(


(



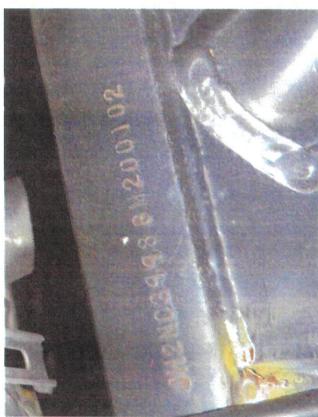

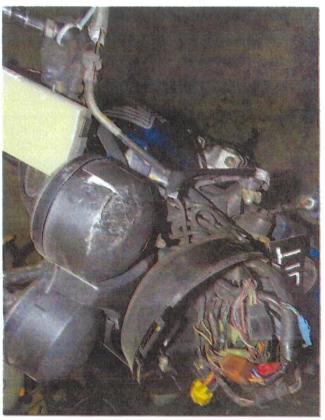





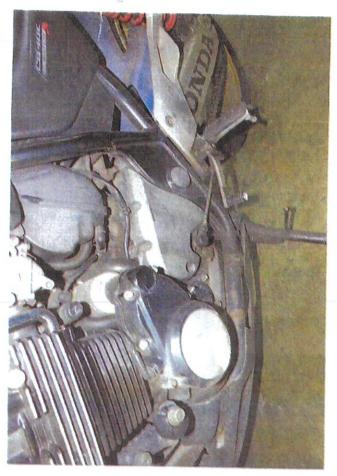






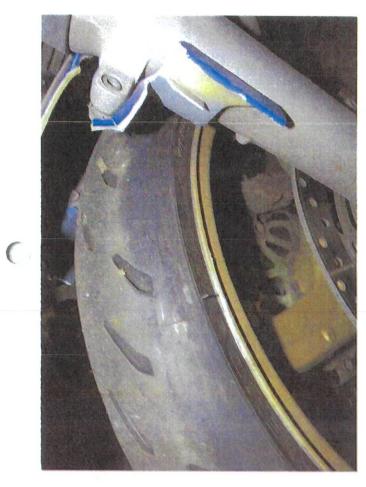

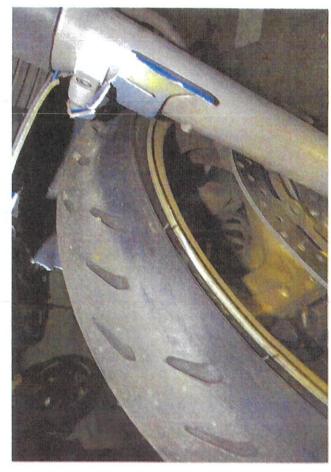



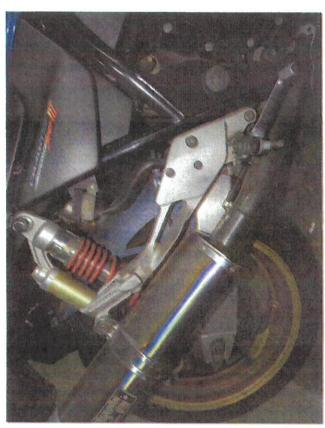













(

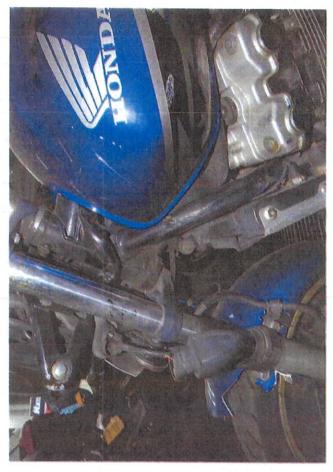





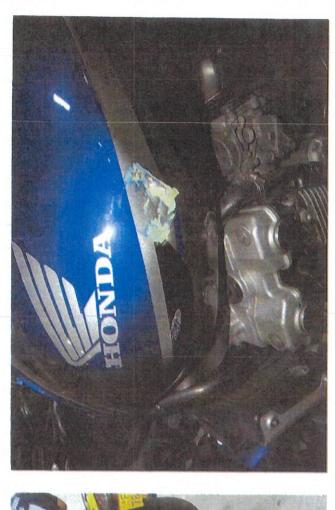

(

(



