

ASS. REC. BY:

REF:

AG2/23001760/kv

C

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD/TP/WS/TPRES/ODRES/EVA/INV/MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

8,500

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

6 days

Res.: Yes or No

Lum Sum:

20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

STN 379R Yr Regn: 01, 09

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Honda 1-17 c.c. 1339

Colour:

M. Blue A/C: Insured / Std / NI / NA

Sp. Reading:

221566 T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

GEC 1149092

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modl: NII / SRIm / STD A/Rim or

Tyre Size:

F: 195/50R15

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Front

R/Bal.

7 mm

L/Bal.

7 mm

D.O.A.

13/2/2

Rear

R/Bal.

L/Bal.

D.O.I.

7 mm

7 mm

16/2/2023

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

1/ GIA & EH not ready, P.A. for jammed
C/A wheel @ 2275.00

9/13 11:30 @ 4400 C.A. for

Date/Time, File Pass to?

: Prel. Report

: Final Report

1)

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation

S - RS. SI

F. 1/15

Others

Add Fee:

: Site Insp (\$

: Interview (\$

: Tech Invs (\$

: Weekend (\$

Report Format:

Lump Sum / I.B.I. (\$

TOTAL

Not Authorized
11/20/98 @ 4400h
Penny After Pain
6 days


Mobile: 82636295 Email: thiamhenghuat@gmail.com

Date: 24/02/2023

Claim Type: TP

VRN: SJN379R

Damaged area: Rear

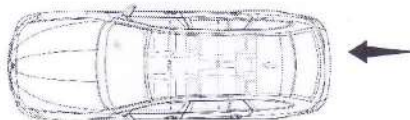

List items					
S/N	Parts description		QTY	UNIT PRICE	AMOUNT
1	Rear bumper	4P3.40	R 1	\$ 726.00	\$ 726.00
2	Rear bumper bracket		N/D 2	\$ 29.35	\$ 58.70
3	Rear bumper side retainer		R 2	\$ 33.00	\$ 66.00
4	Rear bumper tow hook cover		R 1	\$ 24.50	\$ 24.50
5	Rear fender		R 2	\$ 559.00	\$ 1,118.00
6	Rear fender glass moulding		R 2	\$ 68.90	\$ 137.80
7	Rear fender inner garnish		old D/I 2	\$ 396.00	\$ 792.00
8	Rear fender inner trimboard		Replaced 2	\$ 496.30	\$ 992.60
9	Rear fender cowling		R 2	\$ 87.90	\$ 175.80
10	Spare wheel panel		R 1	\$ 737.00	\$ 737.00
11	Rear air vent		R 1	\$ 52.00	\$ 52.00
12	Rear dust cover		R 1	\$ 47.70	\$ 47.70
13	End panel		R 1	\$ 465.10	\$ 465.10
14	End panel top garnish		new D/I 1	\$ 189.00	\$ 189.00
15	Tailgate	845.30	R 1	\$ 1,168.00	\$ 1,168.00
16	Tailgate "FIT" emblem		New 1	\$ 38.50	\$ 38.50
17	Tailgate "HONDA" Logo		New 1	\$ 26.00	\$ 26.00
18	Tailgate inner trimboard		R 1	\$ 296.30	\$ 296.30
19	Tailgate outer garnish		R 1	\$ 238.00	\$ 238.00
20	Tailgate outer handle		R 1	\$ 98.00	\$ 98.00
21	Tailgate top lock		R 1	\$ 186.20	\$ 186.20
22	Tailgate lock striker		R 1	\$ 89.40	\$ 89.40
23	Tailgate weatherstrip		old D/I 1	\$ 165.00	\$ 165.00
24	Tailgate wiper arm cover		D/I 1	\$ 15.00	\$ 15.00
25	Tailgate wiper motor		R 1	\$ 386.00	\$ 386.00
26	Tailgate wiper blade		R 1	\$ 38.00	\$ 38.00
27	Tailgate wiper blade arm		R 1	\$ 48.00	\$ 48.00
28	Windscreen moulding		New 1	\$ 182.00	\$ 182.00
29	Taillamp	288.50 old BRN	new BRN 2	\$ 376.20	\$ 752.40
30	Taillamp lower bracket		R 2	\$ 31.20	\$ 62.40
31	Taillamp panel		old BRN 2	\$ 185.80	\$ 371.60
32	Rear wheel panel tool box		New 1	\$ 238.00	\$ 238.00
33	Rear wheel panel trimboard		R 1	\$ 296.70	\$ 296.70
34	Rear number plate lamp		R 2	\$ 48.00	\$ 96.00
35	Exhaust muffler		R 1	\$ 786.80	\$ 786.80

Repair Estimate

36	Exhaust muffler heatshield	1	\$ 112.00	\$ 112.00	X
37	Exhaust muffler mounting	2	\$ 37.00	\$ 74.00	X
38	Rear bumper reinforcement	1	\$ 442.00	\$ 442.00	X
39	Rear bumper reinforcement bracket	2	\$ 159.00	\$ 318.00	X
Subtotal				\$ 12,106.50	
List discount				20.00%	
Total				\$ 9,685.20	

Special nett items

No.	Parts description	QTY	UNIT PRICE	AMOUNT	
1	Rear bumper clips	12	\$ 5.50	\$ 66.00	11
2	End panel inner garnish clip	8	\$ 5.50	\$ 44.00	11
3	Rear fender inner garnish clips	16	\$ 5.50	\$ 88.00	4
4	Rear fender inner trimboard clips	16	\$ 5.50	\$ 88.00	11
5	Rear fender cowling clips	12	\$ 5.50	\$ 66.00	X
6	Spare wheel panel sealant	1	\$ 120.00	\$ 120.00	X
7	End panel sealant	1	\$ 120.00	\$ 120.00	30cm
8	End panel top garnish clips	8	\$ 5.50	\$ 44.00	X
9	Tailgate inner trimboard clips	10	\$ 5.50	\$ 55.00	X
10	Rear windscreen sealant	1	\$ 120.00	\$ 120.00	40cm
11	Reverse sensors	1	\$ 280.00	\$ 280.00	20cm
12	Rear number plate & frame	1	\$ 55.00	\$ 55.00	X
13	Sundries	1	\$ 50.00	\$ 50.00	X
Total				\$ 1,196.00	

Labour

No.	Description	Work unit	Amount	
1	To dismantle / renew accident damaged portion. To panel beat, reshape, straighten, orientate and align repair / replacement parts.	7	\$ 1,400.00	900l
2	To disconnect rear wire harness of electrical components to facilitate repairs, reconnect and check functions including taillamp lightings.	0.25	\$ 50.00	20l
3	To remove, refit tailgate components, check and re-adjust close gap, alignment and water seepage.	0.75	\$ 150.00	60l
4	To measure, drill holes on replaced rear bumper, position and install reverse sensor, check and test distance and functions.	0.75	\$ 150.00	30l
5	To remove and refit, straighten and re-adjust exhaust pipe and replace exhaust silencer.	0.75	\$ 150.00	X
6	To remove and refit both rear fender glass to facilitate repair work.	1.5	\$ 300.00	X
7	To remove and refit rear windscreen to facilitate repair work.	0.75	\$ 150.00	120l
8	Supply spray paint material and necessary items to respray affected area / panel.	6	\$ 1,200.00	900l
9	To rust proof all affected portions after repair.	0.5	\$ 100.00	60l
Total labour			\$ 3,650.00	

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Estimate Grand Total \$ 14,531.20