

A.S. P.C. BY:

REF:

CC4/AIS2300 2093 4907/Dpa3

ASSIGNMENT

CJB June 2027

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____


Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

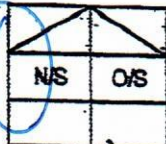

Bel. or Market Value: _____

DAC Accident Rpt: _____

Consistent?: Yes or No

GIA / PR Seen: _____

Consistent?: Yes or No

Est. Repair: _____

11

days

Res.: Yes or No

Lum Sum: _____

20

%

3 Val: Yes or No

CA / REV / REP. / 24 HRS

Date: _____

Person Contacted: _____

Vehicle: IN / OUT

Veh No: _____

SHC 8347L

Yr Regr: _____

June 2019

Type: M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: _____

Hyundai Ioniq

C.C. 1580

Colour: _____

Blue

A/C: Insured / Std / NI / NA

Sp. Reading: _____

357234

T/Radio: Insured / Std / NI / NA

Eng/No: _____

G4LEKU 296289

C/No: _____

KMHC852CVKU164464

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Mod: Nil / S/Rim / STD A/Rim or

Tyre Size: _____

F: _____

195/65 2.5

R: _____

BS / DUN / EXMOVA / GY / FS / LZA / MEC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Westlake

Front

Rear

R/Bal: _____

S

mm

R/Bal: _____

S

mm

L/Bal: _____

S

mm

L/Bal: _____

S

mm

D.O.A. _____

23/02/2023

D.O.I. _____

27/02/2023

Survey held at _____

Sijrost Sire Ming

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

W/S Portion

The U/C / Chassis frame / Body Structure affected due to collision.

Date/Time

Action / Instruction

Allianz YM 4554C

17/7/23

Jurnal 2/5 12,2001 - with 11 days of age

Date/Time, File Pass to?



: Prel. Report

7)



: Final Report

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee: _____

Transportation: _____

S + RS \$

Photos

Other

Add Fee: _____



: Site Insp (\$



: Interview (\$



: Tech. Inve (\$

Report Format: _____

1 series 2 series 3 series 4 series

BIFROST AUTO PTE LTD

REPAIR ESTIMATE

DATE: 27-Feb-23
 MODEL: HYUNDAI IONIC
 VEHICLE NO.: SHC 8347L

INSURANCE:

Allianz

Description	Qty	List Price	Amount
Front Bumper Cover <i>Replaced</i>	1	\$ 481.10	\$ 481.10
Front Bumper Moulding Centre Upper <i>HH</i>	1	\$ 368.50	\$ 368.50
Front Bumper Bracket Top (LH) <i>HH</i>	1	\$ 85.00	\$ 85.00
Front Bumper Bracket (LH) <i>HH</i>	1	\$ 75.00	\$ 75.00
Front Bumper Retainer Mounting (LH) <i>HH</i>	1	\$ 95.00	\$ 95.00
Front Bumper Clips 10 pcs <i>HH</i>	1	\$ 45.00	\$ 45.00
Front Bumper Grille (LH) <i>HH</i>	1	\$ 186.90	\$ 186.90
Front bumper air duct (LH) <i>HH</i>	1	\$ 153.80	\$ 153.80
Day Light ,LH <i>HH</i>	1	\$ 642.50	\$ 642.50
Headlamp(LH) <i>cut / scratched</i>	1	\$ 3,987.30	\$ 3,987.30
Front Fender(LH) <i>Replaced</i>	1	\$ 490.70	\$ 490.70
Front Fender Shield (LH) <i>HH</i>	1	\$ 164.70	\$ 164.70
Frt Door(LH) <i>cut</i>	1	\$ 1,797.20	\$ 1,797.20
Frt Door Rubber <i>broken</i>	1	\$ 250.00	\$ 250.00
Front Door Regulator (LH) <i>HH</i>	1	\$ 750.40	\$ 750.40
Front Door Power Motor, LH <i>HH</i>	1	\$ 689.20	\$ 689.20
Front Door Hinge Upper (LH) <i>HH</i>	1	\$ 165.76	\$ 165.76
Front Door Hinge Lower (LH) <i>HH</i>	1	\$ 153.70	\$ 153.70
Front Door Check (LH) <i>HH</i>	1	\$ 72.98	\$ 72.98
Front Door Inner Lock (LH) <i>HH</i>	1	\$ 385.60	\$ 385.60
Front Door Outer Handle (LH) <i>broken</i>	1	\$ 234.80	\$ 234.80
Front Door Mirror ASSY (LH) <i>HH</i>	1	\$ 1,691.70	\$ 1,691.70
Front Door Trim Board (LH) <i>HH</i>	1	\$ 796.80	\$ 796.80
Front Door Protector(LH) <i>cut / mended broken</i>	1	\$ 186.20	\$ 186.20

2110.30

Front Door Outer Moulding (LH) <i>HH</i>	1	\$ 110.10	\$ 110.10	X
Front Door Key Lock Set (RH) <i>HH</i>	1	\$ 438.00	\$ 438.00	X
Front Door Switch (LH) <i>HH</i>	1	\$ 635.80	\$ 635.80	X
Rear Door (LH) <i>cut</i>	1	\$ 2,147.90	\$ 2,147.90	✓
Rear Door Rubber(LH) <i>dam</i>	1	\$ 280.00	\$ 280.00	✓
Rear Door Outer Moulding(LH) <i>HH</i>	1	\$ 125.30	\$ 125.30	X
Rear Door Outer Handle (LH) <i>cut</i>	1	\$ 124.80	\$ 124.80	✓
Rear Door Channel (LH) <i>HH</i>	1	\$ 358.30	\$ 358.30	X
Rear Door Gear/Regulator(LH) <i>broken</i>	1	\$ 367.84	\$ 367.84	✓
Rear Door Power Motor (LH) <i>HH</i>	1	\$ 256.80	\$ 256.80	X
Rear Door Lock Assy <i>HH</i>	1	\$ 306.40	\$ 306.40	X
Rear Door Hinge Upper (LH) <i>HH</i>	1	\$ 173.88	\$ 173.88	X
Rear Door Hinge Lower (LH) <i>HH</i>	1	\$ 170.50	\$ 170.50	X
Rear Door Check(LH) <i>HH</i>	1	\$ 85.92	\$ 85.92	X
Rear Door Trim Board (LH) <i>broken</i>	1	\$ 613.60	\$ 613.60	✓
Rear Door Protector(LH) <i>cut / mandy broken</i>	1	\$ 166.20	\$ 166.20	✓
Door Centre Pillar Outer (LH) <i>HH</i>	1	\$ 3,764.90	\$ 3,764.90	X
Rocker Panel Outer Garnish <i>HH</i>	1	\$ 715.60	\$ 715.60	X
Rocker Panel Outer Garnish Clip <i>HH</i>	1	\$ 65.00	\$ 65.00	X
Front Wheel Rim (LH) <i>distorted</i>	1	\$ 1,124.20	\$ 1,124.20	✓
Front Wheel Hub assy (LH) <i>Dam</i>	1	\$ 678.50	\$ 678.50	✓
Front Wheel Hub Cap <i>cut</i>	1	\$ 346.40	\$ 346.40	✓
Front Shock Absorber(Assy)(LH) <i>distorted</i>	1	\$ 372.50	\$ 372.50	✓
Front Shock Absorber Mounting (LH) <i>HH</i>	1	\$ 372.50	\$ 372.50	X
Front Drive Shaft (LH) <i>HH</i>	1	\$ 1,136.70	\$ 1,136.70	X
Rack & Pinion Assy <i>HH</i>	1	\$ 2,387.40	\$ 2,387.40	X
STG Tie Rod <i>HH</i>	1	\$ 125.60	\$ 125.60	X
STG Tie End <i>HH</i>	1	\$ 94.70	\$ 94.70	X
Stabilizer Bar <i>HH</i>	1	\$ 326.80	\$ 326.80	X
Stabilizer Bar Link <i>HH</i>	1	\$ 92.10	\$ 92.10	X
Front Suspension Lower Arm (LH) <i>distorted</i>	1	\$ 596.80	\$ 596.80	✓
Knuckle Arm (LH) <i>distorted</i>	1	\$ 663.60	\$ 663.60	✓
Rear Bumper <i>cut</i>	1	\$ 459.40	\$ 459.40	✓

1789.90

Rear Bumper Side retainer (LH) <i>broken</i>	1	\$	85.80	\$	85.80	✓
Rear Bumper Cover Clips <i>HC</i>	1	\$	22.00	\$	22.00	✓
Tail Lamp(LH) <i>washy broken</i>	1	\$	870.40	\$	870.40	✓
Tail Lamp Quarter Panel(LH) <i>HH</i>	1	\$	208.90	\$	208.90	X
Rear Fender(LH) <i>Dent/cut</i>	1	\$	1,768.30	\$	1,768.30	✓
Rear Fender Inner Panel (LH) <i>HH</i>	1	\$	1,406.20	\$	1,406.20	X
Rear Fender SHIELD REAR PIECE (LH) <i>HH</i>	1	\$	173.60	\$	173.60	X
Rear Fender SHIELD Frt Piece (LH) <i>HH</i>	1	\$	165.50	\$	165.50	X
Rear Fender Corner inner upper garnish (LH) <i>HH</i>	1	\$	486.70	\$	486.70	X
Rear Fender Trim Board (LH) <i>HH</i>	1	\$	788.75	\$	788.75	X
REAR FENDER TRIM BOARD TOP GARNISH (LH) <i>HH</i>	1	\$	167.90	\$	167.90	X
Rear Tyre Rim (LH) <i>HH</i>	1	\$	1,124.20	\$	1,124.20	X
Rear Wheel Hub-Cap (LH) <i>HH</i>	1	\$	346.40	\$	346.40	X
Rear Wheelbearing & Hub assy <i>HH</i>	1	\$	554.00	\$	554.00	X
Rear Trailing Arm(LH) <i>HH</i>	1	\$	265.40	\$	265.40	X
Rear Assist (LH) <i>HH</i>	1	\$	227.90	\$	227.90	X
Rear shock Absorber(LH) <i>HH</i>	1	\$	230.50	\$	230.50	X
Rear Shock Absorber Mounting (LH) <i>HH</i>	1	\$	133.10	\$	133.10	X
Rear Absorber stopper (LH) <i>HH</i>	1	\$	137.60	\$	137.60	X
Rear Absorber Cover (LH) <i>HH</i>	1	\$	175.60	\$	175.60	X
Stabilizer Bar <i>HH</i>	1	\$	387.30	\$	387.30	X
Stabilizer Link (LH) <i>HH</i>	1	\$	147.30	\$	147.30	X
Rear Upper Arm(LH) <i>HH</i>	1	\$	239.50	\$	239.50	X
Rear Lower Arm(LH) <i>HH</i>	1	\$	393.10	\$	393.10	X
Rear Knuckle Arm (LH) <i>HH</i>	1	\$	538.10	\$	538.10	X
						</

15,426.04

12,340.83
=

Front Door Advertisement Logo (LH) <i>cut</i>	SN	1	\$ 100.00	\$ 100.00	✓
Rear Door Advertisement Logo (LH) <i>cut</i>	SN	1	\$ 100.00	\$ 100.00	✓
Rear Door Tel No.Sticker(LH) <i>Hu</i>	SN	1	\$ 10.00	\$ 10.00	✓
Rear Door Comfortdelgro & Apps Sticker(LH) <i>Hu</i>	SN	1	\$ 80.00	\$ 80.00	✓
Rocker Panel Outer Garnish Advertisement <i>Hu</i>	SN	1	\$ 120.00	\$ 120.00	X
Front Tyre(LH) <i>Hu</i>	SN	1	\$ 216.00	\$ 216.00	X
Rear Bumper Advertisement Logo <i>Hu</i>	SN	1	\$ 100.00	\$ 100.00	✓
Rear Bumper Rubber Mat <i>Hu</i>	SN	1	\$ 50.00	\$ 50.00	✓
Rear Fender Advertisement Logo (LH) <i>cut</i>	SN	1	\$ 120.00	\$ 120.00	✓
Rear Tyre(LH) <i>Hu</i>	SN	1	\$ 216.00	\$ 216.00	X
SUB TOTAL				\$ 1,313.60	
Labour Charge					
Panel Beating		1	\$1,800.00	\$1,800.00	900/-
Spray Painting Charge		1	\$1,600.00	\$1,600.00	900/-
Wiring Charge		1	\$100.00	\$100.00	30/-
Tuff Kote		1	\$100.00	\$100.00	40/-
Towing Charge		1	\$80.00	\$80.00	Hu
Remove/Refix Cushion & Upholstery Rear		1	\$150.00	\$150.00	80/-
Remove/Refix Reverse Sensor		1	\$120.00	\$120.00	Hu
Remove/Refix Undercarriage (RR)		1	\$400.00	\$400.00	Hu
Re-set Rear ABS System		1	\$400.00	\$400.00	Hu
Remove/Refix Fuel Tank		1	\$80.00	\$80.00	Hu
Transfer of Door Mechanism FRONT		1	\$80.00	\$80.00	60/-
Re-set Frt Power Window System		1	\$200.00	\$200.00	Hu
Transfer of Door Mechanism REAR		1	\$80.00	\$80.00	60/-
Re-set Rear Power Window System		1	\$200.00	\$200.00	Hu
Four Wheel Alignment		1	\$120.00	\$120.00	60/-
Remove/Refix Undercarriage (Frt)		1	\$400.00	\$400.00	150/-
Re-set Frt ABS System		1	\$200.00	\$200.00	Hu
Remove/Refix Radiator		1	\$90.00	\$90.00	Hu
Remove/Refix Aircon & Refill Gas		1	\$130.00	\$130.00	Hu

735.00

Diagnostic & Resetting To Erase Fault Code	1	\$550.00	\$550.00
Diagnostic & Resetting ADAS Optical sensor	1	\$550.00	\$550.00
TOTAL LABOUR			\$7,430.00
ESTIMATE TOTAL			\$ 44,485.94
This is an initial estimate based on a visual inspection of the above vehicle. The final repair quantum will be prepared after the vehicle is surveyed by a motor Surveyor appointed by the insurance			

II

2280.00

27/02/2023 @ 1130am
Not Actual

15,355.83

4/s 12,200/-

2/sum 11 days
ryan
2kk Auto

8

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Customer:	LIM TAN	Date:	2/27/2023 9:55 AM
Company:		VIN	
License NO:	SHC 8347 L	Technician:	
Odometer:		Order NO:	

VEHICLE ALIGNMENT REPORT
HYUNDAI, IONIQ (AE HEV) Hybrid, 17-17 (Customized)

Primary Angles			Initial	Specifications		Final
				Min	Max	
Front	Caster	Left	6°26'	4°00'	5°00'	6°30'
		Right	6°32'	4°00'	5°00'	6°36'
	Camber	Left	-2°54'	-0°53'	0°07'	-3°00'
		Right	0°12'	-0°53'	0°07'	0°24'
	Toe	Left	-0°06'	-0°03'	0°09'	1°21'
		Right	-0°12'	-0°03'	0°09'	1°36'
Total		-0°18'	-0°06'	0°18'	-0°15'	
Rear	Camber	Left	-1°30'	-1°42'	-0°42'	-1°30'
		Right	-1°30'	-1°42'	-0°42'	-1°30'
	Toe	Left	0°54'	-0°02'	0°10'	0°54'
		Right	-0°51'	-0°02'	0°10'	-0°51'
		Total	0°03'	-0°04'	0°20'	0°03'
Thrust Angle		0°53'	----		0°53'	
Secondary Angles			Initial	Specifications		Final
				Min	Max	
SAI		Left	13°58'	13°30'	14°30'	13°58'
		Right	13°33'	13°30'	14°30'	13°33'
Included Angle		Left	11°04'	----	----	10°58'
		Right	13°45'	----	----	13°57'
Toe Out On Turns		Left	----	----	----	----
		Right	----	----	----	----
Max Turn Inside		Left	----	----	----	----
		Right	----	----	----	----
Toe Curve Change		Left	----	----	----	----
		Right	----	----	----	----
Setback		Front	-0mm	----	----	-0mm
		Rear	10mm	----	----	10mm
Track Width Diff.			4mm			4mm
Wheel Base Diff.			-11mm			-11mm
Front Ride Height		Left	----	373mm	393mm	----
		Right	----	373mm	393mm	----
Rear Ride Height		Left	----	372mm	392mm	----
		Right	----	372mm	392mm	----
Frame Angle						----

ONE STOP AUTOMOTIVE SOLUTION

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Company

Owner ID:

821R

Vehicle Details

Vehicle No.:

SHC8347L

Vehicle to be Exported:

No

Intended Deregistration Date:

28 Feb 2023

Vehicle Make:

HYUNDAI

Vehicle Model:

AE IONIQ HEV 1.6 DCT

Primary Colour:

Blue

Manufacturing Year:

2019

Engine No.:

G4LEKU296289

Chassis No.:

KMHC851CVKU164464

Maximum Power Output:

103.6 kW (138 bhp)

Open Market Value:

\$25,373.00

Original Registration Date:

26 Jun 2019

First Registration Date:

26 Jun 2019

Transfer Count:

0

Actual ARF Paid:

\$12,523.00

Intended PARF Rebate Details

PARF Eligibility:

Yes

PARF Eligibility Expiry Date:

25 Jun 2027

PARF Rebate Amount:

\$9,392.00

Intended COE Rebate Details

COE Expiry Date:

25 Jun 2027

COE Category:

A - Car up to 1600cc & 97kW (130bhp)

COE Period(Years):

8

PQP Paid:

\$23,872.00

COE Rebate Amount:

\$12,889.00

Total Rebate Amount:

\$22,281.00

Message

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 23 Feb 2023

OK