

(08/11/13) wef

ASS. REC. BY: Tom

REF:

9
1314

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD/TP/WS/TP RES/OD RES/EVA/INV/MVTo Inspect Vehicle No: SMP 5717Uat Workshop m/s PREMIUMof 24, 2000 & 2000Insured: ALL

Policy No. _____

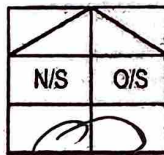
Claims No. _____

Sum Insured: _____ Excess: TBA

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.Bal. or Market Value: 171K

IDAC Accident Rpt: _____ Consistent?: Yes or No

GIA / PR Seen: _____ Consistent?: Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: SMP 5717U Yr Regn: 2019 / 18PType: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or _____

Make: Audi Q5 SP 2.0 TFSI Quattro c.c. 1984Colour: WHITE A/C: Insured / Std / NI / NASp. Reading: 18982 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: W4UZZZ4Y0K2110551Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orMod: Nil / S/Rim / STD A/Rim orTyre Size: F: 235/55ZR19

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or FALKEN

Front: _____ Rear: _____

R/Bal: 6 mm R/Bal: 6 mmL/Bal: 6 mm L/Bal: 6 mmD.O.A. 20/02/23 D.O.I. 24/02/23Survey held at: PREMIUMDes. of Damages: Frt Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time _____ Action / Instruction

REPAIR LIMIT - 105K

Date/Time, File Pass to?

☐ : Prell. Report

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee: _____

1)

Date/Time, File Return to?

☐ : Final Report

Transportation: _____

2)

Add Fee: ☐ : Site Insp (\$ _____)

S + RS, SI

☐ : Interview (\$ _____)

Photos

☐ : Tech. Invs (\$ _____)

Others

☐ : Weekend (\$ _____)

TOTAL

Report Format : _____

Lump Sum / I.B.I. (\$) _____

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATE : ACCIDENT REPAIRS
WORKSHOP : UBI ROAD 1
CONTACT NO : 6366 2323
FAX NO : 6841 1183
REFERENCE : PA/OD/0202/2023/EQ
DATE : 23-Feb-23
WIP : 64455

VEHICLE IN WORKSHOP. KINDLY ARRANGE FOR SURVEY ON 24/2/2023

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Motor Claims Dept

Tel: 6880 4602 - Fax: 6880 4838

OWNER'S NAME : MR RADHAKRISHNAN HARISH
ADDRESS : 8 BOONLAY DRIVE
#01-20
SINGAPORE 649928
TELEPHONE : HP +65 93953508
TYPE OF CLAIM : OWN DAMAGE CLAIM
POLICY NO : -
VEHICLE NO : **SMP 5717 U**
MODEL CODE : AUDI Q5 SPORT 2.0 TFSI QU
MODEL YEAR : 30/9/2019
ENGINE NO : DAX 057219
CHASSIS NO : WAUZZZFY0K2110551
MILEAGE : 60,513
DATE IN : 21-Feb-23
ESTIMATED BY : JOHNNY BOO / ALLAN WU
ACCIDENT DATE : 20-Feb-23
PLACE OF ACCIDENT : CHIN BEE DRIVE (COMING FROM BOONLAY)

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SMP 5717 U

S/N	NATURE OF JOBS		ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
1	TO REMOVE AND TRANSFER REAR PARKING AID AND REAR LID KICK SENSOR. CHECK FUNCTION.	S/N \$	360.00	/
2	TO REMOVE AND TRANSFER REAR LID'S CONVENIENCE LOCK SYSTEM, WIRE HARNESS FOR TAIL LIGHTS AND REAR LID WIPER ASSY.	S/N \$	480.00	/
3	TO RENEW REAR WINDSCREEN TO FACILITATE RENEWAL OF REAR LID.	S/N \$	480.00	/
4	TO INSTALL SOLAR FILM FOR ALL THE AFFECTED GLASSES.	S/N \$	400.00	/
5	TO CARRY OUT WATER SEEPAGE FOR REAR WINDSCREEN.	S/N \$	200.00 150	
6	TO RENEW LHS REAR 1/4 GLASS TO FACILITATE RENEWAL OF RHS REAR FENDER.	S/N \$	300.00	X
TOTAL LABOUR CHARGES		:	\$ 2,220.00	

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SMP 5717 U

S/N	NATURE OF JOBS	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
7	TO DISLODGE AND REINSTALL REAR WIRE HARNESS FOR LIGHTS, BATTERY MANAGER, FUSE AND RELAY TRAYS, ELECTRICAL AND AUDIO EQUIPMENT. INSPECT FOR DAMAGE AND RENEW WHERE NECESSARY.	S/N \$ 1,600.00	?
8	TO REMOVE AND REINSTALL REAR SEAT, BACK REST, HAT TRAY, ABCD PILLAR TRIMS, LUGGAGE COMPARTMENT TRIMS. DISLODGE ROOF LINER AND DISENGAGE CURTAIN AIRBAG ETC.	S/N \$ 1,600.00	?
9	TO DISMANTLE AND RENEW REAR BUMPER AND REAR LID. TO CUT OUT AND WELD LHS REAR FENDER AND REAR END PANELLING. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED.	\$ 8,800.00	1000
10	TO RESPRAY REAR BUMPER, REAR LOWER BUMPER, REAR LID, HINGES, LHS REAR FENDER, LHS SILL PANEL, DRAIN CHANNEL, DOOR ENTRANCE, REAR LID TOP SPOILER, ROOF CHANNEL, REAR END PANELLING AND BOTH REAR WHEEL ARCH TRIMS.	\$ 8,500.00	1650
11	TO RENEW LHS REAR EXHAUST SILENCER AND ALIGN TO POSITION.	S/N \$ 480.00	?
12	TO CARRY OUT CLEANUP FOR REAR INTERIOR COMPARTMENT.	S/N \$ 280.00	
13	TO CARRY OUT DIAGNOSTIC CHECK.	S/N \$ 192.00	
TOTAL LABOUR CHARGES		: \$ 23,672.00	

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SMP 5717 U

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
1	REAR BUMPER - UPPER / LOWER <i>cm /</i>	1	\$	3,561.00
2	REAR BUMPER SPOILER <i>cm /</i>	1	\$	1,021.00
3	REAR BUMPER TOW EYE COVER - LH / RH <i>X</i>	2	\$	91.00
4	REAR BUMPER CLOSING ELEMENT - LH <i>?</i>	1	\$	114.00
5	REAR BUMPER CHROME TRIM - LH <i>sun /</i>	1	\$	281.00
6	REAR BUMPER TAIL LIGHT - LH <i>cm /</i>	1	\$	826.00
7	REAR LID TAIL LIGHT - LH <i>sun /</i>	1	\$	1,967.00
8	REAR LICENCE PLATE LIGHT - LH / RH <i>X</i>	2	\$	119.00
9	REAR ADDITIONAL BRAKE LIGHT <i>?</i>	1	\$	263.00
10	REAR BOOT LID OPENING CONTROL UNIT <i>?</i>	1	\$	491.00
11	REAR TAILGATE OPENING SENSOR LINE <i>?</i>	1	\$	129.00
12	REAR AERIAL KEY ACCESS <i>?</i>	1	\$	123.00
13	REAR BUMPER REINFORCEMENT BEAM <i>?</i>	1	\$	1,104.00
14	REAR BUMPER IMPACT BAR GASKET - LH / RH <i>?</i>	2	\$	7.00
15	REAR BUMPER HOLDING STRAP <i>?</i>	1	\$	201.00
16	REAR BUMPER GUIDE SECTION - LH <i>?</i>	1	\$	100.00
17	REAR BUMPER FOAM FILLER PIECE - LH <i>?</i>	1	\$	74.00
18	REAR PARKING AID SENSOR - INNER / OUTER <i>?</i>	3	\$	815.00
19	REAR PARKING AID SEAL RING <i>?</i>	4	\$	11.00
20	REAR BUMPER WIRING SET <i>?</i>	1	\$	551.00
SUB TOTAL SPARE PARTS		:	\$	11,849.00

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SMP 5717 U

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
21	REAR LID <i>bt</i>	1	\$ 5,267.00	
22	REAR LID HINGE - LH / RH <i>X</i>	2	\$ 542.00	
23	REAR LID ATTACHMENT PARTS <i>?</i>	1	\$ 179.00	
24	REAR LID FLAP GASKET <i>X</i>	1	\$ 456.00	
25	REAR LID LOCK STRIKER <i>X</i>	1	\$ 102.00	
26	REAR LID LOCK <i>X</i>	1	\$ 267.00	
27	REAR LID BONNET LOCK COVER <i>X</i>	1	\$ 9.00	
28	REAR LID LOCK ACTUATOR CAMERA PUSHBUTTON <i>X</i>	1	\$ 1,512.00	
29	PACKING ADHESIVE <i>m</i>	1	\$ 22.00	
30	AUDI EMBLEM <i>m</i>	1	\$ 152.00	
31	"Q5" INSCRIPTION <i>m</i>	1	\$ 110.00	
32	"QUATTRO" INSCRIPTION <i>m</i>	1	\$ 110.00	
33	REAR WINDOW <i>bu</i>	1	\$ 1,348.00	
34	WINDOW PRIMER <i>m</i>	1	\$ 24.00	
35	REAR SPOILER - LH / RH <i>m</i>	2	\$ 550.00	
36	REAR SPOILER FIXING PARTS <i>m</i>	1	\$ 38.00	
37	REAR SPOILER FOAM STRIPS <i>m</i>	1	\$ 38.00	
38	REAR SIDE PANEL <i>X</i>	1	\$ 5,586.00	
39	REAR QUARTER WINDOW - LH <i>X</i>	1	\$ 981.00	
40	WINDOW PRIMER <i>X</i>	1	\$ 24.00	
SUB TOTAL SPARE PARTS		:	\$ 17,317.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.

55 UBI ROAD 1, SINGAPORE 408699
 TEL : 6366 2323 FAX : 6841 1183
 EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SMP 5717 U

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
41	REAR DOOR SILL TRIM STRIP - LH X	1	\$ 168.00	
42	REAR CROSS PANEL X	1	\$ 672.00	
43	LOCK CARRIER BRACKET X	1	\$ 286.00	
44	REAR WHEEL COVER - LH / RH ~ /	2	\$ 1,306.00	
45	REAR SILENCER ?	1	\$ 2,153.00	
46	REAR SILENCER DUAL CLIP ?	1	\$ 68.00	
47	REAR SILENCER BRACKET ?	1	\$ 66.00	
48	REAR SILENCER HEAT SHIELD ?	1	\$ 169.00	
49	REAR VENT ?	1	\$ 411.00	
50	REAR WHEEL HOUSING LINER - LH ? X	1	\$ 326.00	
51	REAR CROSS PANEL TRIM X ?	1	\$ 538.00	
52	REAR LID TRIM PANEL - LOWER ?	1	\$ 870.00	
53	REAR LUGGAGE COMPARTMENT COVER BLIND ?	1	\$ 1,792.00	
54	ACRYLIC SEALANT X	S/N	\$ 180.00	
55	CAVITY WAX X	S/N	\$ 140.00	
56	STONE CHIP X	S/N	\$ 180.00	
57	1/4 GLASS SEALANT X	S/N	\$ 100.00	
58	METAL FILLER POWDER X	S/N	\$ 280.00	
59	REAR WINDSCREEN SEALANT ~ /	S/N	\$ 200.00	
60	REAR BUMPER PLATE X	S/N	\$ 60.00	
61	SUNDRIES ?		\$ 500.00	
TOTAL SPARE PARTS			: \$ 39,631.00	
TOTAL LABOUR CHARGES			: \$ 23,672.00	
GRAND TOTAL			: \$ 63,303.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
 SPARE PARTS ARE SPECIAL NETT.

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

NAME
SURVEYED DATE
AUTHORISED DATE
EXCESS COST
LIABILITY
REMARKS

: Rasu - Hp 90010068
: 24/02/23 @ 1610
: 6 days
: EXCESS: TBA
: Revert
: Resu before print

PLEASE NOTE

: THIS ESTIMATE IS BASED ON VISUAL INSPECTION OF
THE AFFECTED VEHICLE. SHOULD WE REQUIRE
FURTHER LABOUR CHARGES AND SPARE PARTS IN THE
PROGRESS OF REPAIR, WE SHALL INFORM YOU
ACCORDINGLY.
FOR INSPECTION OF VEHICLE, PLEASE REFER TO
MS. NORAH KHAI AT TEL: 6768 9828 / 6768 9911 FOR
APPOINTMENT.

YOURS FAITHFULLY,
PREMIUM AUTOMOBILES PTE LTD

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

JOHNNY BOO
BODY REPAIR MANAGER

ALLAN WU
CLAIMS CONSULTANT

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Foreign Identification Number

Owner ID:

131U

Vehicle Details

Vehicle No.:

SMP5717U

Vehicle to be Exported:

No

Intended Deregistration Date:

26 Feb 2023

Vehicle Make:

AUDI

Vehicle Model:

Q5 SPORT 2.0 TFSI QU S TRONIC

Primary Colour:

White

Manufacturing Year:

2019

Engine No.:

DAX057219

Chassis No.:

WAUZZZFY0K2110551

Maximum Power Output:

185.0 kW (248 bhp)

Open Market Value:

\$43,642.00

Original Registration Date:

30 Sep 2019

First Registration Date:

30 Sep 2019

Transfer Count:

0

Actual ARF Paid:

\$53,099.00

Intended PARF Rebate Details

PARF Eligibility:

Yes

PARF Eligibility Expiry Date:

29 Sep 2029

PARF Rebate Amount:

\$39,824.00

Intended COE Rebate Details

COE Expiry Date:

29 Sep 2029

COE Category:

E - Open - all except motorcycle

COE Period(Years):

10

QP Paid:

\$40,002.00

COE Rebate Amount:

\$25,445.00

Total Rebate Amount:

\$65,269.00

Audi Q5 2.0A TFSI Quattro S-tronic Sport

Overview

[Financial](#)[Accessories](#)[Similar](#)[Research](#)[Photos](#)[Map](#)

Price **\$171,288** [Get Pre-approved Loan.](#)

Depreciation ⓘ **\$21,950 /yr**
[View models with similar depre](#)

Reg Date **30-Sep-2019**
(6yrs 7mths 3days COE left)

Mileage **31,000 km (9.1k /yr)**

Manufactured ⓘ **2019**

Road Tax ⓘ **\$1,194 /yr**

Transmission **Auto**

Dereg Value ⓘ **\$64,164 as of today (change)**

OMV ⓘ **\$43,623**

COE ⓘ **\$40,000**

ARF ⓘ **\$53,073**

Engine Cap **1,984 cc**

Power **185.0 kW (248 bhp)**

Curb Weight ⓘ **1,795 kg**

No. of Owners ⓘ **2**

Type of Vehicle **SUV**