

(08/11/13) wof
ASS. REC. BY: Am

REF: CC3/AK 23002143/Rpa3


4122

ASSIGNMENT

From: _____ Date: _____
Estimated Cost: _____
OD / TP / WS / TP RES / OD RES / EVA / INV / MV
To Inspect Vehicle No: SLN 62494
at Workshop m/s PREMIUM
of 24, Pioneer street
Insured: Alh
Policy No. _____
Claims No. _____
Sum Insured: _____ Excess: _____
(Client's Record)
Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

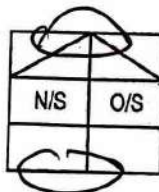

Bal. or Market Value: 71K
IDAC Accident Rpt: Consistent? : Yes or No
GIA / PR Seen: Consistent? : Yes or No
Est. Repairs: _____ days Res.: Yes or No
Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: SLN 62494 Yr Regn: 2017 / MAY
Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
Truck / Trailer or

Make: Audi A3 SP 110 TFSI ST c.c. 999
Colour: Blue A/C: Insured / Std / NI / NA
Sp. Reading: 95497 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: WAUZZZ8VXH115564

Gen. Cond: Good / Fair / Poor / Burnt

Steering: in order / Jammed / Leaked / Burnt or

Brake: in order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 205/55R16
R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Front

R/Bal. 6 mm
L/Bal. 6 mm

D.O.A. 28/02/23

Rear

R/Bal. 6 mm
L/Bal. 6 mm

D.O.I. 28/02/23

Survey held at PREMIUM

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

REPAIR Lim 7 - 39K

Date/Time, File Pass to?

☐ : Prell. Report
☐ : Final Report

1) Date/Time, File Return to?
2) _____

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee: ☐ : Site Insp (\$)
☐ : Interview (\$)
☐ : Tech. Invs (\$)
☐ : Weekend (\$)

Survey Fee:

Transportation: _____

S + RS, SI

Photos

Others

TOTAL

Report Format : _____

Lump Sum / I.B.I. (\$) _____

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATE : ACCIDENT REPAIRS
WORKSHOP : UBI ROAD 1
CONTACT NO : 6366 2323
FAX NO : 6841 1183
REFERENCE : PA/TP/0216/2023/EQ
DATE : 28-Feb-23
WIP : 65400

VEHICLE IN WORKSHOP. KINDLY ARRANGE FOR SURVEY ON 28/02/2023

YOUR INSURED VEH NO : SMU 1822 Z

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Motor Claims Dept

OWNER'S NAME : MISS GUO YIXUAN GERALDINE @GUO HUITING GERALDINE
ADDRESS : 99 PASIR RIS HEIGHTS
#15-31
SINGAPORE 519291
TELEPHONE : HP +65 96540511
TYPE OF CLAIM : THIRD PARTY CLAIM
POLICY NO : 5117343446-02
VEHICLE NO : **SLN 6249 U**
MODEL CODE : AUDI A3 SPORTSBACK 1.0 TF
MODEL YEAR : 11/5/2017
ENGINE NO : CHZ 338275
CHASSIS NO : WAUZZZ8VXHA115564
MILEAGE : -
DATE IN : -
ESTIMATED BY : JOHNNY BOO / ALLAN WU
ACCIDENT DATE : 25-Feb-23
PLACE OF ACCIDENT : PIE

55 UBI ROAD 1, SINGAPORE 408699

TEL: 6366 2323 FAX: 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SLN 6249 U - FRONT

S/N	NATURE OF JOBS	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
1	TO REMOVE, CHECK AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT WASHER ASSY.	S/N \$ 360.00	X
2	TO REMOVE AND TRANSFER BOTH HEADLIGHT'S CONTROL UNIT AND POWER MODULE.	S/N \$ 700.00	?
3	TO REMOVE AND RENEW AIRCON CONDENSER, ADDITIONAL RADIATOR AND RADIATOR. CHECK ELECTRICAL FANS AND CONTROL UNIT. PRESSURISE COOLING SYSTEM. TO CARRY OUT VACUUM AND REGAS.	S/N \$ 1,400.00	?
4	TO DISMANTLE AND RENEW FRONT BUMPER, BONNET, BOTH FRONT FENDERS AND BOTH HEADLIGHT. TO RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED.	\$ 5,600.00	1250
5	TO RESPRAY FRONT BUMPER, BONNET, HINGES AND BOTH FRONT FENDER. ?	\$ 4,000.00	1100
TOTAL LABOUR CHARGES - FRONT		: \$ 12,060.00	

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SLN 6249 U - REAR

S/N	NATURE OF JOBS		ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
1	TO REMOVE AND TRANSFER REAR PARKING AID. CHECK FUNCTION.	S/N \$	280.00	/
2	TO REMOVE AND TRANSFER REAR LID'S CONVENIENCE LOCK SYSTEM, WIRE HARNESS FOR TAIL LIGHTS AND REAR LID WIPER ASSY.	S/N \$	480.00	/
3	TO RENEW REAR WINDSCREEN.	S/N \$	480.00	/
4	TO INSTALL SOLAR FILM FOR REAR WINDSCREEN.	S/N \$	400.00	/
5	TO CARRY OUT WATER SEEPAGE TEST FOR REAR WINDSCREEN.	S/N \$	200.00	150
6	TO DISLodge AND REINSTALL REAR WIRE HARNESS FOR LIGHTS, BATTERY MANAGER, FUSE AND RELAY TRAYS, ELECTRICAL AND AUDIO EQUIPMENT. INSPECT FOR DAMAGE AND RENEW WHERE NECESSARY.	S/N \$	1,400.00	?
TOTAL LABOUR CHARGES - REAR		:	\$ 3,240.00	

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SLN 6249 U - REAR

S/N	NATURE OF JOBS	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
7	TO DISMANTLE AND RENEW REAR BUMPER AND REAR LID. TO CUT OUT AND WELD REAR END PANELLING. TO REPAIR SPARE WHEEL HOUSING. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED.	\$ 4,500.00	1000
8	TO RESPRAY REAR BUMPER, REAR LID, HINGES, REAR END PANELLING AND SPARE WHEEL HOUSING.	\$ 3,500.00	1100
9	TO RENEW LHS REAR EXHAUST SILENCER AND ALIGN TO POSITION.	S/N \$ 480.00	?
10	TO CARRY OUT DIAGNOSTIC CHECK.	S/N \$ 192.00	
TOTAL LABOUR CHARGES - FRONT & REAR		: \$ 23,972.00	

55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SLN 6249 U - FRONT

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
1	FRONT BUMPER <i>de/</i>	1	\$ 2,273.00	
2	FRONT BUMPER FIXING PARTS <i>X</i>	1	\$ 207.00	
3	FRONT BUMPER GUIDE SECTION - LH / RH <i>?</i>	2	\$ 92.00	
4	FRONT BUMPER GRILLE - CENTER <i>de/</i>	1	\$ 190.00	
5	FRONT BUMPER CLOSING ELEMENT - LOWER CENTRE <i>?</i>	1	\$ 352.00	
6	FRONT BUMPER CLOSING ELEMENT - LH / RH <i>?</i>	2	\$ 674.00	
7	RADIATOR GRILLE <i>con/</i>	1	\$ 1,679.00	
8	RADIATOR GRILLE CLOSING ELEMENT <i>?</i>	1	\$ 223.00	
9	AIR CONDITIONER STICKER <i>ne/</i>	1	\$ 9.00	
10	CAUTION SIGN STICKER <i>ne/</i>	1	\$ 17.00	
11	FRONT BUMPER AIR GUIDE GRILLE - LH / RH <i>?</i>	2	\$ 444.00	
12	FRONT BUMPER REINFORCEMENT BEAM <i>?</i>	1	\$ 974.00	
13	FRONT BUMPER FOAM FILLER PIECE <i>?</i>	1	\$ 224.00	
14	FRONT BUMPER REINFORCEMENT BEAM COVER <i>?</i>	1	\$ 144.00	
15	BONNET <i>st/</i>	1	\$ 3,434.00	
16	BONNET ATTACHMENT PARTS <i>X</i>	1	\$ 182.00	
17	BONNET HINGE - LH / RH <i>X</i>	2	\$ 146.00	
18	BONNET EDGE PROTECTION <i>ne/</i>	1	\$ 33.00	
19	BONNET CATCH HOOK <i>X</i>	1	\$ 106.00	
20	BONNET STRIKER - LH / RH <i>?</i>	2	\$ 260.00	
SUB TOTAL SPARE PARTS - FRONT		:	\$ 11,663.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.

55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SLN 6249 U - FRONT

			DAMAGED PARTS & PRICES		
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS	
21	BONNET LOCK - LH / RH <i>X</i>	2	\$	481.00	
22	BONNET BOWDEN CABLE - CENTER <i>?</i>	1	\$	67.00	
23	BONNET RELEASE CABLE COVER <i>?</i>	1	\$	12.00	
24	BONNET CATCH HOOK <i>bt / (Lower)</i>	1	\$	75.00	
25	FRONT PLENUM CHAMBER COVER <i>X</i>	1	\$	211.00	
26	HEADLIGHT - LH / RH <i>?</i>	2	\$	12,464.00	
27	FRONT FENDER - LH / RH <i>repair</i>	2	\$	2,024.00	
28	FRONT FENDER RIVET <i>X</i>	16	\$	64.00	
29	FRONT FENDER CLOSING ELEMENT - LH / RH <i>X</i>	2	\$	146.00	
30	FRONT FENDER BRACKET - LH / RH <i>X</i>	2	\$	144.00	
31	FRONT FENDER BRACE - LH / RH <i>X</i>	2	\$	228.00	
32	FRONT WHEEL HOUSING LINER - LH / RH <i>X</i>	2	\$	396.00	
33	LIFT CYLINDER - LH / RH <i>X</i>	2	\$	330.00	
34	LIFT CYLINDER HOSE <i>X</i>	1	\$	81.00	
35	LIFT CYLINDER WASH WATER RESERVOIR <i>X</i>	1	\$	231.00	
36	LOCK CARRIER MOUNTING <i>?</i>	1	\$	854.00	
37	OUTSIDE TEMPERATURE SENSOR BRACKET <i>?</i>	1	\$	22.00	
38	A/C CONDENSER <i>?</i>	1	\$	641.00	
39	A/C CONDENSER REFRIGERANT LINE <i>?</i>	1	\$	627.00	
40	A/C CONDENSER REFRIGERANT LINE <i>?</i>	1	\$	503.00	
SUB TOTAL SPARE PARTS - FRONT		:	\$	19,601.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.

55 UBI ROAD 1, SINGAPORE 408699
 TEL : 6366 2323 FAX : 6841 1183
 EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SLN 6249 U - FRONT

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
41	A/C CONDENSER REFRIGERANT LINE ?	1	\$ 574.00	
42	ADDITIONAL RADIATOR ?	1	\$ 967.00	
43	RADIATOR ?	1	\$ 1,099.00	
44	RADIATOR BRACKET - LH / RH UPPER ?	2	\$ 92.00	
45	RADIATOR BUSH - LH / RH LOWER ?	2	\$ 22.00	
46	READY-MIX COOLANT ?	6	\$ 326.00	
47	RADIATOR AIR GUIDE - LH / RH ?	2	\$ 62.00	
48	RADIATOR AIR GUIDE SEAL - RH OUTER ?	1	\$ 10.00	
49	RADIATOR AIR GUIDE - UPPER CENTRE ?	1	\$ 20.00	
50	AIR INLET COVER ?	1	\$ 31.00	
51	RADIATOR AIR DUCT ?	1	\$ 60.00	
52	RADIATOR AIR DUCT ?	1	\$ 21.00	
53	RADIATOR WATER DRAINAGE HOSE ?	1	\$ 38.00	
54	RADIATOR AIR GUIDE ?	1	\$ 71.00	
55	FRONT NUMBER PLATE 41	S/N	\$ 60.00	
SUB TOTAL SPARE PARTS - FRONT		:	\$ 34,717.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
 SPARE PARTS ARE SPECIAL NETT.

55 UBI ROAD 1, SINGAPORE 408699
 TEL : 6366 2323 FAX : 6841 1183
 EMAIL : NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SLN 6249 U - REAR

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
1	REAR BUMPER <i>de ✓</i>	1	\$ 2,328.00	
2	REAR BUMPER FIXING PARTS ?	1	\$ 213.00	
3	REAR BUMPER SPOILER <i>de ✓</i>	1	\$ 279.00	
4	REAR WHEEL HOUSING LINER ADAPTER - LH / RH ?	2	\$ 90.00	
5	REAR BUMPER LOCKING MECHANISM - LH / RH ?	2	\$ 34.00	
6	REAR BUMPER REFLECTOR - LH / RH ?	2	\$ 72.00	
7	REAR OUTER TAIL LIGHT - LH / RH ?	2	\$ 2,060.00	
8	REAR INNER TAIL LIGHT - LH / RH ?	2	\$ 2,060.00	
9	REAR LICENCE PLATE LIGHT - LH / RH X	2	\$ 211.00	
10	REAR BUMPER SIDE REINFORCEMENT ?	1	\$ 680.00	
11	REAR BUMPER BRACKET - LH / RH ?	2	\$ 67.00	
12	REAR BUMPER GUIDE SECTION - LH / RH ?	2	\$ 158.00	
13	REAR PARKING AID SENSOR - INNER / OUTER ?	2	\$ 543.00	
14	REAR PARKING AID SEAL RING <i>ne ✓</i>	4	\$ 11.00	
15	REAR BUMPER WIRING SET ?	1	\$ 578.00	
16	REAR LID <i>bt ✓</i>	1	\$ 3,373.00	
17	REAR LID ATTACHMENT PARTS ?	1	\$ 326.00	
18	REAR LID HINGE - LH / RH ?	2	\$ 350.00	
19	REAR LID FLAP GASKET <i>ne ✓</i>	1	\$ 242.00	
20	REAR LID LOCK X	1	\$ 196.00	
SUB TOTAL SPARE PARTS - REAR		:	\$ 13,871.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
 SPARE PARTS ARE SPECIAL NETT.

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SLN 6249 U - REAR

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
21	REAR LID FLAP LOCK COVER CAP X	1	\$	9.00
22	REAR LID LOCK ACTUATOR PUSH BUTTON X	1	\$	222.00
23	PACKING ADHESIVE ne /	1	\$	22.00
24	REAR LID LOCK STRIKER X	1	\$	104.00
25	AUDI EMBLEM ne /	1	\$	152.00
26	"A3" INSCRIPTION ne /	1	\$	110.00
27	"TFSI" INSCRIPTION ne /	1	\$	110.00
28	REAR WINDOW ne photo?	1	\$	961.00
29	WINDOW PRIMER ne /	1	\$	24.00
30	REAR SPOILER FIXING PARTS ne /	1	\$	194.00
31	REAR SPOILER FOAM STRIPS ne /	1	\$	162.00
32	REAR CROSS PANEL ?	1	\$	273.00
33	REAR CROSS PANEL REINFORCEMENT ?	1	\$	1,244.00
34	REAR CROSS PANEL CONNECTING PLATE - LH / RH ?	2	\$	102.00
35	REAR SILENCER ?	1	\$	990.00
36	REAR SILENCER DUAL CLIP ?	1	\$	66.00
37	EXHAUST SYSTEM RETAINER ?	2	\$	105.00
38	EXHAUST TAIL PIPE CHROME TRIM sa /	1		TBC
39	REAR SILENCER HEAT SHIELD bt /	1	\$	185.00
40	REAR CROSS PANEL TRIM ?	1	\$	181.00
SUB TOTAL SPARE PARTS - REAR		:	\$	5,216.00

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.

55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SLN 6249 U - REAR

			DAMAGED PARTS & PRICES	
S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
41	ACRYLIC SEALANT ?	S/N	\$ 180.00	
42	CAVITY WAX ?	S/N	\$ 140.00	
43	STONE CHIP ?	S/N	\$ 180.00	
44	METAL FILLER POWDER ?	S/N	\$ 280.00	
45	REAR NUMBER PLATE su /	S/N	\$ 60.00	
46	REAR WINDSCREEN SEALANT m /	S/N	\$ 200.00	
47	SUNDRIES ?	\$	500.00	
TOTAL SPARE PARTS - FRONT & REAR		:	\$ 55,344.00	
TOTAL LABOUR CHARGES - FRONT & REAR		:	\$ 23,972.00	
GRAND TOTAL		:	\$ 79,316.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.



55 UBI ROAD 1, SINGAPORE 408699
TEL : 6366 2323 FAX : 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

NAME
SURVEYED DATE
AUTHORISED DATE
EXCESS COST
LIABILITY
REMARKS

: Rasul - Hp 90010068
: 28/02/23 P 1530
: 9 days
: P/P
: Resy before paint

PLEASE NOTE

: THIS ESTIMATE IS BASED ON VISUAL INSPECTION OF THE AFFECTED VEHICLE. SHOULD WE REQUIRE FURTHER LABOUR CHARGES AND SPARE PARTS IN THE PROGRESS OF REPAIR, WE SHALL INFORM YOU ACCORDINGLY. FOR INSPECTION OF VEHICLE, PLEASE REFER TO MS. NORA KHAI AT TEL: 6768 9828 / 6768 9911 FOR APPOINTMENT.

YOURS FAITHFULLY,
PREMIUM AUTOMOBILES PTE LTD

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

JOHNNY BOO
BODY REPAIR MANAGER

ALLAN WU
CLAIMS CONSULTANT

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Singapore NRIC
Owner ID: 412Z

Vehicle Details

Vehicle No.: SLN6249U
Vehicle to be Exported: No
Intended Deregistration Date: 05 Mar 2023
Vehicle Make: AUDI
Vehicle Model: A3 SPORTBACK 1.0 TFSI S TRONIC (LED)
Primary Colour: Blue
Manufacturing Year: 2017
Engine No.: CHZ338275
Chassis No.: WAUZZZ8VXHA115564
Maximum Power Output: 85.0 kW (113 bhp)
Open Market Value: \$23,754.00
Original Registration Date: 11 May 2017
First Registration Date: 11 May 2017
Transfer Count: 0
Actual ARF Paid: \$15,256.00

Intended PARF Rebate Details

PARF Eligibility: Yes
PARF Eligibility Expiry Date: 10 May 2027
PARF Rebate Amount: \$10,679.00

Intended COE Rebate Details

COE Expiry Date: 10 May 2027
COE Category: A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years): 10
QP Paid: \$49,430.00
COE Rebate Amount: \$20,662.00
Total Rebate Amount: \$31,341.00

Audi A3 Sportback 1.0A TFSI S-tronic

Overview

[Financial](#)[Accessories](#)[Similar](#)[Research](#)[Photos](#)[Map](#)**Price****\$71,777****Depreciation** ?

\$15,320 /yr

[View models with similar depre](#)**Reg Date**

12-May-2017

(4yrs 2mths 6days COE left)

Mileage

N.A.

Manufactured ?

2017

Road Tax ?

\$392 /yr

Transmission

Auto

Dereg Value ?\$32,285 as of today ([change](#))**OMV** ?

\$23,758

COE ?

\$51,600

ARF ?

\$15,262

Engine Cap

999 cc

Power

85.0 kW (113 bhp)

Curb Weight ?

1,275 kg

No. of Owners ?

1

Type of Vehicle[Hatchback](#)

Features

[View specs of the Audi S3 Sportback \(2009-2013\)](#)