

Thiam Heng Huat Pte Ltd

176 Sin Ming Drive #05-14 Sin Ming Autocare Singapore 575721
 Mobile: (65) 8263 6295 Email: thiamhenghuat@gmail.com

Make/Model: OPEL ZAFIRA

Engine/Chassis No.: W0VPE9EC3J1042154

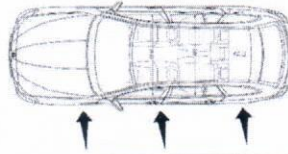
Date of accident: 28.02.23

Damaged area: N/S

Date: 06/03/2023

Claim Type: TP

VRN: SMY426U

**List items**

S/N	Parts description	QTY	UNIT PRICE	AMOUNT
1	Front door n/s <i>1612</i>	1	\$ 1,980.00	\$ 1,980.00
2	Front door top hinge n/s	1	\$ 136.00	\$ 136.00
3	Front door lower hinge n/s	1	\$ 136.00	\$ 136.00
4	Front door inner trim board n/s	1	\$ 683.00	\$ 683.00
5	Front door outer handle n/s <i>182</i>	1	\$ 296.00	\$ 296.00
6	Front door outer handle quarter cover n/s	1	\$ 95.00	\$ 95.00
7	Front door lock n/s	1	\$ 285.00	\$ 285.00
8	Front door lock striker n/s	1	\$ 69.00	\$ 69.00
9	Front door window regulator n/s	1	\$ 336.00	\$ 336.00
10	Front door window motor n/s	1	\$ 286.00	\$ 286.00
11	Front door window outer channel n/s	1	\$ 113.00	\$ 113.00
12	Front door window outer chrome moulding n/s	1	\$ 265.00	\$ 265.00
13	Rear door n/s	1	\$ 1,895.00	\$ 1,895.00
14	Rear door top hinge n/s	1	\$ 136.00	\$ 136.00
15	Rear door lower hinge n/s	1	\$ 136.00	\$ 136.00
16	Rear door inner trim board n/s	1	\$ 694.00	\$ 694.00
17	Rear door outer handle n/s	1	\$ 296.00	\$ 296.00
18	Rear door outer handle quarter cover n/s	1	\$ 95.00	\$ 95.00
19	Rear door lock n/s	1	\$ 385.00	\$ 385.00
20	Rear door lock striker n/s	1	\$ 88.00	\$ 88.00
21	Rear door window regulator n/s	1	\$ 436.00	\$ 436.00
22	Rear door window motor n/s	1	\$ 386.00	\$ 386.00
23	Rear door window outer channel n/s	1	\$ 145.00	\$ 145.00
24	Rear door window outer chrome moulding n/s	1	\$ 295.00	\$ 295.00
25	Front fender n/s <i>704</i>	1	\$ 929.00	\$ 929.00
26	Front fender cowling n/s	1	\$ 237.00	\$ 237.00
27	Front shock absorber n/s	1	\$ 467.00	\$ 467.00
28	Front shock absorber mounting n/s	1	\$ 102.00	\$ 102.00
29	Front lower arm n/s	1	\$ 387.00	\$ 387.00
30	Front wheel knuckle n/s	1	\$ 469.00	\$ 469.00
31	Front wheel bearing n/s	1	\$ 214.00	\$ 214.00
32	Rear bumper	1	\$ 893.00	\$ 893.00

LKK Auto Consultants hence notify
 the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Repair Estimate

33	Rear bumper side retainer	Sm	2	\$ 75.00	\$ 150.00	X
34	Taillamp n/s	Sm	1	\$ 685.00	\$ 685.00	X
35	Rear fender n/s	R	1	\$ 1,184.00	\$ 1,184.00	X
36	Rear fender cowling n/s	Sm	1	\$ 185.00	\$ 185.00	X
37	Front fender signal lamp n/s	112 CM	1	\$ 158.00	\$ 158.00	✓
38	Rear fender quarter glass moulding n/s	Sm	1	\$ 137.00	\$ 137.00	X
39	Rear fender quarter glass chrome moulding n/s	Sm	1	\$ 235.00	\$ 235.00	X
40	Wing mirror n/s	Sm	1	\$ 663.00	\$ 663.00	X
41	Wing mirror outer cover n/s	Sm	1	\$ 145.00	\$ 145.00	X
				Subtotal	\$ 16,907.00	
				List discount	10.00%	
				Total	\$ 15,216.30	

Special nett items

No.	Parts description	QTY	UNIT PRICE	AMOUNT	
1	Front door inner trim board clips n/s	12	\$ 5.50	\$ 66.00	X
2	Rear door inner trim board clips n/s	12	\$ 5.50	\$ 66.00	X
3	Rear fender cowling clips n/s	8	\$ 5.50	\$ 44.00	X
4	Rear bumper clips	12	\$ 5.50	\$ 66.00	X
5	Front fender cowling clips n/s	8	\$ 5.50	\$ 44.00	✓
6	Front alloy wheel n/s	1	\$ 550.00	\$ 550.00	X
7	Front tyre n/s	1	\$ 280.00	\$ 280.00	X
8	Sundries	1	\$ 50.00	\$ 50.00	X
				Total	\$ 1,166.00

Labour

No.	Description	Work unit	Amount	
1	To dismantle / renew accident damaged portion. To panel beat, reshape, straighten, orientate and align repair / replacement parts.	8	\$ 1,600.00	500
2	To disconnect n/s doors wire harness of electrical components to facilitate repairs, reconnect and check functions of power windows.	0.5	\$ 100.00	200
3	To remove and refit n/s doors components to replace both n/s doors, check alignment.	1	\$ 200.00	600
4	To remove and refit n/s rear fender glass to facilitate repair.	0.75	\$ 150.00	X
5	To remove and replace n/s front tyre & rim. To perform tyre balancing.	0.25	\$ 50.00	X
6	To conduct computerized wheel alignment.	0.75	\$ 150.00	600
7	To remove and refit n/s front undercarriage for replacement of parts.	1	\$ 200.00	X
8	Supply spray paint material and necessary items to respray affected area / panel.	7	\$ 1,400.00	800
9	To rust proof all affected portions after repair.	0.5	\$ 100.00	60
Total labour			\$ 3,950.00	

Estimate Grand Total	\$ 20,332.30
-----------------------------	---------------------