



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2304392

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 11/07/2023
Reference CC6/CTI23002401/Uya3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SKZ 9580R
Insured Veh. SJL 1564B
Claim No. SNM23D201710/C02
Policy No. DMHCSNW00018352200
Accident Date 03/03/2023
Inspection Date 07/03/2023

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI23002401/Uya3q2 Date: 11/07/2023 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SJL 1564B	Veh. Inspected	SKZ 9580R	
Policy No.	DMHCSNW00018352200	Coverage (\$)	0.00	
Claim No.	SNM23D201710/C02	Excess (\$)	0.00	
Assign From		Assign Date	07/03/2023	
2. Vehicle Particulars & Condition				
Make & Model	HONDA CITY (A)	c.c	1497	
Engine No.	HIDDEN	Year of Reg.	2016	
Chassis No.	MRHGM6660GP000421	Colour	SILVER	
Odometer	112910 KM	Steering	AFFECTED	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	185/55 R16	YOKOHAMA	6 mm	
L/H Front Tyre	185/55 R16	YOKOHAMA	6 mm	
R/H Rear Tyre	185/55 R16	YOKOHAMA	6 mm	
L/H Rear Tyre	185/55 R16	YOKOHAMA	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE O/S FRONT PORTION ,O/S BODY.THE UNDERCARRIAGE AFFECTED DUE TO COLLISION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	03/03/2023	Inspection Date	07/03/2023	
Survey held at	FASTECH AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		5 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKZ 9580R

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BUMPER	DISTORTED	793.00	459.80
1	FRONT BUMPER SIDE RETAINER O/S	BENT	66.50	32.50
1	SET FRONT BUMPER CLIPS	NECESSARY	50.00	35.00
1	FRONT BUMPER BEAM	NOT NECESSARY	341.00	-
1	FRONT BUMPER FOG LAMP O/S	CRACKED	332.10	277.60
1	FRONT BUMPER FOG LAMP GARNISH O/S	TWISTED	105.80	82.10
1	HEADLAMP O/S	HOLDER CRACKED	2,650.00	860.20
1	HEADLAMP LOWER BRACKET O/S	NOT NECESSARY	85.50	-
1	FRONT FENDER O/S	BADLY DENTED	685.20	453.80
1	FRONT FENDER INNER SHIELD O/S	TORN	245.20	145.20
1	SET FRONT FENDER INNER SHIELD CLIPS O/S	NECESSARY	50.00	30.00
1	FRONT FENDER INNER GARNISH O/S	TWISTED	121.30	62.80
1	FRONT FENDER INNER PANEL O/S	TO REPAIR SEE LABOUR	485.20	-
1	FRONT FENDER INNER ARCH FRT PANEL O/S	DENTED / BENT	221.00	221.00
1	FRONT SHOCK ABSORBER O/S	BENT	665.20	392.50
1	FRONT LOWER ARM O/S	BUCKLED	685.40	422.80
1	FRONT KNUCKLE ARM O/S	BENT	605.20	452.50
1	FRONT KNUCKLE ARM BEARING O/S	NECESSARY	350.00	185.00
1	FRONT DRIVE SHAFT O/S	NOT NECESSARY	1,128.30	-
1	FRONT DOOR O/S	TO REPAIR SEE LABOUR	1,485.20	-
2	FRONT DOOR HINGES @\$105.00	NOT NECESSARY	210.00	-
1	FRONT DOOR INNER LOCK O/S	NOT NECESSARY	145.00	-
1	FRONT DOOR OUTER HANDLE O/S	NOT NECESSARY	288.30	-
1	FRONT DOOR MIRROR ASSY O/S	DAMAGED	845.20	615.20
1	FRONT DOOR MIRROR OUTER COVER O/S	BROKEN / MISSING	165.20	118.50
1	FRONT DOOR MIRROR BLACK GARNISH O/S	TWISTED	115.80	90.80
1	FRONT DOOR INNER RUBBER O/S	NOT NECESSARY	242.30	-
1	FRONT DOOR OUTER PILLAR O/S	TO REPAIR SEE LABOUR	899.30	-
1	SET FRONT DOOR FRAME BLACK STICKER O/S	NOT NECESSARY	60.00	-

Report Ref No. CC6/CTI23002401/Uya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR DOOR O/S	TO REPAIR SEE LABOUR	1,322.30	-
1	REAR DOOR GLASS OUTER MOULDING O/S	NOT NECESSARY	108.80	-
1	ROCKER PANEL O/S	TO REPAIR SEE LABOUR	685.20	-
1	REAR FENDER O/S	TO REPAIR SEE LABOUR	955.80	-
	LESS 20% DISCOUNT		-	-987.46
			17,194.30	3,949.84
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT SPORT RIM O/S (SN)	CUT / WARPED	1,500.00	480.00
1	FRONT DOOR VISOR O/S (SN)	NOT NECESSARY	90.00	-
1	REAR SPORT RIM O/S (SN)	CUT	1,500.00	480.00
			3,090.00	960.00
	<u>LABOUR</u>			
	TO CHECK WIRING .		50.00	30.00
	TO DISMANTLE & REPLACED FRONT UNDER CARRIAGE .		180.00	150.00
	TO DISMANTLE & REFIX DOOR MECHANISM .	NOT NECESSARY	180.00	-
	TO CONDUCT WHEEL ALIGNMENT.		150.00	80.00
	TO DISMANTLE & REFIX CUSHION UPHOLSTERY .		120.00	60.00
	TO SPRAY RUST PROOFING .		150.00	50.00
	TO RESET & REPROGRAMME SYSTEM.		180.00	50.00
	LABOUR FOR PANEL BEATING & REPLACED PARTS .INCLUSIVE OF THE REPAIR OF FRONT FENDER INNER PANEL O/S ,FRONT DOOR O/S,FRONT DOOR OUTER PILLAR O/S ,REAR DOOR O/S ,ROCKER PANEL O/S AND REAR FENDER O/S .		1,800.00	880.00
	TO PUTTY & SPRAY PAINTING.		2,000.00	1,300.00
			4,810.00	2,600.00
GRAND TOTAL			25,094.30	7,509.84

Report Ref No. CC6/CTI23002401/Uya3q2



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			6,000.00
---	--	--	-----------------

Report Ref No. CC6/CTI23002401/Uya3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKZ 9580R

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

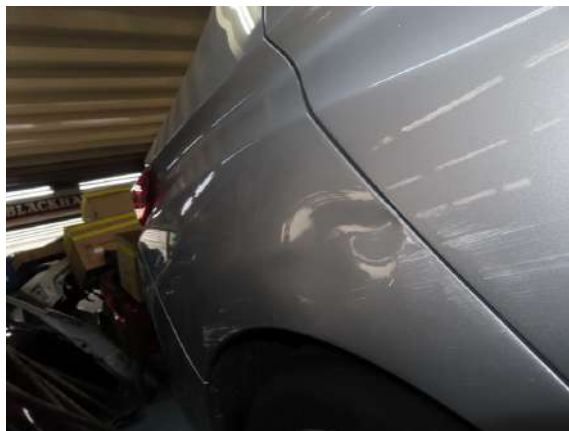



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKZ 9580R

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKZ 9580R

RE-INSPECTION

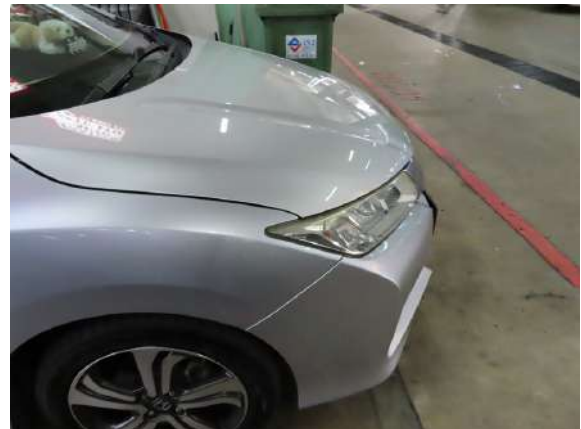



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

