



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2303946

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 20/06/2023
Reference CC6/CTI23002458/Uya3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SJJ 5804T
Insured Veh. PA 9958H
Claim No. SNM23D201790/C02
Policy No.
Accident Date 08/03/2023
Inspection Date 08/03/2023

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI23002458/Uya3q2 Date: 20/06/2023 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	PA 9958H	Veh. Inspected	SJJ 5804T
	Policy No.		Coverage (\$)	0.00
	Claim No.	SNM23D201790/C02	Excess (\$)	0.00
	Assign From		Assign Date	08/03/2023
2. Vehicle Particulars & Condition				
	Make & Model	TOYOTA COROLLA ALTIS (A)	c.c	1598
	Engine No.	HIDDEN	Year of Reg.	2008
	Chassis No.	MROS3ZEE106100113	Colour	GREY
	Odometer	143849 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	195/65 R15	FIRENZA	6 mm
	L/H Front Tyre	195/65 R15	FIRENZA	6 mm
	R/H Rear Tyre	195/65 R15	FIRENZA	6 mm
	L/H Rear Tyre	195/65 R15	FIRENZA	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	08/03/2023	Inspection Date	08/03/2023
	Survey held at	FASTECH AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJJ 5804T

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BOOTLID	BADLY DENTED	1,266.10	1,099.10
1	BOOTLID REAR LOGO	NECESSARY	68.50	68.50
1	BOOTLID 'COROLLA' EMBLEM	NECESSARY	62.80	62.80
1	BOOTLID 'ALTIS' EMBLEM	NECESSARY	58.00	58.00
1	BOOTLID '1.6' EMBLEM	NECESSARY	48.00	48.00
1	BOOTLID INNER LOCK	TWISTED	409.10	309.10
1	BOOTLID LOCK STRICKET	NOT NECESSARY	66.80	-
1	BOOTLID WEATHERSTRIP	TWISTED	282.30	282.30
2	BOOTLID REFLECTORS @\$450.90	N/S CRACKED / O/S NOT NECESSARY	901.80	306.10
1	BOOTLID INNER TRIM	NOT CHANGED	366.10	-
1	BOOTLID OUTER CHROME MOULDING	CRACKED	388.10	366.50
1	REAR BUMPER	DISTORTED	655.10	521.10
1	REAR BUMPER SPONGE	TORN	505.40	299.50
2	REAR BUMPER REFLECTORS @\$60.00	NOT NECESSARY	120.00	-
2	REAR BUMPER SIDE RETAINERS @\$65.00	BENT	130.00	130.00
1	SET REAR BUMPER CLIPS	NECESSARY	50.00	50.00
1	REAR END PANEL	BADLY DENTED	788.20	615.10
1	REAR END PANEL TOP GARNISH	TWISTED	362.30	288.20
2	TAILLAMPS @\$580.00	N/S CRACKED	1,160.00	425.10
2	TAILLAMP LOWER BRACKETS @\$65.00	N/S CRACKED	130.00	65.00
1	REAR ANTENNA SENSOR	NOT NECESSARY	241.20	-
1	REAR FLOOR PANEL	TO REPAIR SEE LABOUR	1,145.20	-
1	REAR FLOOR PANEL TOP BOARD	TORN	620.50	425.10
2	REAR FENDERS @\$1099.10	TO REPAIR SEE LABOUR	2,198.20	-
2	REAR FENDER INNER TRIMS @\$450.00	N/S TWISTED / O/S NOT NECESSARY	900.00	381.10
	LESS 25% DISCOUNT		-	-1,450.15
			12,923.70	4,350.45



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>SPECIAL NETT ITEMS</u>			
1	SET REAR BUMPER REVERSE SENSOR (SN)	SHORTED	280.00	200.00
1	REAR END PANEL SEALANT (SN)	NECESSARY	50.00	50.00
1	SET REAR FLOOR PANEL INSULATOR (SN)	NOT NECESSARY	250.00	-
1	REAR LICENCE PLATE (SN)	BENT	50.00	40.00
			630.00	290.00
	<u>LABOUR</u>			
	TO CHECK WIRING .		50.00	20.00
	TO DISMANTLE & REPLACED REVERSE SENSOR .		80.00	50.00
	TO DISMANTLE & REFIX BOOTLID MECHANISM .		100.00	60.00
	TO DISMANTLE & REFIX CUSHION UPHOLSTERY .		120.00	80.00
	TO SPRAY RUST PROOFING.		100.00	60.00
	LABOUR FOR PANEL BEATING & REPLACED PARTS.INCLUSIVE OF THE REPAIR OF REAR FLOOR PANEL AND REAR FENDERS.		1,600.00	800.00
	TO PUTTY & SPRAY PAINTING.		1,800.00	1,000.00
			3,850.00	2,070.00
	GRAND TOTAL		17,403.70	6,710.45
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			5,000.00

Report Ref No. CC6/CTI23002458/Uya3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJJ 5804T

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

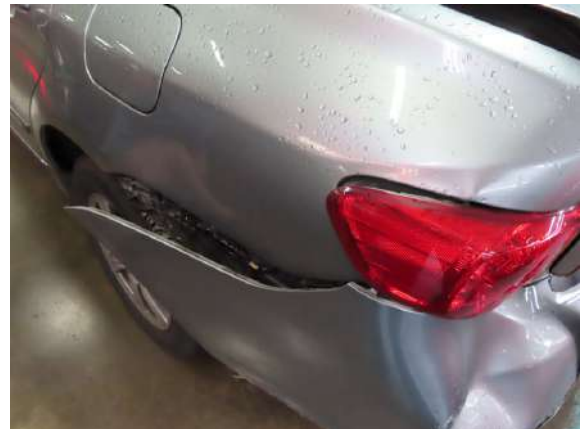



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

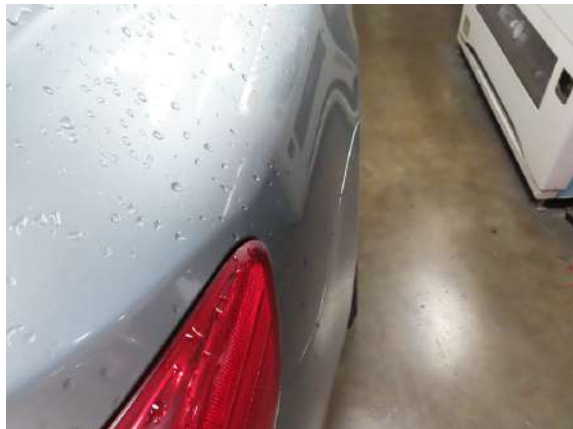



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJJ 5804T

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJJ 5804T

RE-INSPECTION

