



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2303600

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 07/06/2023
Reference CC3/CTI23002478/Kya3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SMM 734T
Insured Veh. SMU 876A
Claim No. SNM23D201689
Policy No. DMPCSNA00158572201
Accident Date 03/03/2023
Inspection Date 07/03/2023

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC3/CTI23002478/Kya3q2 Date: 07/06/2023 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SMU 876A	Veh. Inspected	SMM 734T
	Policy No.	DMPCSNAA00158572201	Coverage (\$)	0.00
	Claim No.	SNM23D201689	Excess (\$)	0.00
	Assign From		Assign Date	07/03/2023
2. Vehicle Particulars & Condition				
	Make & Model	KIA CERATO (A)	c.c	1591
	Engine No.	HIDDEN	Year of Reg.	2010
	Chassis No.	KNAFW411MA5174808	Colour	METALLIC SILVER
	Odometer	260222 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	225/45 R17	FIRENZA	8 mm
	L/H Front Tyre	225/45 R17	FIRENZA	8 mm
	R/H Rear Tyre	225/45 R17	FIRENZA	9 mm
	L/H Rear Tyre	225/45 R17	FIRENZA	9 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	03/03/2023	Inspection Date	07/03/2023
	Survey held at	HUI YANG MOTOR PTE LTD BLOCK 176 SIN MING DRIVE #04-02 SIN MING AUTOCARE SINGAPORE 575721		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMM 734T

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BOOT COVER	BENT	1,150.50	1,091.00
2	REAR BOOT COVER HINGE @\$69.50	TO REPAIR SEE LABOUR	139.00	-
1	REAR BOOT COVER 'KIA' LOGO	NECESSARY	70.00	70.00
1	REAR BOOT COVER 'FORTE' EMBLEM	NECESSARY	65.00	58.00
1	REAR BOOT COVER 'CERATD' EMBLEM	NECESSARY	65.00	58.00
1	REAR BOOT COVER 'C&C' LOGO	NECESSARY	55.00	55.00
2	REAR BOOT COVER SIDE REFLECTOR @\$345.00	MTG CRACKED	690.00	690.00
1	REAR BOOT COVER INNER LOCK	DENTED	358.00	187.60
1	REAR BOOT COVER INNER TRIM	DEFORMED	255.00	255.00
1	REAR BUMPER	BENT	958.20	601.00
2	REAR BUMPER SIDE RETAINER @\$45.00	SERVICEABLE	90.00	-
1	REAR BUMPER DIFFUSED	CRACKED	355.20	355.20
1	REAR BUMPER SPONGE	CRACKED	220.50	220.50
1	REAR BUMPER REINFORCEMENT	CRACKED	350.00	350.00
2	REAR BUMPER REINFORCEMENT SIDE BRACKET @\$75.00	BENT	150.00	150.00
5	REAR BUMPER REINFORCEMENT TOP & LOWER BRACKET @\$25.00	CRACKED (2 PCS ONLY)	125.00	50.00
3	REAR BUMPER PARKING SENSOR @\$198.50	SHORTED (2 PCS ONLY)	595.50	397.00
2	REAR TAILLAMP @\$458.00	MTG CRACKED	916.00	916.00
2	REAR TAILLAMP LOWER BRACKET @\$35.00	SERVICEABLE	70.00	-
1	REAR BUMPER REINFORCEMENT SENSOR	CRACKED	195.20	195.20
1	REAR END PANEL	BENT	480.00	382.00
1	REAR END PANEL INNER GARNISH	MTG DISTORTED	280.50	143.00
1	REAR FLOOR PANEL	TO REPAIR SEE LABOUR	851.20	-
1	REAR FLOOR PANEL TRIM CARDBOARD	CRACKED	458.20	312.00
	LESS 10% DISCOUNT		-894.30	-653.65
			8,048.70	5,882.85

Report Ref No. CC3/CTI23002478/Kya3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR BOOT COVER INNER RUBBER (50%) (SN)	DISTORTED / DENTED	185.00	92.50
	LESS 10% DISCOUNT		-18.50	-
			166.50	92.50
	<u>SPECIAL NETT ITEMS</u>			
1	SET REAR NUMBER & CASING (SN)	DENTED	50.00	45.00
			50.00	45.00
	<u>LABOUR</u>			
	TUFFKOTE .		150.00	60.00
	WIRING.		150.00	20.00
	SPRAY PAINTING.		1,400.00	1,000.00
	LABOUR CHARGE.INCLUSIVE OF THE REPAIR OF REAR BOOT COVER HINGE AND REAR FLOOR PANEL .		1,400.00	900.00
			3,100.00	1,980.00
GRAND TOTAL			11,365.20	8,000.35
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				6,400.00

Report Ref No. CC3/CTI23002478/Kya3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMM 734T

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

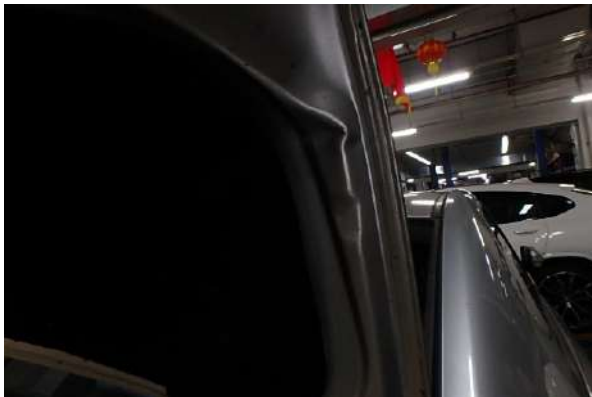



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

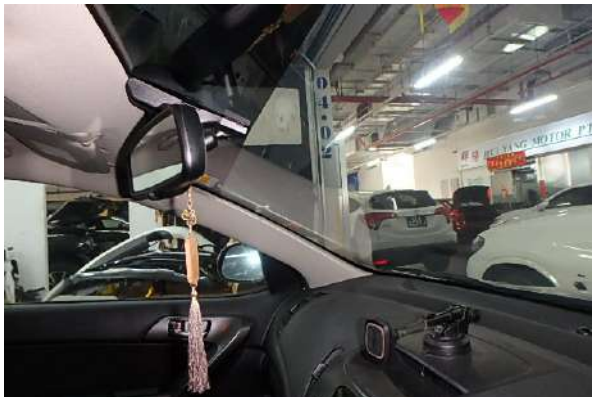



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMM 734T

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMM 734T

RE-INSPECTION

