



Century Motors



Century Motors (Singapore) Pte Ltd  
6 Marsiling Lane  
Singapore 739145

E: claims@autoinsure.com.sg

T: (65) 3157 2626

GST No.: 192800002R

Page No.1

AUTOMOBILE ASSESSMENT REPORT

Our Ref: SLF1034Y (MARVYN)

Your ref: SLP7770M

Date: 7-Mar-23

BY EMAIL ONLY  
(claims@autoinsure.com.sg)

Assessed Vehicle No : SLV7336C  
Car Make and Model : HONDA SHUTTLE 1.5G CVT  
Date of Accident : 5-Mar-23  
Date of Assessment : 6-Mar-23


We have carried out a physical assessment of SLV7336C at our workshop Auto Insure Pte Ltd sustained damages to the REAR portion of the vehicle.

4. DESCRIPTION OF DAMAGE

At the time of the inspection observed that this vehicle had sustained damages to the REAR portion of the vehicle.

Please see attached schedule for details.

Remarks: NIL

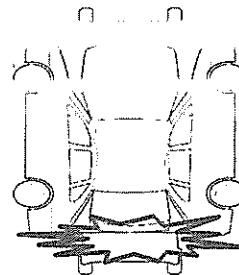

Estimated Amount : L/S  
Adjusted Amount : \$ 9,614.24  
Est. Repair Days : 7

Pursuant to your instruction, we have NOT AUTHORIZED repair.  
The assessment was conducted on a "WITHOUT PREJUDICE" basis.

If we are not notified of anything within 14 Days from the date hereof, this report shall be treated as correct.

Disclaimer

This report is intended for the exclusive use of the addressee solely in relation to the loss of occurrence in which the assessed vehicle is involved.

No liability or responsibility whatsoever shall be held by

**Century Motors (Singapore) Pte Ltd** For any reliance on this report by any third party.

Our Ref: SLV7336C

Your Ref: YR38B

S/NO	QTY	DESCRIPTIONS	ASSESSED CONDITION	EST. BY WORKSHOP
<b>PARTS REPLACEMENT - LIST ITEMS</b>				
1	1	TAILGATE <i>Buc</i>		\$ 1,431.84
2	1	TAILGATE WEATHERSTRIP <i>PR?</i>		\$ 161.89
3	1	TAILGATE WINDSCREEN <i>Br</i>		\$ 1,201.84
4	1	TAILGATE ABOSORBER LH?		\$ 131.96
5	1	TAILGATE ABOSORBER RH?		\$ 131.96
6	1	TAILGATE HINGE LH?		\$ 68.24
7	1	TAILGATE HINGE RH?		\$ 68.24
8	1	TAILGATE LOGO (H) <i>NLC</i>		\$ 65.84
9	1	TAILGATE EMBLEM (SHUTTLE) <i>NLC</i>		\$ 95.04
10	1	TAILGATE GARNISH (CHROME)?		\$ 459.72
11	1	TAILGATE LOCK <i>Scr</i>		\$ 215.92
12	1	TAILGATE LAMP LH <i>rcu</i>		\$ 574.48
13	1	TAILGATE LAMP RH?		\$ 574.48
14	1	REAR TAILGATE INNER TRIM?		\$ 264.48
15	1	REAR BUMPER <i>Br</i>		\$ 1,380.72
16	1	REAR BUMPER RELECTOR RH <i>Scr</i>		\$ 80.72
17	1	REAR BUMPER COVER RH <i>Scr</i>		\$ 95.12
18	1	REAR BUMPER SIDE RETAINER RH?		\$ 48.20
19	1	REAR BUMPER SIDE RETAINER LH?		\$ 48.20
20	1	REAR END PANEL <i>Buc</i>		\$ 721.80
21	1	REAR QUARTER GLASS SEAL LH <i>Cut</i>		\$ 68.80
			SUB TOTAL	\$ 7,890.09
			LESS 20%	\$ 1,578.02
			TOTAL AMOUNT	\$ 6,312.07

Our Ref: SLV7336C

Your Ref: YR38B

S/NO	QTY	SPECIAL NETT ITEMS	ASSESSED CONDITION	EST. BY WORKSHOP
1	1	REAR BUMPER CLIPS IVCL		\$ 50.00
2	1	WINDSCREEN SELANT		\$ 60.00
3	1 SET	REAR PARKING SENSORS Faulty		\$ 250.00
			SUB TOTAL	\$ 360.00
			TOTAL PARTS COST	\$ 6,672.07

200

Our Ref: SLV7336C

Your Ref: YR38B

S/NO	DESCRIPTION	EST. BY WORKSHOP
	<b>LABOUR &amp; PAINTWORK</b>	
1	TO REMOVE THE AFFECTED PARTS & FITTINGS TO COMMENCE REPAIRS; PANEL BEAT & RESHAPE THE AFFECTED AREAS AND REPLACED THE DAMAGED PARTS AND COMPONENTS	\$ 800.00
2	TO REMOVE & REFIT WIRING SYSTEM AT ACCIDENT AND CHECK FOR PROPER FUNCTIONS	\$ 100.00
3	TO REMOVE & REFIT REAR TAILGATE MECHANISM	\$ 100.00
4	TO REMOVE & REFIT REAR TAILGATE WINDSCREEN	\$ 150.00
5	TO REMOVE & REFIT REAR BUMPER REVERSE SENSORS	\$ 60.00
6	TO RESPRAY AND SUPPLY EXPANDABLE ITEMS & PUFFY ON PARTS REPLACED	\$ 800.00
7	TO PERFORM ANTI-RUST TREATMENT ON AFFECTED AREAS	\$ 50.00
8	SUNDRIES (SAND PAPER, WELDING WIRE ETC.)	\$ 50.00
9	TO VACUUM, WAXING & CLEAN	\$ 50.00
10	TO PERFORM WATER SEEPAGE TEST ON REPAIRED PORTIONS	\$ 50.00
	TOTAL BEFORE GST	\$ 8,902.07
	GST 8%	\$ 712.17
	TOTAL (PARTS & LABOUR):	\$ 9,614.24

600  
30  
60  
80  
30  
680  
40  
X  
20  
X

#### Adjustments / Recommendations

Our estimator have throughly inspected each and every item on the estimate against physical damage found on the vehicle and have listed the breakdown of our finding and recommendation.

Our Workshop has agreed to undertake the job at a **sum of \$ 9,614.24** for lump sum with the third party insurance.

Yours Faithfully,

Ck Loh  
Claims Estimator

5 days ~~45~~  
P/P

9/3/23  
545pm  
90097659  
lrn @ LinkAuto.com

