

ASS. REC. BY:

REF: ASV

ASSIGNMENT

Kenneth

From: _____

Date: _____

Estimated Cost: _____

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No: _____

at Workshop m/s _____

Ding

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____


Excess: _____

2K

(Client's Record)

Make of Veh: _____

(Policy Condition)

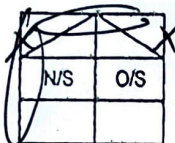Remark: The veh had commenced its
repair at the time of inspection.Bal. or Market Value: 879K

IDAC Accident Rpt: _____

Consistent? : Yes or No

GIA / PR Seen: _____

Consistent? : Yes or No

Est. Repairs: 28 days

Res.: Yes or No

Lum Sum: 20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____

Person Contacted: _____

Vehicle: IN / OUT

Veh No: SMS 37067Yr Regn: 02, 20Type: M Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or _____

Make: HondaFit

c.c

1317Colour: M-D Blue

A/C: _____

Insured / Std / NI / NA

Sp. Reading: _____

T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: GK 31351532Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Mod: M / S/Rim / STD A/Rim orTyre Size: F: B.SR: Westlake

175/70R14

D / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or _____

Front

Rear

R/Bal. 4 mmR/Bal. 8 mmL/Bal. 4 mmL/Bal. 8 mmD.O.A. 25/2/23D.O.I. 10/3/2023

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

FR L/N/S bodyThe U/C / ~~Chassis frame~~ Body Structure affected due to collision. ✓

Date / Time

Action / Instruction

1 Barley Plot, accident in Malaysia

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee: _____

Transportation

S + RS. SI

Fees

Others

Add Fee: ☐

: Site Insp (\$)

☐

: Interview (\$)

☐

Tech Invs (\$)

☐

Weekend (\$)

Report Format :

Lump Sum / I.B.I.: (\$)

Estimate Repair

Ding Auto Pte Ltd (Co.Reg.No:201311788Z)
176 Sin Ming Drive #04-06, Sin Ming Autocare
Singapore 575721

Tel: 64521208 Fax: 64520614 Email: ding@dingauto.sg;kenneth.ding@dingauto.sg

INSURER: **Allianz Insurance Singapore Pte. Ltd. (HQ)**

PARTICULARS OF CLAIM

Claim Type:	OD (Own Damage)	Ref. No:	
Policy No:	SP2003972742	Date of Loss:	25/02/2023
Vehicle Reg. No.:	SMS3706Z	Driveable?	
Driver Age/Info:	/ MALE	Party At Fault:	UNKNOWN
TP Injury Involved?	NO	Third Party Involved?	YES
Insured/Claimant:	J AUTO LEASING PTE LTD	Contact No:	+6581448822
Driver:	ASHMADOU AL SYAMMARY BIN HAJI SARIF		

Make/Model:	HONDA FIT, 1.3 GF CVT (A)	Vehicle Reg. Date:	24/02/2020
Vehicle Colour:	Blue		
Engine No:	L13B1461641	Chassis No:	GK31351532
Odometer:	0 KM		

Paint Type:

Total Loss? **NO**

Est. Duration of Repair (day) **30 20 days**

*Not withered
1/1 day &
Penny After Pain*

Present Location: **DING AUTO PTE LTD (HQ)**

COST OF CLAIMS

Amount

Parts	61,941.00
Miscellaneous Items	1,085.00
Labour	7,210.00
Paintwork Labour	0.00
Towing	0.00

Gross Total (\$\$) **70,236.00**

+ GST 8.00% (\$\$) **5,618.88**

Nett Amount (\$\$) **75,854.88**

This claim is handled by: **HENRY LEE YOON SANG**

Generated using Merimen e-Claims Internet Estimation & Adjusting System

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 09 Mar 2023)
 Parts: 143 HONDA FIT 1.3 GF CVT (A) (Catalogue:Merimen Singapore 1.0)
 Labour: Repairer's (Price-denominated Standard List)
 Print Code: Ding Auto Pte Ltd/SMS3706Z/09/03/2023 15:01
 Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
 Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Estimates on Parts

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1		*FRONT BUMPER	Mi	0.00	*560.00 F
2	1		*FRONT BUMPER RETAINER RH	CM	0.00	*20.00 F
3	1		*FRONT BUMPER RETAINER LH	CM	0.00	*20.00 F
4	1		*FRONT BUMPER SUPPORT	Mi	0.00	*225.00 F
5	1		*FRONT BUMPER SIDE COVER RH	Mi	0.00	*35.00 F
6	1		*FRONT BUMPER SIDE COVER LH	Mi	0.00	*35.00 F
7	1		*FRONT BUMPER LOWER GARNISH	Mi	0.00	*185.00 F
8	1		*BONNET	Bj	0.00	*320.00 F
9	1		*BONNET HINGE RH	Bj	0.00	*30.00 F
10	1		*BONNET HINGE LH	Bj	0.00	*30.00 F
11	1		*BONNET LOCK	Bj	0.00	*100.00 F
12	1		*BONNET INSULATOR	Tn	0.00	*110.00 F
13	1		*BONNET STAND	Mi	0.00	*35.00 F
14	1		*BONNET STAND HOOK	Mi	0.00	*15.00 F
15	1		*BONNET FRONT SEAL	Tn	0.00	*40.00 F
16	1		*BONNET RUBBER STOPPER RH	Mi	0.00	*20.00 F
17	1		*BONNET RUBBER STOPPER LH	Mi	0.00	*20.00 F
18	1		*FRONT GRILLE BASE	Mi	0.00	*270.00 F
19	1		*FRONT GRILLE UPPER CHROME MLDG	Mi	0.00	*155.00 F
20	1		*FRONT GRILLE CTR LOWER CHROME TRIM	Mi	0.00	*170.00 F
21	1		*FRONT LOWER GRILLE	Mi	0.00	*145.00 F
22	1		*FRONT GRILLE CTR BRACKET	Mi	0.00	*25.00 F
23	1		*FRONT GRILLE BADGE	Mi	0.00	*20.00 F
24	1		*FRONT SUPPORT PANEL CPL	Bj	0.00	*450.00 F
25	1		*FRONT SUPPORT PANEL UPPER GARNISH	Mi	0.00	*40.00 F
26	1		*FRONT FENDER RH	Bj	0.00	*185.00 F
27	1		*FRONT FENDER LH	Bj	0.00	*185.00 F
28	1		*FRONT FENDER INNER COVER RH	Tn	0.00	*75.00 F
29	1		*FRONT FENDER INNER COVER LH	Tn	0.00	*75.00 F
30	1		*FRONT FENDER - WHEELHOUSE REINF RH	Bj	0.00	*390.00 F
31	1		*FRONT FENDER - WHEELHOUSE REINF LH	Bj	0.00	*390.00 F
32	1		*FRONT SIDE PILLAR LH	Bj	0.00	*680.00 F
33	1		*WIPER PANEL	R	0.00	*205.00 F
34	1		*WIPER PANEL END GARNISH RH	CM	0.00	*30.00 F
35	1		*WIPER PANEL END GARNISH LH	nd	0.00	*30.00 F
36	1		*HEADLAMP ASSY RH	Mi	0.00	*580.00 F
37	1		*HEADLAMP ASSY LH	Mi	0.00	*580.00 F
38	1		*HEADLAMP BRACKET RH	Mi	0.00	*35.00 F
39	1		*HEADLAMP BRACKET LH	Mi	0.00	*35.00 F
40	1		*FRONT LOWER SIDE GARNISH RH	Mi	0.00	*25.00 F
41	1		*FRONT LOWER SIDE GARNISH LH	Mi	0.00	*25.00 F
42	1		*RADIATOR ASSY	1400 Bj	0.00	*1,180.00 F
43	1		*RADIATOR AIR GUIDE RH	Mi	0.00	*30.00 F
44	1		*RADIATOR AIR GUIDE LH	Mi	0.00	*30.00 F
45	1		*CONDENSOR ASSY	Bj	0.00	*540.00 F
46	1		*FAN SHOURD	Bj	0.00	*120.00 F
47	1		*FAN BLADE	CM	0.00	*60.00 F

48	1	*FAN MOTOR	Tm	0.00	0.00	*230.00 F	1
49	1	*A/C SUCTION HOSE	Ry	0.00	0.00	*130.00 F	1
50	1	*A/C DISCHARGE HOSE	Ry	0.00	0.00	*155.00 F	1
51	1	*WASHER TANK	nd	0.00	0.00	*75.00 F	1
52	1	*WASHER TANK PUMP	ni	0.00	0.00	*120.00 F	1
53	1	*AIR FILTER HOUSING CPL	CM	0.00	0.00	*285.00 F	1
54	1	*AIR FILTER HOSE	CM	0.00	0.00	*45.00 F	1
55	1	*AIR FILTER DUCT	CM	0.00	0.00	*40.00 F	1
56	1	*HORN - LOW PITCH	ni	0.00	0.00	*45.00 F	1
57	1	*WIPER MOTOR		0.00	0.00	*240.00 F	7
58	1	*WIPER LINKAGE		0.00	0.00	*180.00 F	7
59	1	*FUSE BOX CPL	CM	0.00	0.00	*100.00 F	1
60	1	*FRONT WINDSCREEN - GLASS	CM	0.00	0.00	*1,100.00 F	1
61	1	*FRONT WINDSCREEN - MLDG	Ncc	0.00	0.00	*80.00 F	1
62	1	*REAR BUMPER	Ry	0.00	0.00	*250.00 F	1
63	1	*REAR BUMPER RETAINER RH	Sn	0.00	0.00	*15.00 F	X
64	1	*REAR BUMPER RETAINER LH	CM	0.00	0.00	*15.00 F	1
65	1	*REAR BUMPER TOW CAP	Sn	0.00	0.00	*20.00 F	X
66	1	*REAR BUMPER SIDE GARNISH LH		0.00	0.00	*30.00 F	7
67	1	*REAR BUMPER SIDE REFLECTOR LH		0.00	0.00	*50.00 F	7
68	1	*REAR BUMPER REVERSE PARKING LH		0.00	0.00	*95.00 F	7
69	1	*BOOTLID	Ry	0.00	0.00	*580.00 F	1
70	1	*BOOTLID HINGE RH	R	0.00	0.00	*35.00 F	X
71	1	*BOOTLID HINGE LH	R	0.00	0.00	*35.00 F	X
72	1	*BOOTLID LOCK		0.00	0.00	*105.00 F	7
73	1	*BOOTLID DAMPER RH	Sn	0.00	0.00	*100.00 F	X
74	1	*BOOTLID DAMPER LH	Sn	0.00	0.00	*100.00 F	X
75	1	*BOOTLID LOCK HANDLE		0.00	0.00	*115.00 F	7
76	1	*BOOTLID TAIL LAMP ASSY LH	CM	0.00	0.00	*110.00 F	1
77	1	*BOOTLID CTR GARNISH	CM	0.00	0.00	*140.00 F	1
78	1	*BOOTLID INNER TRIM		0.00	0.00	*90.00 F	7
79	1	*BOOTLID BADGE	Nc	0.00	0.00	*20.00 F	1
80	1	*REAR FENDER LH	Ry	0.00	0.00	*620.00 F	1
81	1	*FENDER TAIL LAMP ASSY LH	Rv	0.00	0.00	*245.00 F	1
82	1	*FENDER SIDE INNER TRIM LH		0.00	0.00	*160.00 F	7
83	1	*FENDER AIR VENT LH		0.00	0.00	*30.00 F	7
84	1	*FENDER SIDE BRACKET LH		0.00	0.00	*75.00 F	7
85	1	*REAR WINDSCREEN GLASS - MLDG	Nc	0.00	0.00	*120.00 F	1
86	1	*REAR TRUNK COMPARTMENT BOARD	Sn	0.00	0.00	*190.00 F	X
87	1	*REAR TRUNK RUBBER MLDG		0.00	0.00	*70.00 F	7
88	1	*REAR END PANEL		0.00	0.00	*290.00 F	7
89	1	*REAR END PANEL UPPER GARNISH	Sn	0.00	0.00	*50.00 F	X
90	1	*LOWER SIDE SILL PANEL LH		0.00	0.00	*280.00 F	7
91	1	*FRONT DOOR LH	Ry	0.00	0.00	*570.00 F	1
92	1	*DOOR GLASS	Rv	0.00	0.00	*290.00 F	43
93	1	*DOOR UPPER HINGE LH		0.00	0.00	*45.00 F	7
94	1	*DOOR LOWER HINGE LH		0.00	0.00	*45.00 F	7
95	1	*DOOR CATCH LH		0.00	0.00	*50.00 F	7
96	1	*DOOR HANDLE LH	Sn	0.00	0.00	*205.00 F	X
97	1	*DOOR REGULATOR LH		0.00	0.00	*275.00 F	7
98	1	*DOOR INNER TRIM LH		0.00	0.00	*390.00 F	7
99	1	*REAR DOOR LH	Ry	0.00	0.00	*570.00 F	1
100	1	*REAR DOOR GLASS LH	Rv	0.00	0.00	*290.00 F	1
101	1	*REAR DOOR UPPER HINGE LH		0.00	0.00	*45.00 F	7
102	1	*REAR DOOR LOWER HINGE LH		0.00	0.00	*45.00 F	7
103	1	*REAR DOOR CATCH LH	R	0.00	0.00	*50.00 F	X
104	1	*REAR DOOR HANDLE LH	Sn	0.00	0.00	*205.00 F	X
105	1	*REAR DOOR REGULATOR LH		0.00	0.00	*275.00 F	7
106	1	*REAR DOOR INNER TRIM LH	CM	0.00	0.00	*390.00 F	1
107	1	*REAR FENDER SIDE GLASS LH	CM	0.00	0.00	*350.00 F	1
108	1	*REAR FENDER SIDE GLASS - MLDG LH	Nc	0.00	0.00	*40.00 F	1

109	1	*FRONT FENDER SIDE GLASS RH	CM	0.00	0.00	*350.00 F	—
110	1	*FRONT FENDER SIDE GLASS LH	CM	0.00	0.00	*350.00 F	—
111	1	*FRONT FENDER SIDE GLASS - MLDG RH	CM	0.00	0.00	*40.00 F	—
112	1	*FRONT FENDER SIDE GLASS - MLDG LH	CM	0.00	0.00	*40.00 F	—
113	1	*DASHBOARD CPL	TH	0.00	0.00	*680.00 F	—
114	1	*AIRBAG - DRIVER	Burn	0.00	0.00	*1,250.00 F	—
115	1	*AIRBAG - PASSENGER	Y	0.00	0.00	*1,300.00 F	—
116	1	*AIRBAG - ECU	CM	0.00	0.00	*720.00 F	—
117	1	*SEAT BELT ASSY RH	TH	0.00	0.00	*485.00 F	—
118	1	*SEAT BELT ASSY LH	TH	0.00	0.00	*485.00 F	—
119	1	*SEAT BELT PILLAR CTR GARNISH RH	DY	0.00	0.00	*90.00 F	—
120	1	*SEAT BELT PILLAR CTR GARNISH LH	DY	0.00	0.00	*90.00 F	—
121	1	*FRONT SIDE PILLAR UPPER GARNISH RH	DY	0.00	0.00	*110.00 F	—
122	1	*FRONT SIDE PILLAR UPPER GARNISH LH		0.00	0.00	*110.00 F	7
123	1	*FRONT SHOCK ABSORBER RH		0.00	0.00	*260.00 F	7
124	1	*FRONT SHOCK ABSORBER LH	B	0.00	0.00	*260.00 F	—
125	1	*FRONT ABSORBER MTG RH		0.00	0.00	*30.00 F	7
126	1	*FRONT ABSORBER MTG LH		0.00	0.00	*30.00 F	7
127	1	*FRONT LOWER ARM RH		0.00	0.00	*140.00 F	7
128	1	*FRONT LOWER ARM LH	DY	0.00	0.00	*140.00 F	—
129	1	*FRONT WHEEL HUB RH		0.00	0.00	*105.00 F	7
130	1	*FRONT WHEEL HUB LH	B	0.00	0.00	*105.00 F	—
131	1	*FRONT KNUCKLE RH		0.00	0.00	*295.00 F	7
132	1	*FRONT KNUCKLE LH	B	0.00	0.00	*295.00 F	—
133	1	*FRONT DRIVE SHAFT CPL RH		0.00	0.00	*950.00 F	7
134	1	*FRONT DRIVE SHAFT CPL LH		0.00	0.00	*950.00 F	7
135	1	*STEERING RACK CPL	TH	0.00	0.00	*1,200.00 F	—
136	1	*FRONT CROSSMEMBER - SUBFRAME		0.00	0.00	*700.00 F	7
137	1	*FRONT TIE ROD RH		0.00	0.00	*85.00 F	7
138	1	*FRONT TIE ROD LH		0.00	0.00	*85.00 F	7
139	1	*FRONT TIE ROD JOINT RH		0.00	0.00	*55.00 F	7
140	1	*FRONT TIE ROD JOINT LH		0.00	0.00	*55.00 F	7
141	1	*FRONT STABILIZER	DY	0.00	0.00	*180.00 F	—
142	1	*FRONT ENGINE LOWER COVER	mi	0.00	0.00	*120.00 F	—
143	1	*FRONT ENGINE LOWER SIDE COVER RH	mi	0.00	0.00	*90.00 F	—
144	1	*FRONT ENGINE LOWER SIDE COVER LH	mi	0.00	0.00	*90.00 F	—
145	1	*ENGINE MOUNTING RH	CM	0.00	0.00	*155.00 F	—
146	1	*ENGINE MOUNTING LH	CM	0.00	0.00	*175.00 F	—
147	1	*ENGINE MOUNTING BRACKET RH	CPL	0.00	0.00	*100.00 F	—
148	1	*ENGINE MOUNTING BRACKET LH		0.00	0.00	*150.00 F	7
149	1	*REAR AXLE - SUBFRAME		0.00	0.00	*880.00 F	7
150	1	*REAR SHOCK ABSORBER LH		0.00	0.00	*220.00 F	7
151	1	*REAR ABSORBER MTG LH		0.00	0.00	*40.00 F	7
152	1	*FRONT WHEEL LH	LP	0.00	0.00	*250.00 F	50in
153	1	*FRONT WHEEL CAP LH		0.00	0.00	*100.00 F	—
154	1	*FRONT TYRE LH		0.00	0.00	*250.00 F	30in
155	1	*FRONT ROTOR DISC LH		0.00	0.00	*220.00 F	7
156	1	*FRONT BRAKE CALIPER ASSY LH		0.00	0.00	*350.00 F	X
157	1	*FRONT BRAKE PAD LH		0.00	0.00	*80.00 F	X
158	1	*FRONT BRAKE HOSE LH		0.00	0.00	*90.00 F	7
159	1	*FRONT ABS SENSOR LH		0.00	0.00	*180.00 F	7
160	1	*ENGINE ECU ASSY CPL	CM	0.00	0.00	*1,450.00 F	—
161	1	*ENGINE HARNESS WIRE CPL		0.00	0.00	*1,250.00 F	7
162	1	*ENGINE - GEARBOX ASSY CPL	CM	0.00	0.00	*18,500.00 F	—

F=Franchise part.

Sub Total (\$\$)	56,310.00
+ Margin on L,N Items 10.00% (\$\$)	5,631.00
Total Parts (\$\$)	61,941.00

Estimates on Miscellaneous Items

No Qty Particulars

Miscellaneous Items

No	Qty	Particulars	Amount
1	1	ENGINE - FITTING & ACCESSORIES	
2	1	ENGINE ECU - DIAGNOSIS & RE-SETTING	250.00
3	1	FRONT GRILLE, BUMPER, INNER COVER, SIDE PANEL & INNER GARNISH - CLIPS	550.00
4	1	FRONT NUMBER PLATE & FRAME	250.00
			35.00
Sub Total (\$\$)			1,085.00

Estimates on Labour

No Particulars

Labour Items

No	Particulars	Lab.Type	Amount
1	BODY REPAIR, PANEL BEAT & STRAIGHTEN/ALIGN - ACCIDENT AREA	New	2,500.00
2	SPRAY PAINT - FRT BUMPER, BONNET, FRT FENDER X2, FRT DOOR X2, REAR BUMPER, BOOTLID, REAR DOOR LH, REAR FENDER LH, SIDE PILLAR, CTR PILLAR & SUPPORT PANEL	New	2,500.00
3	REMOVE & REFIT - FRT WINDSCREEN GLASS	New	150.00
4	REMOVE & REFIT - REAR WINDSCREEN GLASS	New	120.00
5	REMOVE & REFIT - REAR FENDER SIDE GLASS LH	New	120.00
6	REMOVE & REFIT - FRT PILLAR SIDE GLASS RH & LH (2 SIDES)	New	120.00
7	REMOVE & REFIT - FRT DOOR COMPONENTS	New	120.00
8	REMOVE & REFIT - REAR DOOR COMPONENTS	New	120.00
9	REMOVE & REFIT - FRONT UNDERCARRIAGE COMPONENTS	New	350.00
10	REMOVE & REFIT - REAR UNDERCARRIAGE COMPONENTS	New	350.00
11	REMOVE & REFIT - DASHBOARD COMPONENTS	New	250.00
12	REFILL - ENGINE OIL, BRAKE OIL, STEERING OIL & AUTO TRANSMISSION OIL	New	350.00
13	REFILL - RADIATOR COOLANT	New	80.00
14	REFILL - AIR COND GAS	New	80.00
Gross Labour Cost (\$\$)			7,210.00

Ding Auto Pte Ltd/SMS3706Z/09/03/2023 15:01. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:


Date:

Ding Auto Pte Ltd

PARTS SUPPLEMENTARY & QUOTATION FORM

ATTENTION: Kenneth @ UKK	
VEHICLE NUMBER: SNM 37062	WORK ORDER NUMBER:
MAKE & MODEL: Honda Fit.	OUR REFERENCE NUMBER:

S/NO	PART NUMBER	PART DESCRIPTION	QTY	UNIT PRICE	SURVEYOR REMARK	W/S REMARK
1		brake master pump Assy	1		BT ✓	
2		Door side mirror LH	1		BT ✓	
3		A/C suction Hose	1		Puc ✓	
4		A/C Discharge Hose	1		Puc ✓	
5		Brake Booster	1		BT ✓	
6						
7						
8						
9						
10						
11						
12						
13						
14						
15						
16						
17						
18						

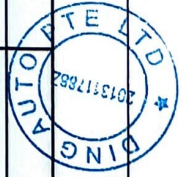

ESTIMATOR: Henry

SURVEYOR: Kenneth

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	286N
Vehicle Details	
Vehicle No.:	SMS3706Z
Vehicle to be Exported:	Yes
Intended Deregistration Date:	16 Mar 2023
Vehicle Make:	HONDA
Vehicle Model:	FIT 1.3 GF CVT
Primary Colour:	Blue
Manufacturing Year:	2019
Engine No.:	L13B1461641
Chassis No.:	GK31351532
Maximum Power Output:	73.0 kW (97 bhp)
Open Market Value:	\$16,472.00
Original Registration Date:	24 Feb 2020
First Registration Date:	24 Feb 2020
Transfer Count:	0
Actual ARF Paid:	\$6,472.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	23 Feb 2030
PARF Rebate Amount:	\$4,854.00
Intended COE Rebate Details	
COE Expiry Date:	23 Feb 2030
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$30,010.00
COE Rebate Amount:	\$20,819.00
Total Rebate Amount:	\$25,673.00

The information contained herein is correct as at 10 Mar 2023

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	06/03/2023 15:38 (SGT)
Reported by	Driver
Date of Accident	25/02/2023 16:00 (SGT)
Exact Location of Accident	Malaysia
Additional Location Information	HIGHWAY OF PEDAS LINGGI (MALAYSIA)
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SMS3706Z
INSURED/POLICYHOLDER	
Is company?	Yes
Name Of Registered Owner	J AUTO LEASING PTE LTD
Company Reg No	2XXXXX286N
Email Address	AMBER.AUTOLEASING@GMAIL.COM
Mobile Phone No	(Phone) +65-81448822
Alternative Phone No	-

VEHICLE PARTICULARS

Manufacturer	Honda
Model	Fit
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Private hire
Transmission	Auto
CC	1317

INSURANCE COMPANY

Name of Insurance Company	Allianz Insurance Singapore Pte. Ltd.
Policy Number / Cover Note Number	SP2003972742

DRIVER

Name of Driver	ASHMADOU AL SYAMMARY BIN HAJI SARIF
NRIC No	SXXXX907F
Date Of Birth	01/10/1999
Occupation	Outdoor



SINGAPORE POLICE FORCE



F/20230306/2045

1 of 2

POLICE REPORT (NP299)

Report No. F/20230306/2045

Police Station Of Origin
Kebun Baru NPP
111 Ang Mo Kio Avenue 4 SINGAPORE
560111
Tel No: 1800-4589999

Date/Time Report Made 06/03/2023 15:05	Vide Report No.	Station Diary No. 18
Name Of Informant ASHMADOU AL SYAMMARY BIN HAJI SARIF	Address APT BLK 5 TANJONG PAGAR PLAZA #14-03 SINGAPORE 081005	
ID Type / ID No. NRIC NO / S9932907F	Contact No. Home/Office Mobile 91116305	
Nationality SINGAPORE CITIZEN	Email Address	
Occupation TECHNICIAN	Sex Male	Age 23
Institution/School Name	Date of Birth 01/10/1999	Race Malay
	Language	
Date/Time Of Incident 25/02/2023 16:00	Location Of Incident Pedas Linggi Highway MALAYSIA	

Brief details.

On 25/02/2023 at around 1600hrs, I was driving vehicle bearing carplate SMS3706Z along Pedas Linggi Highway in Malaysia. I was driving on the third lane when one Malaysia vehicle of unknown carplate number filtered into the lane I was on and collided onto the front left portion of my vehicle. Due to the collision, my vehicle lost control and spun 360 degrees and finally hit onto the metal dividers. There were 4 persons in the vehicle including myself and all of us were injured. The ambulance came and sent all 4 of us to the hospital. My vehicle suffered major damages all over the vehicle.

Signature Of Officer Recording The Report:
F / SGT 3 KOH JIA JUN

Signature Of Informant:

Signature Of Interpreter:
Not applicable

Date/Time:
06/03/2023 15:05

Officer In-Charge Of Case:
F / Ang Mo Kio North N.P.C /
SR STAFF SGT SHAHRIL RASHIDI BIN SADLI
Contact No.: 64849999

Classification Of Case: