


ASS. RE: UBI, Tuffin

REF:

ALG

# ASSIGNMENT

From: \_\_\_\_\_ Date: \_\_\_\_\_  
 Estimate Cost: \_\_\_\_\_  
 OD / TP / WS / TP RES / OD RES / EVA / INV / MV  
 To Insp. Ed Vehicle No: \_\_\_\_\_  
 at Workshop m/s \_\_\_\_\_  
 of \_\_\_\_\_  
 Insured: \_\_\_\_\_  
 Policy No. \_\_\_\_\_  
 Claims No. \_\_\_\_\_  
 Sum Insured: \_\_\_\_\_ Excess: tb1  
 (Client's Record)  
 Make of Veh: \_\_\_\_\_

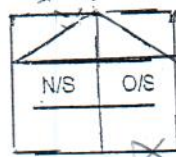

(Policy Condition)  
 Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value: £190K  
 IDAC: Accident Report \_\_\_\_\_ Consistent? : Yes or No  
 GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No  
 Est. Repairs: \_\_\_\_\_ days Res.: Yes or No  
 Lum Sum: \_\_\_\_\_ % 3 Val.: Yes or No  
 CA / REV / REP. / 24 HRS

Date: \_\_\_\_\_ Person Contacted: Tony Vehicle: IN / OUT

Veh No: SNH48717 Yr Regn: 2022, out  
 Type: M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /  
 Truck / Trailer or \_\_\_\_\_  
 Make: Hindi 174 C.C. 1784  
 Colour: black A/C: Insured / Std / NI / NA  
 Sp. Reading: 11154 T/Radio: Insured / Std / NI / NA  
 Eng/No: \_\_\_\_\_  
 C/No: WA4777F45N4015772  
 Gen. Cond: Good / Fair / Poor / Burnt  
 Steering: In order / Jammed / Leaked / Burnt or \_\_\_\_\_  
 Brake: In order / Jammed / Leaked / Burnt or \_\_\_\_\_  
 Modi: NI / S/Rim / STD A/Rim or \_\_\_\_\_  
 Tyre Size: F: 225/50R17  
 R: \_\_\_\_\_  
 BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /  
 TOYO / YOKO or Markham  
 Front \_\_\_\_\_ Rear \_\_\_\_\_  
 R/Bal. 6 mm R/Bal. 6 mm  
 L/Bal. 6 mm L/Bal. 6 mm  
 D.O.A. \_\_\_\_\_ D.O.I. 14/3/23  
 Survey held at Premium 46  
 Des. of Damages Fr / Rear / O/S / N/S / U/C / Rooftop or  
Rear O/S  
 The U/C / Chassis frame / Body Structure affected due to collision.

| Date/Time | Action / Instruction |
|-----------|----------------------|
|           |                      |
|           |                      |
|           |                      |
|           |                      |
|           |                      |
|           |                      |
|           |                      |
|           |                      |
|           |                      |
|           |                      |

Date/Time, File Pass to? ☐ : Preli. Report  
☐ : Final Report

1) \_\_\_\_\_  
 Date/Time, File Return to?  
 2) \_\_\_\_\_

Rep. Format: \_\_\_\_\_  
 Lump Sum / L.B. / F: \_\_\_\_\_

Days Of Repair: \_\_\_\_\_  
 Resurvey No. of Trip: \_\_\_\_\_

Add Fee: ☐ : Site Insp (\$ \_\_\_\_\_)  
☐ : Interview (\$ \_\_\_\_\_)  
☐ : Tech. Invs (\$ \_\_\_\_\_)  
☐ : Weekend (\$ \_\_\_\_\_)

|                 |       |
|-----------------|-------|
| Survey Fee:     | _____ |
| Transportation: | _____ |
| S + RS. \$:     | _____ |
| Photos          | _____ |
| Others          | _____ |
| TOTAL           | _____ |

55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

**ESTIMATE** : ACCIDENT REPAIRS  
**WORKSHOP** : UBI ROAD 1  
**CONTACT NO** : 6366 2323  
**FAX NO** : 6841 1183  
**REFERENCE** : PA/OD/0245/2023/EQ  
**DATE** : 6-Mar-23  
**WIP** : 10184

**VEHICLE NOT IN WORKSHOP. KINDLY ARRANGE FOR SURVEY ON 7/3/2023**

**AIG Asia Pacific Insurance Pte Ltd**

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Motor Claims Dept

**Tel: 6880 4602 - Fax: 6880 4838**

**OWNER'S NAME** : MR MUHAMMAD HAZWAN SYAKIR BIN SULAIMAN  
**ADDRESS** : BLK 875B TAMPINES STREET 86  
#14-113  
SINGAPORE 522875  
**TELEPHONE** : HP +65 84682344  
**TYPE OF CLAIM** : OWN DAMAGE CLAIM  
**POLICY NO** : 7220123179  
**VEHICLE NO** : **SNH 4871 T**  
**MODEL CODE** : AUDI A4 2.0 TFSI S-TRONIC  
**MODEL YEAR** : 31/10/2022  
**ENGINE NO** : DEM 036425  
**CHASSIS NO** : WAUZZZF43NA013772  
**MILEAGE** : -  
**DATE IN** : -  
**ESTIMATED BY** : JOHNNY BOO / ALLAN WU  
**ACCIDENT DATE** : 28-Feb-23  
**PLACE OF ACCIDENT** : PARKING LOT BLK 875B TAMPINES ST 86

55 UBI ROAD 1, SINGAPORE 408699  
 TEL : 6366 2323 FAX : 6841 1183  
 EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

**ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SNH 4871 T**

| S/N                         | NATURE OF JOBS                                                                                                                                                                                      |          | ESTIMATED<br>CHARGES | SURVEYOR'S<br>RECOMMENDATIONS |
|-----------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------|----------------------|-------------------------------|
| 1                           | TO REMOVE AND TRANSFER REAR PARKING AID AND REAR LID KICK SENSOR. CHECK FUNCTION.                                                                                                                   | S/N \$   | 360.00 ✓             |                               |
| 2                           | TO DISLodge AND REINSTALL REAR WIRE HARNESS FOR LIGHTS, BATTERY MANAGER, FUSE AND RELAY TRAYS, ELECTRICAL AND AUDIO EQUIPMENT. INSPECT FOR DAMAGE AND RENEW WHERE NECESSARY.                        | S/N \$   | 1,400.00 X           |                               |
| 3                           | TO DISMANTLE AND RENEW REAR BUMPER. TO CUT OUT AND WELD REAR END PANELLING. TO REPAIR SPARE WHEEL HOUSING AND RHS REAR FENDER. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL AL PARTS REMOVED. | \$       | 4,200.00 500         |                               |
| 4                           | TO RESPRAY REAR BUMPER, REAR END PANELLING, RHS REAR FENDER AND SPARE WHEEL HOUSING.                                                                                                                | \$       | 3,500.00 550         |                               |
| 5                           | TO RENEW RHS EXHAUST SILENCER AND ALIGN TO POSITION.                                                                                                                                                | S/N \$   | 480.00 X             |                               |
| 6                           | TO CARRY OUT DIAGNOSTIC CHECK.                                                                                                                                                                      | S/N \$   | 192.00 ✓             |                               |
| <b>TOTAL LABOUR CHARGES</b> |                                                                                                                                                                                                     | <b>:</b> | <b>\$ 10,132.00</b>  |                               |



55 UBI ROAD 1, SINGAPORE 408699  
 TEL : 6366 2323 FAX : 6841 1183  
 EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

**MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SNH 4871 T**

|                              |                                           |     | DAMAGED PARTS & PRICES |         |
|------------------------------|-------------------------------------------|-----|------------------------|---------|
| S/N                          | PARTS DESCRIPTION                         | QTY | S/NETT                 | REMARKS |
| 1                            | REAR BUMPER                               | 1   | \$ 2,642.00            | del ✓   |
| 2                            | REAR BUMPER FIXING PARTS                  | 1   | \$ 184.00              | X       |
| 3                            | REAR BUMPER SECURING STRIP                | 1   | \$ 133.00              | del ✓   |
| 4                            | REAR BUMPER SECURING STRIP                | 1   | \$ 264.00              | ?       |
| 5                            | REAR BUMPER SPOILER                       | 1   | \$ 292.00              | del ✓   |
| 6                            | REAR BUMPER BRACKET - RH                  | 1   | \$ 241.00              | ?       |
| 7                            | REAR BUMPER REFLECTOR - LH / RH           | 2   | \$ LH X 102.00         | RH ✓    |
| 8                            | REAR OUTER TAIL LIGHT - RH                | 1   | \$ 1,200.00            | cut ✓   |
| 9                            | REAR OUTER TAIL LIGHT TRIM - RH           | 1   | \$ 36.00               | ?       |
| 10                           | REAR INNER TAIL LIGHT - RH                | 1   | \$ 1,200.00            | X       |
| 11                           | REAR INNER TAIL LIGHT TRIM - RH           | 1   | \$ 36.00               | X       |
| 12                           | REAR BUMPER REINFORCEMENT BEAM            | 1   | \$ 1,197.00            | ?       |
| 13                           | REAR BUMPER IMPACT BAR GASKET - LH / RH   | 2   | \$ 34.00               | ?       |
| 14                           | REAR BUMPER GUIDE SECTION - RH UPPER      | 1   | \$ 54.00               | ?       |
| 15                           | REAR BUMPER GUIDE SECTION - LH / RH LOWER | 2   | \$ 54.00               | ?       |
| 16                           | REAR BUMPER HOLDING STRAP - LH / RH       | 2   | \$ 200.00              | ?       |
| 17                           | REAR PARKING AID SENSOR - INNER / OUTER   | 2   | \$ 543.00              | X       |
| 18                           | REAR PARKING AID SEAL RING                | 4   | \$ 11.00               | ?       |
| 19                           | REAR BUMPER WIRING SET                    | 1   | \$ 452.00              | X       |
| 20                           | REAR BOOT LID OPENING CONTROL UNIT        | 1   | \$ 491.00              | X       |
| <b>SUB TOTAL SPARE PARTS</b> |                                           | :   | <b>\$ 9,366.00</b>     |         |

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED  
 SPARE PARTS ARE SPECIAL NETT.

55 UBI ROAD 1, SINGAPORE 408699  
 TEL : 6366 2323 FAX : 6841 1183  
 EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

**MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SNH 4871 T**

|                             |                                   |     | DAMAGED PARTS & PRICES |         |
|-----------------------------|-----------------------------------|-----|------------------------|---------|
| S/N                         | PARTS DESCRIPTION                 | QTY | S/NETT                 | REMARKS |
| 21                          | REAR TAILGATE OPENING SENSOR LINE | 1   | \$ 230.00              | X       |
| 22                          | REAR AERIAL KEY ACCESS            | 1   | \$ 123.00              | X       |
| 23                          | REAR SILENCER - RH                | 1   | \$ 1,700.00            | X       |
| 24                          | REAR SILENCER DUAL CLIP           | 1   | \$ 61.00               | X       |
| 25                          | EXHAUST SILENCER BRACKET          | 1   | \$ 48.00               | X       |
| 26                          | EXHAUST TAIL PIPE TRIM - RH       | 1   | \$ 406.00              | dd ✓    |
| 27                          | REAR CROSS PANEL                  | 1   | \$ 290.00              | X       |
| 28                          | REAR CROSS PANEL REINFORCEMENT    | 1   | \$ 565.00              | X       |
| 29                          | ACRYLIC SEALANT                   | S/N | \$ 180.00              | X       |
| 30                          | CAVITY WAX                        | S/N | \$ 140.00              | X       |
| 31                          | STONE CHIP                        | S/N | \$ 180.00              | X       |
| 32                          | METAL FILLER POWDER               | S/N | \$ 280.00              | X       |
| 33                          | SUNDRIES                          |     | \$ 500.00              | 7       |
| <b>TOTAL SPARE PARTS</b>    |                                   | :   | <b>\$ 14,069.00</b>    |         |
| <b>TOTAL LABOUR CHARGES</b> |                                   | :   | <b>\$ 10,132.00</b>    |         |
| <b>GRAND TOTAL</b>          |                                   | :   | <b>\$ 24,201.00</b>    |         |

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APROVED  
 SPARE PARTS ARE SPECIAL NETT.

55 UBI ROAD 1, SINGAPORE 408699  
TEL : 6366 2323 FAX : 6841 1183  
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

NAME :  
SURVEYED DATE :  
AUTHORISED DATE :  
EXCESS COST :  
LIABILITY :  
REMARKS :

Tanjin 97495749  
Not Authorise  
Ex: Hkn  
14/3/23 C1010  
p/p Resurvey before paint 3 days  
3 days tanjin C1010

PLEASE NOTE :

THIS ESTIMATE IS BASED ON VISUAL INSPECTION OF THE AFFECTED VEHICLE. SHOULD WE REQUIRE FURTHER LABOUR CHARGES AND SPARE PARTS IN THE PROGRESS OF REPAIR, WE SHALL INFORM YOU ACCORDINGLY. FOR INSPECTION OF VEHICLE, PLEASE REFER TO MS. NORAH KHAI AT TEL: 6768 9828 / 6768 9911 FOR APPOINTMENT.

YOURS FAITHFULLY,  
PREMIUM AUTOMOBILES PTE LTD

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer  
Signature:  
Date:

JOHNNY BOO  
BODY REPAIR MANAGER

ALLAN WU  
CLAIMS CONSULTANT