

(08/11/13) Wef

ASS. REC. BY: John

REF:

CC4/GRB 2300 2663/Rpa3

8394

ASSIGNMENT

2026/04

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SHB 4891Mat Workshop m/s DINH ANUOof 31 CORPORATION COInsured: GRB

Policy No. _____

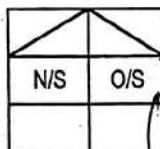
Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.Bal. or Market Value: 35K

IDAC Accident Rpt: Consistent?: Yes or No

GIA / PR Seen: Consistent?: Yes or No

Est. Repairs: days Res.: Yes or No

Lum Sum: % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: SHB 4891M Yr Regn: 2018 / OCTType: M.Car / M.Cycle / Bus / Van / Lorry / (Taxi) / Prime Mover /

Truck / Trailer or

Make: HYUNDAI IONIQ HEV 1.6 DCT c.c. 1580Colour: YELLOW A/C: Insured / Std / NI / NASp. Reading: 535995 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: KMHCR51CVK115008

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orModi: NI / S/Rim / STD A/Rim orTyre Size: F: 195/65R15
R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or WESTLAK

Front

Rear

R/Bal. 6 mmR/Bal. 6 mmL/Bal. 6 mmL/Bal. 6 mmD.O.A. 12/03/23D.O.I. 15/03/23Survey held at DINH ANUO

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

O/S REAR

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

REPAIR LIMIT - 15K

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee:

Transportation:

S + RS \$

Photos

Others

Add Fee: ☐ : Site Insp (\$☐ : Interview (\$☐ : Tech. Invs (\$☐ : Weekend (\$

Report Format : _____

Lum Sum / L.R. / \$

TO :

ESTIMATE REPORT 1ST Quotation

FAX NO:

13/03/2023 15:52

JOB-NO: 50114927

OWNER'S PARTICULARS

NAME: CityCab PTE LTD (Fleet)

CONTACT: 65533880

Page 1 of 2

ADDRESS: 383 SIN MING DRIVE
SINGAPORE 575717 0

64739522

VEHICLE DETAILS

LICENSE NO: SHB4891M

TRANS: AUTO

CHASSIS: KMHC851CVKU115008

MAKE / MODEL: HYUNDAI / AE IONIQ HEV 1.6 DI

ENGINE: G4LEJU111714

OWNER'S INSURER: AXA INSURANCE SINGAPORE PTE LTD

JOB-CODE: TP

SA: Ding Auto User 2

CLAIM DETAILS

DESCRIPTION	QTY	QUOTED COSTS	DISCOUNT	DISC PRICE	IND	SUR.DISP	REV PRICE
LABOUR							
1 TO STRAIGHTEN AND PANEL BEAT OF ACCIDENT AFFECTED AREA	1.00	1,600.00	0.00	1,600.00		Y	800
2 TO RUST PROOFING OF THE AFFECTED AREA	1.00	170.00	0.00	170.00		Y	80
3 TO REMOVE AND REFIT OF NECESSARY ITEMS TO FACILITATE BODYWORK REPAIR	1.00	300.00	0.00	300.00		Y	X
4 TO DIAGNOSTIC, CHECK WIRING AND LIGHTING SYSTEM AND CLEAR FAULT CODE	1.00	250.00	0.00	250.00		Y	100
5 TO CONDUCT TYRE BALANCING AND WHEEL ALIGNMENT	1.00	120.00	0.00	120.00		Y	60
6 TO REFIT REAR REVERSE SENSOR	1.00	100.00	0.00	100.00		Y	X
7 TO TRANSFER OF REAR DOOR MECHANISM TO NEW DOOR AND PERFORM WATER SEEPAGE TEST	1.00	200.00	0.00	200.00		Y	60
8 TO REMOVE AND REFIT REAR TAILGATE UPPER AND LOWER WINDSCREEN TO ENABLE BODYWORK REPAIR	1.00	260.00	0.00	260.00		Y	120
9 TO RESPRAY REAR BUMPER	1.00	250.00	0.00	250.00		Y	200
10 TO RESPRAY REAR END PANEL	1.00	250.00	0.00	250.00		Y	X
11 TO RESPRAY REAR QUARTER PANEL	1.00	250.00	0.00	250.00		Y	200
12 TO RESPRAY REAR DOOR PANEL	1.00	250.00	0.00	250.00		Y	200
13 TO RESPRAY REAR DOOR PANEL OUTER HANDLE AND COVER	1.00	250.00	0.00	250.00		Y	50
14 TO RESPRAY REAR DOOR OUTER WAIST LINE MOULDING	1.00	250.00	0.00	250.00		Y	50
15 TO RESPRAY SIDE SKIRT RH	1.00	250.00	0.00	250.00		Y	100
TOTAL:		4,750.00	0.00	4,750.00			
MATERIALS							
1 REAR BUMPER COVER <i>repair</i>	1.00	459.40	91.88	367.52	L	Y	
2 REAR RH BUMPER RETAINER <i>X</i>	1.00	33.10	6.62	26.48	L	Y	
3 REAR RH QUARTER PANEL <i>H</i>	1.00	1,768.30	353.66	1,414.64	L	Y	
4 REAR RH QUARTER PANEL AIR VENT <i>X</i>	1.00	57.60	11.52	46.08	L	Y	
5 SIDE SKIRT RH <i>repair</i>	1.00	290.00	58.00	232.00	L	Y	
6 REAR RH DOOR PANEL <i>H</i>	1.00	2,147.90	429.58	1,718.32	L	Y	
7 REAR RH OUTER DOOR HANDLE <i>repair</i>	1.00	78.00	15.60	62.40	L	Y	
8 REAR RH WHEEL RIM COVER <i>sur</i>	1.00	346.40	69.28	277.12	L	Y	
9 REAR RH OUTER DOOR WAIST LINE MOULDING <i>repair</i>	1.00	77.10	15.42	61.68	L	Y	

CLAIM DETAILS

DESCRIPTION	QTY	QUOTED COSTS	DISCOUNT	DISC PRICE	IND	SUR.DISP	REV PRICE
10 REAR RH DOOR FRAME FRONT BLACK TAPE	1.00	7.00	1.40	5.60	L	Y	
11 REAR RH DOOR FRAME REAR BLACK TAPE	1.00	7.00	1.40	5.60	L	Y	
12 REAR RH DOOR FRAME UPPER BLACK TAPE	1.00	9.70	1.94	7.76	L	Y	
13 REAR BUMPER CLIP SET	1.00	55.00	0.00	55.00	S	Y	30
14 REAR QUARTER PANEL SEALANT	2.00	120.00	0.00	120.00	S	Y	40
15 REAR TYRE 195/65/15	1.00	350.00	0.00	350.00	S	Y	X
16 SIDE SKIRT CLIP SET	1.00	50.00	0.00	50.00	S	Y	X
17 REAR DOOR "GOOGLE PLAY STORE" STICKER	1.00	100.00	0.00	100.00	S	Y	50
18 REAR DOOR "COMFORT DELUXE" STICKER	1.00	100.00	0.00	100.00	S	Y	260
19 REAR DOOR MOULDING CLIP	1.00	50.00	0.00	50.00	S	Y	30
20 REAR WINDSCREEN PRIMER	2.00	80.00	0.00	80.00	S	Y	40
21 REAR WINDSCREEN SEALANT	3.00	150.00	0.00	150.00	S	Y	40
TOTAL:		6,336.50	.056.30	5,280.20			
TOTAL PARTS & LABOUR :		11,086.50	1,056.30	10,030.20			

EXCESS/LOADING:S\$ 0.00

No. Of Day: 7 days

RE-SURVEY: BEFORE/AFTER PAINTING
PART-BY-PART OR LUMP SUM S\$

DATE OF SURVEY: 15 / 03 / 23 @ 1430

SURVEYED BY: Rasul

CONTACT NO: 96010068 FAX NO:

NOTE: LUMP SUM AMOUNT WOULD BE REVISED IF SUPPLEMENT REPAIR IS REQUIRED

DAuto002

Ding Auto User 2

ESTIMATOR

STA AUTOCENTRE

TEL:

FAX:

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Company

Owner ID:

839G

Vehicle Details

Vehicle No.:

SHB4891M

Vehicle to be Exported:

No

Intended Deregistration Date:

16 Mar 2023

Vehicle Make:

HYUNDAI

Vehicle Model:

AE IONIQ HEV 1.6 DCT

Primary Colour:

Yellow

Manufacturing Year:

2018

Engine No.:

G4LEJU111714

Chassis No.:

KMHC851CVKU115008

Maximum Power Output:

103.6 kW (138 bhp)

Open Market Value:

\$24,855.00

Original Registration Date:

24 Oct 2018

First Registration Date:

24 Oct 2018

Transfer Count:

0

Actual ARF Paid:

\$11,797.00

Intended PARF Rebate Details

PARF Eligibility:

Yes

PARF Eligibility Expiry Date:

23 Oct 2026

PARF Rebate Amount:

\$8,847.00

Intended COE Rebate Details

COE Expiry Date:

23 Oct 2026

COE Category:

A - Car up to 1600cc & 97kW (130bhp)

COE Period(Years):

8

PQP Paid:

\$24,228.00

COE Rebate Amount:

\$10,909.00

Total Rebate Amount:

\$19,756.00