

ASS. REC. BY:

REF:

TU / 230028051kp

C

Kenneth

## ASSIGNMENT

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: \_\_\_\_\_

at Workshop m/s \_\_\_\_\_

of \_\_\_\_\_

Insured: \_\_\_\_\_

Policy No. \_\_\_\_\_

Claims No. \_\_\_\_\_


Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_

(Client's Record)

Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

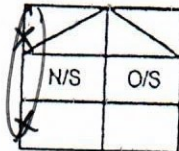Bal. or Market Value: 875k

IDAC Accident Rpt: \_\_\_\_\_ Consistent? : Yes or No

GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No

Est. Repairs: 06 days Res.: Yes or NoLum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_

Vehicle: IN / OUT

Veh No: SLV 31216 Yr Regn: 12, 17

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Toy CHR C.C. 1797Colour: M.P. white A/C: Insured / Std / NI / NASp. Reading: 133457 T/Radio: Insured / Std / NI / NA

Eng/No: \_\_\_\_\_

C/No: 84X10 2074134Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: Nil / S/Rim / STD A/Rim or

Tyre Size: F: TOYO 215/55R18Rouador

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal. 8 mmL/Bal. 8 mmD.O.A. 13/3/23

Survey held at

Rear

R/Bal. 4 mmL/Bal. 4 mmD.O.I. 17/3/2023

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

N/S body & uk

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

1/6 11:00 AM @ 8000 Cnh

Date/Time, File Pass to?

☐ : Prell. Report☐ : Final Report

1)

Date/Time, File Return to?

2)

Days Of Repair: \_\_\_\_\_

Resurvey No. of Trip: \_\_\_\_\_

Add Fee: ☐ : Site Insp (\$☐ : Interview (\$☐ : Tech Invs (\$☐ : Weekend (\$

Survey Fee:

Transportation:

S - RS. \$

Fees

Others

TOTAL

Report Format :

Lump Sum / I.B.I. (\$

# Repair Estimate

Not Withheld  
11 Bm 88800h

## Thiam Heng Huat Pte Ltd

176 Sin Ming Drive #05-14 Sin Ming Autocare Singapore 575721

Mobile: (65) 8263 6295 Email: thiamhenghuat@gmail.com

Salary

Make/Model: TOYOTA C-HR

Date: 17/03/2023


Engine/Chassis No.: ZYX102074134

Claim Type: TP

Date of accident:

VRN: SLV3121G

Damaged area: N/S

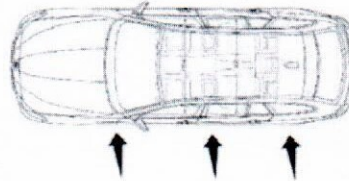

| List items |                                            |     |             |             |   |
|------------|--------------------------------------------|-----|-------------|-------------|---|
| S/N        | Parts description                          | QTY | UNIT PRICE  | AMOUNT      |   |
| 1          | Front door n/s 1426.10 Bz                  | 1   | \$ 1,987.00 | \$ 1,987.00 | ✓ |
| 2          | Front door top hinge n/s R                 | 1   | \$ 136.00   | \$ 136.00   | X |
| 3          | Front door lower hinge n/s R               | 1   | \$ 136.00   | \$ 136.00   | X |
| 4          | Front door inner trim board n/s MHC M      | 1   | \$ 683.00   | \$ 683.00   | ✓ |
| 5          | Front door outer handle n/s Sn             | 1   | \$ 296.00   | \$ 296.00   | X |
| 6          | Front door outer handle lock sensor n/s Sn | 1   | \$ 195.00   | \$ 195.00   | X |
| 7          | Front door lock n/s 325 Tm                 | 1   | \$ 385.00   | \$ 385.00   | ✓ |
| 8          | Front door lock striker n/s R              | 1   | \$ 69.00    | \$ 69.00    | X |
| 9          | Front door window regulator n/s 385 MHC M  | 1   | \$ 436.00   | \$ 436.00   | ✓ |
| 10         | Front door window motor n/s Tm             | 1   | \$ 386.00   | \$ 386.00   | ✓ |
| 11         | Front door window channel n/s Sn           | 1   | \$ 113.00   | \$ 113.00   | X |
| 12         | Front door window outer moulding n/s Sn    | 1   | \$ 265.00   | \$ 265.00   | X |
| 13         | Rear door n/s 1420 Bz                      | 1   | \$ 1,695.00 | \$ 1,695.00 | ✓ |
| 14         | Rear door top hinge n/s R                  | 1   | \$ 136.00   | \$ 136.00   | X |
| 15         | Rear door lower hinge n/s P. g             | 1   | \$ 136.00   | \$ 136.00   | ✓ |
| 16         | Rear door inner trim board n/s MHC M       | 1   | \$ 534.00   | \$ 534.00   | ✓ |
| 17         | Rear door outer handle n/s Sn              | 1   | \$ 296.00   | \$ 296.00   | X |
| 18         | Rear door lower moulding n/s Sn            | 1   | \$ 195.00   | \$ 195.00   | X |
| 19         | Rear door lock n/s Tm                      | 1   | \$ 265.00   | \$ 265.00   | ✓ |
| 20         | Rear door lock striker n/s R               | 1   | \$ 48.00    | \$ 48.00    | X |
| 21         | Rear door window regulator n/s 207 MHC M   | 1   | \$ 336.00   | \$ 336.00   | ✓ |
| 22         | Rear door window motor n/s Tm              | 1   | \$ 286.00   | \$ 286.00   | ✓ |
| 23         | Rear door window channel n/s Sn            | 1   | \$ 145.00   | \$ 145.00   | X |
| 24         | Rear door window outer moulding n/s Sn     | 1   | \$ 295.00   | \$ 295.00   | X |
| 25         | Front fender n/s 645.10 Bz                 | 1   | \$ 929.00   | \$ 929.00   | ✓ |
| 26         | Front fender cowling n/s Sn                | 1   | \$ 237.00   | \$ 237.00   | X |
| 27         | Front shock absorber n/s Bz                | 1   | \$ 467.00   | \$ 467.00   | ✓ |
| 28         | Front shock absorber mounting n/s Sn       | 1   | \$ 102.00   | \$ 102.00   | X |

# Repair Estimate

|               |                                  |        |       |             |              |   |
|---------------|----------------------------------|--------|-------|-------------|--------------|---|
| 29            | Front lower arm n/s              | Rt     | 1     | \$ 387.00   | \$ 387.00    | ✓ |
| 30            | Front wheel carrier n/s          | Rt     | 1     | \$ 469.00   | \$ 469.00    | ✓ |
| 31            | Front wheel carrier bearing n/s  | Ln     | 1     | \$ 214.00   | \$ 214.00    | ✓ |
| 32            | Front bumper                     | Ln     | 1     | \$ 893.00   | \$ 893.00    | X |
| 33            | Front bumper side retainer       | Ln     | 2     | \$ 75.00    | \$ 150.00    | X |
| 34            | Headlamp n/s                     | Ln     | 1     | \$ 2,985.00 | \$ 2,985.00  | X |
| 35            | Front fender arch garnish n/s    | 177    | nd/Lt | \$ 384.00   | \$ 384.00    | ✓ |
| 36            | Front door lower moulding n/s    | Ln     | 1     | \$ 298.00   | \$ 298.00    | X |
| 37            | Rocker panel outer moulding n/s  | Ln     | 1     | \$ 458.00   | \$ 458.00    | X |
| 38            | Rocker panel n/s                 | Rt     | 1     | \$ 837.00   | \$ 837.00    | X |
| 39            | Rocker panel side skirt n/s      | 563.80 | nd/Lt | \$ 967.00   | \$ 967.00    | ✓ |
| 40            | Rear fender n/s                  | Rt     | 1     | \$ 1,178.00 | \$ 1,178.00  | X |
| 41            | Rear fender arch garnish n/s     | 334.60 | Rt    | \$ 384.00   | \$ 384.00    | ✓ |
| 42            | Rear fender cowling n/s          | Ln     | 1     | \$ 185.00   | \$ 185.00    | X |
| 43            | Rear shock absorber n/s          | Ln     | 1     | \$ 389.00   | \$ 389.00    | X |
| 44            | Rear shock absorber mounting n/s | Ln     | 1     | \$ 67.00    | \$ 67.00     | X |
| 45            | Rear lower arm n/s               | 314    | Rt    | \$ 487.00   | \$ 487.00    | ✓ |
| 46            | Rear wheel carrier n/s           | 298    | Rt    | \$ 594.00   | \$ 594.00    | ✓ |
| 47            | Rear wheel carrier bearing n/s   | Ln     | 1     | \$ 196.00   | \$ 196.00    | ✓ |
| 48            | Rear track control arm n/s       | Ln     | 1     | \$ 439.00   | \$ 439.00    | X |
| 49            | Rear roll over strut n/s         | Ln     | 1     | \$ 375.00   | \$ 375.00    | X |
| 50            | Front door speaker n/s           | Ln     | 1     | \$ 285.00   | \$ 285.00    | X |
| Subtotal      |                                  |        |       |             | \$ 23,810.00 |   |
| List discount |                                  |        |       |             | 25.00%       |   |
| Total         |                                  |        |       |             | \$ 17,857.50 |   |

| Special nett items |                                       |    |     |            |             |
|--------------------|---------------------------------------|----|-----|------------|-------------|
| No.                | Parts description                     |    | QTY | UNIT PRICE | AMOUNT      |
| 1                  | Front door inner trim board clips n/s | Ln | 12  | \$ 5.50    | \$ 66.00    |
| 2                  | Rear door inner trim board clips n/s  | Ln | 12  | \$ 5.50    | \$ 66.00    |
| 3                  | Front fender cowling clips n/s        | Ln | 8   | \$ 5.50    | \$ 44.00    |
| 4                  | Front bumper clips                    | Ln | 12  | \$ 5.50    | \$ 66.00    |
| 5                  | Rocker panel sealant n/s              | Ln | 1   | \$ 100.00  | \$ 100.00   |
| 6                  | Rocker panel outer moulding clips n/s | Ln | 10  | \$ 5.50    | \$ 55.00    |
| 7                  | Front fender arch garnish clips n/s   | Ln | 6   | \$ 5.50    | \$ 33.00    |
| 8                  | Front alloy wheel n/s                 | nd | 1   | \$ 650.00  | \$ 650.00   |
| 9                  | Front tyre n/s                        | Ln | 1   | \$ 280.00  | \$ 280.00   |
| 10                 | Rear alloy wheel n/s                  | nd | 1   | \$ 650.00  | \$ 650.00   |
| 11                 | Rear tyre n/s                         | Ln | 1   | \$ 280.00  | \$ 280.00   |
| 12                 | Rear bumper clips                     | Ln | 12  | \$ 5.50    | \$ 66.00    |
| 13                 | Rear fender sealant n/s               | Ln | 1   | \$ 80.00   | \$ 80.00    |
| 14                 | Rear fender cowling clips n/s         | Ln | 8   | \$ 5.50    | \$ 44.00    |
| 15                 | Sundries                              | Ln | 1   | \$ 50.00   | \$ 50.00    |
| Total              |                                       |    |     |            | \$ 2,530.00 |

# Repair Estimate

| Labour               |                                                                                                                                           |           |              |
|----------------------|-------------------------------------------------------------------------------------------------------------------------------------------|-----------|--------------|
| No.                  | Description                                                                                                                               | Work unit | Amount       |
| 1                    | To dismantle / renew accident damaged portion. To panel beat, reshape, straighten, orientate and align repair / replacement parts.        | 10        | \$ 2,000.00  |
| 2                    | To disconnect both n/s doors wire harness of electrical components to facilitate repairs, reconnect and check functions of power windows. | 0.5       | \$ 100.00    |
| 3                    | To remove and refit n/s doors components to replace both n/s doors, check alignment.                                                      | 1         | \$ 200.00    |
| 4                    | To remove and refit n/s front door quarter glass to facilitate repair.                                                                    | 0.25      | \$ ~ 50.00   |
| 5                    | To remove and replace both n/s tyres & rims. To perform tyre balancing.                                                                   | 0.25      | \$ 50.00     |
| 6                    | To conduct computerized wheel alignment.                                                                                                  | 0.75      | \$ 150.00    |
| 7                    | To remove and refit n/s front & rear undercarriage for replacement of parts.                                                              | 2         | \$ 400.00    |
| 8                    | Supply spray paint material and necessary items to respray affected area / panel.                                                         | 9         | \$ 1,800.00  |
| 9                    | To rust proof all affected portions after repair.                                                                                         | 0.5       | \$ 100.00    |
| Total labour         |                                                                                                                                           |           | \$ 4,850.00  |
| Estimate Grand Total |                                                                                                                                           |           | \$ 25,237.50 |

1000

300

1200

X

300

600

3500

11000

900

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: