

(08/11/13) wef

ASS. REC. BY: Marcus


REF:

CS/PC123002860/Urly3**ASSIGNMENT**

From: _____ Date: _____
 Estimated Cost: _____
 OD / TP / WS / TP RES / OD RES / EVA / INV / MV
 To Inspect Vehicle No: SLJ3409R
 at Workshop m/s hookwoh 10an
 of _____
 Insured: XE7687C
 Policy No. _____
 Claims No. D23000948MFVS
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
 repair at the time of inspection.

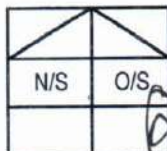

Bal. or Market Value: \$50k.
 IDAC Accident Rpt: _____ Consistent?: Yes or No
 GIA / PR Seen: _____ Consistent?: Yes or No
 Est. Repairs: 5 days Res.: Yes or No
 Lum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

747h

Vehicle: IN / OUT

Date: _____ Person Contacted: LMA 2695

Veh No: SLJ3409R Yr Regn: 06/12/16
 Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or CA
 Make: Mazda 3 SP C.C. 1496
 Colour: Silver A/C: Insured / Std / NI / NA
 Sp. Reading: 130473 T/Radio: Insured / Std / NI / NA
 Eng/No: _____
 C/No: JM6BN22A8H0120230
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: In order / Jammed / Leaked / Burnt or
 Brake: In order / Jammed / Leaked / Burnt or
 Modi: NI / S/Rim / STD A/Rim or
 Tyre Size: F: 205/60R16
 R: _____
 BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or Continental
 Front 7 mm Rear 7 mm
 R/Bal. 7 mm L/Bal. 7 mm
 D.O.A. 15/03/23 D.O.I. 10/04/23
 Survey held at _____
 Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or
O/S Body &
 The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Dep 12h

18/4/23 fender & 1262.77, door front & 1228.97 Rear 1075.41
 1/5 & 4800 informed Anyser (red 5389.28, 52%)

Date/Time, File Pass to?

☐

: Preli. Report

1)

☐

: Final Report

Date/Time, File Return to?

2) 18/4/23-typist

Days Of Repair: 5

Resurvey No. of Trip: 2

Survey Fee:

Transportation:

Photos

Others

TOTAL

Report Format: TP

Lump Sum / L.B.: (\$ 4800)

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech. Invs (\$

☐

: Weekend (\$

> **Back to OneMotoring**

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	747H
Vehicle Details	
Vehicle No.:	SLJ3409R
Vehicle to be Exported:	No
Intended Deregistration Date:	05 Apr 2023
Vehicle Make:	MAZDA
Vehicle Model:	MAZDA3 4-DOOR SEDAN 1.5L SP.6EAT
Primary Colour:	Silver
Manufacturing Year:	2016
Engine No.:	P520402263
Chassis No.:	JM6BN22A8H0120230
Maximum Power Output:	88.0 kW (118 bhp)
Open Market Value:	\$17,091.00
Original Registration Date:	06 Dec 2016
First Registration Date:	06 Dec 2016
Transfer Count:	1
Actual ARF Paid:	\$12,091.00 <i>6045</i>
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	05 Dec 2026
PARF Rebate Amount:	\$7,859.00
Intended COE Rebate Details	
COE Expiry Date:	05 Dec 2026
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$50,991.00
COE Rebate Amount:	\$18,696.00
Total Rebate Amount:	\$26,555.00

The information contained herein is correct as at 05 Apr 2023

OK

Post an Advertisement
Sell it yourself! Advertise it at just
\$68 until it's SOLD!

[Post an Ad](#) [Advertiser Login](#) [Ways of Selling](#)

Audi TT Coupe 2.0 TFSI (COE Until 07/2031).



Original, No Modifications, Low
Mileage.
Direct Owner: StarAd


HIN LUNG AUTO
 Ho Bee Group
One Stop Car Hub
 Finance, Insurance, Workshop
 New and Used Cars

30 years
 of car sale

« Back (1 2 3) Next »

Sort by 20 results/page

56 vehicles



MAZDA 3

Any Category

Advanced Search



Search

	Make	Model	Price	Depreciation	Reg Date	Eng Cap	Mileage	Veh Type	Status
Search Selection	MAZDA 3		Any	Any	2016	Any	Any	Any	Available
	Mazda 3 1.5A Sunroof		\$51,800	\$12,990 /yr	11-Oct-2016	1,496 cc	87,247 km	Sedan	Available
Flexible loan options up High/Over loan available. High trade in for your existing vehicle. Wonderfully maintained beauty of a unit that is...									
Posted: 05-Apr-2023									
	Mazda 3 1.5A Sunroof		\$49,000	\$12,380 /yr	29-Sep-2016	1,496 cc	-	Sedan	Available
Most Popular Mazda 3 Sedan, Very High Demanding In The Market! You'll Won't Regret Drop-by For A View! Superbly Taken Care, For It...									
Posted: 05-Apr-2023									
	Mazda 3 HB 2.0A Sport Sunroof		\$58,800	\$13,840 /yr	21-Sep-2016	1,998 cc	104,520 km	Hatchback	Available
Beautiful In White, Comes With Upgraded Sport Rims And Brake Kits. This Versatile 5- Doors Hatch Mazda 3 Is Powered By Skyactiv-G E...									
Imperium Car Motor Pte Ltd									
Posted: 04-Apr-2023									
	Mazda 3 1.5A Deluxe Sunroof		\$43,800	\$12,570 /yr	24-Mar-2016	1,496 cc	78,094 km	Sedan	Available
100% Loan And Balloon Scheme Available,Ex-Bankruptcy And Bad Credit Welcome,High Trade In.									
Faster Auto Trading									
Posted: 04-Apr-2023									
	Mazda MX-30 R-EV plug-in hybrid revealed								
The Mazda MX-30 R-EV plug-in hybrid will offer a total of 168bhp thanks to a 17.8kWh battery, as well as a 0.8-litre rotary generator.									
Read this article									
	Mazda 3 1.5A		\$48,000	\$12,390 /yr	29-Aug-2016	1,496 cc	160,000 km	Sedan	Available
Rocket Auto Trading. Road Tax New And Tyres New And Car Just Replaced Lower Arm And Driveshaft. Loan Avail. Trade In Welcome.ho...									
Posted: 04-Apr-2023									
	Mazda 3 1.5A Deluxe Sunroof		\$56,800	\$13,260 /yr	19-Dec-2016	1,496 cc	110,098 km	Sedan	Available
1 Owner, Immaculate Condition,No Repair Needed, High Trade In Welcome, Fast Approval For 90% Loan Available With Attractive Inter...									
Tai Huat Automobile									
Posted: 04-Apr-2023									
Compare	Mazda 3 1.5A Deluxe Sunroof		\$56,800	\$13,670 /yr	28-Nov-2016	1,496 cc	79,220 km	Sedan	Available

Hock Wah Motor Workshop PTE LTD

Blk 3011 Bedok North Ave4
#01-2008/2010/2012/2014 Singapore 489977

Phone Number: 6441 5655

Fax Number: 64415355

Customer:	Date:	4/12/2023 10:06:31 AM
Company:	VIN	
License No:	Technician:	
Odometer:	Order No.:	

VEHICLE ALIGNMENT REPORT

MAZDA, 3, 2009-2013, Alle außer L3TurboundMZR-CD 2.2

Primary Angles			Initial	Specifications		Final
				Min.	Max.	
Front	Caster	Left	6.2°	2.1°	4.1°	5.8°
		Right	6.3°	2.1°	4.1°	7.0°
	Camber	Left	-0.5°	-1.6°	0.4°	-0.5°
		Right	-0.3°	-1.6°	0.4°	-0.3°
	Toe	Left	-2.7	-0.5mm	1.7mm	-0.5
		Right	3.1	-0.5mm	1.7mm	0.8
Total		0.4	-1.1	3.3	0.3	
Rear	Camber	Left	-0.9°	-2.5°	-0.5°	-1.0°
		Right	-1.0°	-2.5°	-0.5°	-15.4°
	Toe	Left	0.9	-0.2mm	1.9mm	3.1
		Right	-1.1	-0.2mm	1.9mm	1.0
		Total	-0.2	-0.5	3.8	4.1
	Thrust Angle		-0.2°	-0.8°	0.8°	-0.2°
Secondary Angles			Initial	Specifications		Final
				Min.	Max.	
SAE	Left		15.5°	13.9°	13.9°	15.5°
	Right		14.8°	13.9°	13.9°	14.8°
Included Angle	Left		15.0°	-----	-----	15.0°
	Right		14.5°	-----	-----	14.5°
Toe Out On Turns	Left		1.7°	0.0°	0.0°	1.7°
	Right		1.8°	0.0°	0.0°	1.8°
Maximum Turns	Left		-----	38.0°	44.0°	-----
	Right		-----	38.0°	44.0°	-----
Toe Curve Change	Left		-----	-----	-----	-----
	Right		-----	-----	-----	-----
Setback	Front		-0.2"	-----	-----	0.0"
	Rear		-0.4"	-----	-----	-0.1"
Track Width Diff			0.4"			-1.1"
Wheel Base Diff			0.2"			0.1"
Front Ride Height	Left		-----	-----	-----	-----
	Right		-----	-----	-----	-----
Rear Ride Height	Left		-----	-----	-----	-----
	Right		-----	-----	-----	-----
Frame Angle						-----

Hock Wah Motor Workshop PTE LTD

Blk 3011 Bedok North Ave4
#01-2008/2010/2012/2014 Singapore 489977

Phone Number: 6441 5655

Fax Number: 64415355

Customer:	Date:
Company:	VIN
License No:	Technician:
Character:	Order No.:

VEHICLE ALIGNMENT REPORT

MAZDA, 3 1.6/2.0(Custom), 08-10,

Primary Angles			Initial	Specifications		Final
				Min.	Max.	
Front	Caster	Left	6.1°	2.1°	4.1°	6.3°
		Right	5.8°	2.1°	4.1°	6.7°
	Camber	Left	-0.3°	-1.7°	0.3°	-0.2°
		Right	-0.1°	-1.7°	0.3°	-0.1°
	Toe	Left	-2.4	-----	-----	0.2
		Right	3.1	-----	-----	0.2
Total		0.7	-1.1	3.3	0.4	
Rear	Camber	Left	-0.7°	-2.3°	-0.3°	-0.6°
		Right	-1.2°	-2.3°	-0.3°	-1.0°
	Toe	Left	1.3	-0.5mm	1.7mm	1.3
		Right	-3.9	-0.5mm	1.7mm	-0.1
		Total	-2.6	-1.1	3.3	1.2
	Thrust Angle		-0.4°	-----	-----	-0.1°
Secondary Angles			Initial	Specifications		Final
				Min.	Max.	
SAI	Left		18.4°	14.0°	14.0°	18.4°
	Right		16.8°	14.0°	14.0°	16.8°
Included Angle	Left		18.1°	-----	-----	18.2°
	Right		16.7°	-----	-----	16.7°
Toe Out On Turns	Left		1.5°	-----	-----	1.5°
	Right		1.8°	-----	-----	1.8°
Maximum Turns	Left		-----	36.8°	39.8°	-----
	Right		-----	36.8°	39.8°	-----
Toe Curve Change	Left		-----	-----	-----	-----
	Right		-----	-----	-----	-----
Setback	Front		0.1"	-----	-----	0.0"
	Rear		-0.1"	-----	-----	-0.3"
Track Width Diff			0.4"			0.4"
Wheel Base Diff			0.2"			0.3"
Front Ride Height	Left		-----	-----	-----	-----
	Right		-----	-----	-----	-----
Rear Ride Height	Left		-----	-----	-----	-----
	Right		-----	-----	-----	-----
Frame Angle						-----

HOCK WAH MOTOR WORKSHOP PTE LTD

BLK 3011 BEDOK INDUSTRIAL PARK E

BEDOK NORTH AVE 4,

#01-2008/10/12 SINGAPORE 489977

TEL : 6441 5655 FAX : 6441 5355/6243 8121

R.O.C No : 200104141D GST Reg. No. 20-0104141-D

TO : 96673175

OMAR BIN MOHD HUSSEIN

BLK 491 TAMPINES STREET 45

#04-242

SINGAPORE 527491

TEL : FAX :

PH : 96673175

ATTN :

ESTIMATE BILL

Number : EB00006237

Date : 18/03/2023

Case No : AD00013735

Vehicle No : SLJ3409R

Chassis: JM6BN22A8H0120230

Year of Mfr 2016

Policy No 5131202906

Model : MAZDA 3

Term:

Sn	DESCRIPTION	QTY	U PRICE	DISC	AMOUNT
1	REAR FENDER RH <i>10/30/23</i>	1.0	1,233.80	20	987.04
2	REAR DOOR RH <i>10/30/23</i>	1.0	1,049.40	20	839.52
3	REAR DOOR STICKER TOP RH <i>11</i>	1.0	75.20	20	60.16
4	REAR DOOR INNER LOCK RH <i>11</i>	1.0	401.00	20	320.80
5	REAR DOOR RUBBER RH <i>11</i>	1.0	126.80	20	101.44
6	FRONT DOOR RH <i>10/30/23</i>	1.0	1,200.40	20	960.32
7	FRONT DOOR STICKER TOP RH <i>11</i>	1.0	116.20	20	92.96
8	FRONT DOOR INNER LOCK RH <i>11</i>	1.0	251.10	20	200.88
9	FRONT DOOR OUTER HANDLE RH <i>11</i>	1.0	69.00	20	55.20
10	WING MIRROR ASSEMBLY RH <i>11</i>	1.0	396.90	20	317.52
11	REAR WHEEL HUB BEARING RH <i>11</i>	1.0	434.90	20	347.92
12	REAR SHOCK ABSORBER RH <i>11</i>	1.0	322.40	20	257.92
13	REAR KNUCKLE ARM RH <i>11</i>	1.0	686.70	20	549.36
14	REAR LOWER ARM RH <i>11</i>	1.0	262.80	20	210.24
List Price - Parts Sub Total					5,301.28
15	ROCKER PANEL RH - REPAIR <i>11</i>	1.0			
16	REAR TYRE RH <i>11</i>	1.0	480.00	0	480.00
17	REAR WHEEL RIM RH <i>11</i>	1.0	880.00	0	880.00
18	WINDSCREEN SEALANT <i>11</i>	2.0	24.00	0	48.00
Special Nett Price - Parts Sub Total					1,408.00
Parts Total					6,709.28
19	LABOUR TO REMOVE & REFIT NECESSARY PARTS	1.0	1,200.00	0	1,200.00
20	SPRAY PAINT ON THE AFFECTED AREAS	1.0	1,200.00	0	1,200.00
21	ANTI-RUST COATING	1.0	120.00	0	120.00
22	TO REMOVE & REFIT UNDERCARRIAGE	1.0	350.00	0	350.00
23	TO REMOVE & REFIT WINDSCREEN	1.0	180.00	0	180.00
24	TO REMOVE & REFIT CUSHION & UPHOSTERY	1.0	250.00	0	250.00
25	FOUR WHEEL ALIGNMENT	1.0	180.00	0	180.00
Labour 1 Sub Total					3,480.00

E. & O. E.

Let Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and

CUSTOMER SIGNATURE is subject to final approval from Insurance Company

HOCK WAH MOTOR WORKSHOP PTE LTD

AUTHORISED SIGNATURE

Acknowledged by Repairer

Page 1 of 2

* N = Item not subjected to GST

Date:

Issued by : Anyisia

*not confirmed
10/4/23
4/5 \$4800
5 days
then photo after repair*

*p- 4575.80
202
366064
601064
4808*

HOCK WAH MOTOR WORKSHOP PTE LTD

BLK 3011 BEDOK INDUSTRIAL PARK E
BEDOK NORTH AVE 4,
#01-2008/10/12 SINGAPORE 489977
TEL : 6441 5655 FAX : 6441 5355/6243 8121
R.O.C No : 200104141D GST Reg. No. 20-0104141-D

TO : 96673175
OMAR BIN MOHD HUSSEIN
BLK 491 TAMPINES STREET 45
#04-242
SINGAPORE 527491
TEL : FAX :
PH : 96673175
ATTN :

ESTIMATE BILL

Number : EB00006237
Date : 18/03/2023
Case No : AD00013735
Vehicle No : SLJ3409R
Chassis: JM6BN22A8H0120230
Year of Mfr 2016
Policy No 5131202906
Model : MAZDA 3

Term:

Sn	DESCRIPTION	QTY	U_PRICE	DISC	AMOUNT
SINGAPORE DOLLARS : ELEVEN THOUSAND FOUR AND CENTS FORTY-TWO ONLY			Less Excess		0.00
			SUBTOTAL		10,189.28
			GST 8.00%		815.14
			TOTAL		11,004.42

Date of accident : 15/03/2023 07:15 AM. Place : WEST CAOST HIGHTWAY

E. & O. E.

HOCK WAH MOTOR WORKSHOP PTE LTD

CUSTOMER SIGNATURE

AUTHORISED SIGNATURE