

ASS. P.L.C. BY:

REF:

ASSIGNMENT


02 Oct 2029

From: _____ Date: _____
 Estimated Cost: _____
 OD / TP / WS / TP RES / OD RES / EVA / INV / MV
 To Inspect Vehicle No: _____
 at Workshop m/s _____
 of _____
 Insured: _____
 Policy No. _____
 Claims No. _____
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

Veh No: SHH 59885 Yr Regr: HOV 12009
 Type: MC / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or _____
 Make: Mercedes Benz S350 cc 3498
 Colour: Brown A/C: Insured / Std / NI / NA
 Sp. Reading: 96905 T/Radio: Insured / Std / NI / NA
 Eng/No: 27296531301882
 C/No: WDD2211562A296074
 Gen. Cond: 9 / Good / Fair / Poor / Burnt
 Steering: 9 / In order / Jammed / Leaked / Burnt or _____
 Brake: 9 / In order / Jammed / Leaked / Burnt or _____
 Mod: 9 / Nil / S/Rim / STD A/Rim or _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

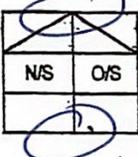

Bel. or Market Value: _____
 IDAC Accident Rpt: _____ Consistent?: Yes or No
 GIA / PR Seen: _____ Consistent?: Yes or No
 Est. Repairs: 9 days Res.: Yes or No
 Linn Sum: 20 % 3 Val.: Yes or No
 CA / REV / REP. / 24 HRS
 Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Tyre Size: F: 255/45 R18
 R: 11
 BS / DUN / EXNOVA / GY / PS / LZA / MRC / OHTSU / PIR / SUMI /
 TOYO / YOKO or Michelin
 Front _____ Rear _____
 R/Bal. 5 mm R/Bal. 5 mm
 L/Bal. 5 mm L/Bal. 5 mm
 D.O.A. 15/03/2023 D.O.L. 22/03/2023
 Survey held at Alford Auto
 Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or
Front & Rear
 The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	<u>Independent</u>

Date/Time, File Pass to? : Prel. Report
 : Final Report

Days Of Repair: _____
 Resurvey No. of Trip: _____

Date/Time, File Return to? _____

Add Fee: : Site Insp (\$) _____
 : Interview (\$) _____
 : Techn. Inve (\$) _____

Survey Fee: _____

Transportation:	_____
\$ + RS. SI	_____
Photos	_____
Other	_____

Report Format: _____
 I unite, 2000 I.P.P. 1/2



ALFRED AUTO

Services & Supplies

Blk 5035 Ang Mo Kio Ave 3 # 01-351 Industrial Park ? Singapore 569538
 Tel: 6483 4586 Fax: 6483 4882 Reg. No. 391089/00-E
 Email: alfredauto@hotmail.com



Reference No.: 180323

Date: 18.03.2023

Tan Boon Chye
 37 Hougang Ave 7 #05-03
 Singapore 538803.

Mercedes Benz S350

Estimate Repair Cost for Vehicle Reg. No: SNH 5988 J

1 Pc. Front Bonnet HH		1,991.00 (Nett) X	
1 2 Pcs. Front Bonnet Lock ST	@ 105.00	210.00 (Nett) ✓	188.55
2 Pcs. Front Bonnet Lock Catch HH	@ 95.00	190.00 (Nett) X	
2 Pcs. Front Bonnet Spring Stopper HH	@ 82.00	164.00 (Nett) X	
1 Pc. Front Bonnet Logo HH		110.00 (Nett) X	
10 Pcs. Front Bonnet Heat Seal Clips HH	@ 6.00	60.00 (Nett) X	
1 Pc. Front Grille Assy. w/c		991.00 (Nett) ✓	834.11
1 Pc. Front Grille Logo HF		95.00 (Nett) X	
2 Pcs. Front Head Lamp Assy. w/s w/c w/c/SHH @ 2,990.00		5,980.00 (Nett) ✓	2228.00
2 Pcs. Front Head Lamp Panel HH	@ 398.00	796.00 (Nett) X	
1 Pc. Front Centre Panel HH		290.00 (Nett) X	
1 Pc. Front Bumper distal w/c		2,038.00 (Nett) ✓	1845.00
1 Pc. Front Bumper Sponge HH		499.00 (Nett) ✓	192.00
1 Pc. Front Bumper Centre Inner Garnish HH		299.00 (Nett) ✓	245.90
2 Pcs. Front Bumper Corner Garnish HH	@ 315.00	630.00 (Nett) X	
2 Pcs. Front Bumper Side Retainer HH	@ 298.50	597.00 (Nett) X	
2 Pcs. Front Bumper Side Holder HH	@ 199.00	398.00 (Nett) ✓	
1 Pc. Front Bumper Centre Lower Garnish HH		299.00 (Nett) X	
1 Pc. Front Bumper Centre Grille HH		285.00 (Nett) X	
2 Pcs. Front Bumper Day Light HH	@ 490.00	980.00 (Nett) X	
2 Pcs. Front Bumper Fog Lamp Garnish HH	@ 190.00	380.00 (Nett) X	
1 Pc. Front Bumper Reinforcement HH		599.00 (Nett) X	
10 Pcs. Front Bumper Clips HH	@ 6.00	60.00 (Nett) 30/- SH	
10 Pcs. Front Bumper Rivet HH	@ 8.00	80.00 (Nett) X	
2 Pcs. Front Bumper Grille Base HH	@ 190.00	380.00 (Nett) X	
6 Pcs. Front Parking Sensor 2pc Dem 4pc HH @ 328.00		1,968.00 (Nett) ✓	656.00
6 Pcs. Front Parking Sensor Holder 2pc HH 4pc HH @ 59.00		354.00 (Nett) ✓	118.00
6 Pcs. Front Parking Sensor Ring 2pc HH 4pc HH @ 28.00		168.00 (Nett) ✓	56.00
1 Pc. Front Parking Sensor Harness Wire HH		498.00 (Nett) X	
1 Pc. No. Plate & Box ST		60.00 (S. Nett) 45/- SH	



ALFRED AUTO

Services & Supplies

Blk 5035 Ang Mo Kio Ave 3 # 01-351 Industrial Park 2 Singapore 569538
 Tel: 6483 4586 Fax: 6483 4882 Reg. No. 391089/00-E
 Email: alfredauto@hotmail.com



1 Pc. Rear Boot <i>BT</i>	1,990.00 (Nett) ✓
1 Pc. Rear Boot C&C Plate <i>HU</i>	45.00 (Nett) ✓
1 Pc. Rear Boot Lock <i>Down</i>	299.00 (Nett) ✓
1 Pc. Rear Boot Catch <i>leg</i>	238.00 (Nett) X
1 Pc. Rear Boot Chrome <i>HU</i>	391.00 (Nett) X
1 Pc. Rear Boot S350L Emblem <i>HU</i>	126.00 (Nett) ✓ 81.60
1 Pc. Rear Boot Logo <i>HU</i>	128.00 (Nett) ✓ 48.00
1 Pc. Rear Boot AMG Emblem <i>HU</i>	139.00 (Nett) ✓ 83.20
2 Pcs. Rear Lamp Assy. <i>o/s HU H/s mounty @ 1,280.00</i>	2,560.00 (Nett) ✓ 723.00
1 Pc. Rear End Panel <i>leg</i>	688.00 (Nett) X
1 Pc. Rear End Panel Lock Garnish <i>HU</i>	391.00 (Nett) X
1 Pc. Rear Bumper <i>distorted</i>	1,990.00 (Nett) ✓
1 Pc. Rear Bumper Centre Holder <i>broken</i>	298.00 (Nett) ✓
2 Pcs. Rear Bumper Side Retainer <i>o/s HU H/s @ 205.00</i>	410.00 (Nett) ✓ 142.00
2 Pcs. Rear Bumper Side Garnish <i>HU broken @ 190.00</i>	380.00 (Nett) X
1 Pc. Rear Bumper Lower Pad <i>mounty broken</i>	699.00 (Nett) ✓
2 Pcs. Rear Bumper Exhaust Garnish <i>HU @ 254.00</i>	508.00 (Nett) X
2 Pcs. Rear Bumper Exhaust Aluminum Cover <i>HU @ 210.00</i>	420.00 (Nett) X
1 Pc. Rear Bumper Reinforcement <i>BT</i>	990.00 (Nett) ✓ 835.00
1 Pc. Rear Bumper Sponge <i>HU</i>	391.00 (Nett) X
6 Pcs. Rear Parking Sensor <i>2pc Down 2pc HU @ 298.00</i>	1,788.00 (Nett) ✓ 596.00
6 Pcs. Rear Parking Sensor Holder <i>2pc HU 2pc HU @ 68.00</i>	408.00 (Nett) ✓ 136.00
6 Pcs. Rear Parking Sensor Ring <i>2pc HU 2pc HU @ 25.00</i>	150.00 (Nett) ✓ 50.00
1 Pc. Rear Lower Spare Tyre Garnish <i>BT</i>	399.00 (Nett) ✓
1 Pc. Rear Exhaust <i>BT</i>	3,910.00 (Nett) ✓ 2728.00
2 Pcs. Rear Exhaust Chrome (AMG) <i>H/s BT o/s HU @ 691.00</i>	1,382.00 (Nett) ✓ 198.00
2 Pcs. Rear Lamp Inner Garnish <i>broken @ 135.10</i>	270.20 (Nett) ✓
4 Pcs. Rear Exhaust Mounting <i>HU @ 60.00</i>	240.00 (Nett) X
1 Pc. Spare Tyre Board <i>HU</i>	590.00 (Nett) X
1 Pc. Weather Slips <i>document</i>	391.00 (Nett) ✓ 228.00

Total (Panels / Parts): **44,058.20 (SGD)**

Nett 18,600.56 SH 75.00

LABOR CHARGES

16,740.50

To check wiring, remove & refit all wires.

200.00 30/-

To remove & refit radiator & air-con condenser & top-up Gas & oil.

280.00 *HU*



ALFRED AUTO Services & Supplies

BK 5035 Ang Mo Kio Ave 3 # 01-351 Industrial Park 2 Singapore 569538
Tel: 6483 4586 Fax: 6483 4882 Reg. No. 391089/00-E
Email: alfredauto@hotmail.com



To remove & refit interior garnish, carpet & all accident Affected area.	250.00 120/-	
To remove & refit exhaust system.	280.00 80/-	
To welding, knocking, straightening repair & renew all Accident affected damage parts.	2,000.00 1000/-	
To respray painting on all accident inner & outer Affected area.	2,000.00 1000/-	
To rust proof all accident affected damaged area.	200.00 40/-	2420.00/-
To diagnostic & check control unit, reset memory to Identification standard.	380.00 150/-	

Total (Labor Charges): 5,590.00 (SGD)

TOTAL COST SUMMARY

PANELS / PARTS
LABOR CHARGES

22/03/2023 @ 1000am
 Not Actual
 2/3 same 9 days.
 44,058.20
 5,590.00
 2kk hrs

Check part prices.

Grand Total: 49,648.20 (SGD)

19,235.50
 supp 299.55
 19,535.05
 1/5 15,000/-

We shall be glad if you can forward the payment at your early convenience.

ACKNOWLEDGED BY	DATE	ALFRED AUTO SERVICES & SUPPLIES
		Alfred Quah

Note: Full payment must be completed 7 days from the invoice date. There will be an interest of 1.5% imposed per month on overdue invoice. Thank you.


- To resurvey before/after spray painting
 - To display damaged part(s) during resurvey
 - Parts prices are subject to confirmation
 - Third party survey is on a "Without Prejudice" basis
 - No illegal modification(s) is allowed
 - Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company
- Acknowledged by Repairer
 Signature:
 Date:



ALFRED AUTO

Services & Supplies

Blk 5035 Ang Mo Kio Ave 3 # 01-351 Industrial Park 2 Singapore 569538
 Tel: 6483 4586 Fax: 6483 4882 Reg. No. 391089/00-E
 Email: alfredauto@hotmail.com

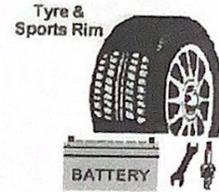

Reference No.: 180323

Date: 18.03.2023

Tan Boon Chye
 37 Hougang Ave 7 #05-03
 Singapore 538803.

Mercedes Benz S350

Supplementary Repair Cost for Vehicle Reg. No: SNH 5988 J

1 Pc. Front LH Head Lamp Washer Pump <i>Demo</i>	299.50 (Nett)	✓
1 Pc. Rear Spare Tyre Lower Cover <i>replace</i>	391.00 (Nett)	X
1 Pc. Exhaust Mounting <i>HM</i>	60.00 (Nett)	X
10 Pcs. Rear Lamp Inner Garnish Clips <i>broken</i> @8.00	80.00 (Nett)	✓ 30/- SH
Total (Panels / Parts):		830.50 (SGD)

TOTAL COST SUMMARY

PANELS / PARTS	830.50	299.50 10% 269.55// SH 30.00//
Grand Total:	830.50 (SGD)	299.55

We shall be glad if you can forward the payment at your early convenience.

ACKNOWLEDGED BY	DATE	ALFRED AUTO SERVICES & SUPPLIES
		<i>Alfred Quah</i>

Note: Full payment must be completed 7 days from the invoice date. There will be an interest of 1.5% imposed per month on overdue invoice. Thank you.

Payment Method

1. PAYNOW via UEN 39108900E
2. Bank Wire Transfer - (SGD Account)



ALFRED AUTO

Services & Supplies

Blk 5035 Ang Mo Kio Ave 3 # 01-351 Industrial Park 2 Singapore 569538
Tel: 6483 4586 Fax: 6483 4882 Reg. No. 391089/00-E
Email: alfredauto@hotmail.com

Tyre &
Sports Rim



Beneficiary/Company Name	Alfred Auto Services & Supplies
UEN no.	39108900E
Beneficiary's Bank Name	OCBC Bank
Account No.	620-453233-001
Bank Code	7339
Branch Code	620
Swift Code	OCBCSGSG