



Century Motors



Century Motors (Singapore) Pte Ltd  
6 Marsiling Lane  
Singapore 739145

E: claims@autoinsure.com.sg

T: (65) 3157 2626

GST No.: 192800002R

Page No.1

# **AUTOMOBILE ASSESSMENT REPORT**

Our Ref: SLN1760S (CK)

Your ref: SMR1396C

Date: 21-Mar-23

BY EMAIL ONLY  
(claims@autoinsure.com.sg)

## **ATTENTION: MOTOR CLAIMS DEPT**

### **LIBERTY INSURANCE PTE LTD**

51 CLUB STREET  
#03-00 LIBERTY HOUSE  
SINGAPORE : 069428

Assessed Vehicle No : SLN1760S  
Car Make and Model : HONDA VEZEL 1.5X HYBRID AT ABS D/AIRBAG 2WD  
Date of Accident : 20-Mar-23  
Date of Assessment : 21-Mar-23

We have carried out a physical assessment of SLN1760S at our workshop Auto Insure Pte Ltd sustained damages to the FRONT & REAR portion of the vehicle.


### **4. DESCRIPTION OF DAMAGE**

At the time of the inspection observed that this vehicle had sustained damages to the FRONT & REAR portion of the vehicle.

Please see attached schedule for details.

Remarks: NIL

Estimated Amount : L/S  
Adjusted Amount : \$ 17,187.38  
Est. Repair Days : 9

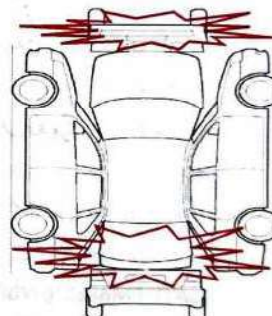

Pursuant to your instruction, we have **NOT AUTHORIZED** repair.  
The assessment was conducted on a "**WITHOUT PREJUDICE**" basis.

If we are not notified of anything within 14 Days from the date hereof, this report shall be treated as correct.

### **Disclaimer**

This report is intended for the exclusive use of the addressee solely in relation to the loss of occurrence in which the assessed vehicle is involved.

No liability or responsibility whatsoever shall be held by

**Century Motors (Singapore) Pte Ltd** For any reliance on this report by any third party.

Our Ref: SLN1760S

Your Ref: SMR1396C

S/NO	QTY	DESCRIPTIONS	ASSESSED CONDITION	EST. BY WORKSHOP
<b>PARTS REPLACEMENT - LIST ITEMS</b>				
1	1	TAILGATE LAMP LH X		\$ 948.90
2	1	TAILGATE LAMP RH X		\$ 948.90
3	1	TAIL LAMP RH X		\$ 850.90
4	1	TAIL LAMP LH X		\$ 850.90
5	1	REAR BUMPER de		\$ 735.90
6	1	REAR BUMPER CORNER LH X		\$ 265.90
7	1	REAR BUMPER CORNER RH repair		\$ 265.90
8	1	REAR BUMPER REFLECTOR LH X		\$ 89.50
9	1	REAR BUMPER REFLECTOR RH can		\$ 89.50
10	1	REAR BUMPER INNER BRACKET LH X		\$ 68.80
11	1	REAR BUMPER INNER BRACKET RH		\$ 68.80
12	1	REAR BUMPER SIDE RETAINER RH X		\$ 65.90
13	1	REAR BUMPER SIDE RETAINER LH X		\$ 65.90
14	1	REAR END PANEL bt		\$ 637.50
15	1	REAR END PANEL INNER TRIM de		\$ 320.90
16	1	TAILGATE bt		\$ 1,980.80
17	1	TAILGATE HINGE LH X		\$ 85.80
18	1	TAILGATE HINGE RH X		\$ 85.80
19	1	TAILGATE WEATHERSTRIP an		\$ 185.80
20	1	TAILGATE LOCK but		\$ 135.50
21	1	TAILGATE LOCK STRIKER X		\$ 45.90
22	1	TAILGATE LOGO an		\$ 85.50
23	1	TAILGATE EMBLEM(VEZEL) an		\$ 55.50
24	1	TAILGATE EMBLEM(HYBRID) an		\$ 55.50
25	1	TAILGATE GARNISH X		\$ 325.90
26	1	TAILGATE INNER TRIM ?		\$ 145.90
27	1	TOOLS BOX ?		\$ 320.90
28	1	SPARE WHEEL COVER X		\$ 455.90
29	1	FRONT BUMPER de		\$ 1,265.90
30	1	FRONT BUMPER TOWING COVER cut		\$ 45.80
31	1	FRONT BUMPER REINFORCEMENT ?		\$ 665.90
32	1	FRONT BUMPER SKIRT ?		\$ 398.90
33	1	FRONT BUMPER LOWER GRILLE ?		\$ 165.90
34	1	FRONT GRILLE COVER X		\$ 375.90
35	1	FRONT GRILLE can		\$ 855.90
36	1	FRONT GRILLE LOGO an		\$ 75.50
37	1	FRONT SUPPORT PANEL X		\$ 825.90
38	1	REAR WINDSCREEN MOULDING an		\$ 240.90
SUB TOTAL			\$	15,155.30
LESS 20%			\$	3,031.06
TOTAL AMOUNT			\$	12,124.24

Our Ref: **SLN1760S**

Your Ref: **SMR1396C**

S/NO	QTY	SPECIAL NETT ITEMS	ASSESSED CONDITION	EST. BY WORKSHOP
1	1	WINDSCREEN SEALANT		\$ 60.00
2	1	REVERSE SENSORS L & R		\$ 250.00
3	1	REAR BUMPER CLIPS		\$ 50.00
4	1	FRONT NUMBER PLATE WITH HOLDER		\$ 35.00
5	1	REAR NUMBER PLATE WITH HOLDER		\$ 35.00
SUB TOTAL				\$ 430.00
TOTAL PARTS COST				\$ 12,554.24

Our Ref: **SLN1760S**

Your Ref: **SMR1396C**

S/NO	DESCRIPTION	EST. BY WORKSHOP
<b>LABOUR &amp; PAINTWORK</b>		
1	TO REMOVE THE AFFECTED PARTS & FITTINGS TO COMMENCE REPAIRS; PANEL BEAT & RESHAPE THE AFFECTED AREAS AND REPLACED THE DAMAGED PARTS AND COMPONENTS	\$ 1,600.00
2	TO REMOVE & REFIT WIRING SYSTEM AT ACCIDENT AND CHECK FOR PROPER FUNCTIONS	\$ 100.00
3	TO RESPRAY AND SUPPLY EXPANDABLE ITEMS & PUFFY ON PARTS REPLACED	\$ 1,200.00
4	TO PERFORM ANTI-RUST TREATMENT ON AFFECTED AREAS	\$ 100.00
5	TO REMOVE & REFIT TAILGATE MECHANISM	\$ 100.00
6	TO REMOVE & REFIT WINDSCREEN	\$ 100.00
7	SUNDRIES (SAND PAPER, WELDING WIRE ETC.)	\$ 50.00
8	TO VACUUM, WAXING & CLEAN	\$ 50.00
9	TO PERFORM WATER SEEPAGE TEST ON REPAIRED PORTIONS	\$ 60.00
TOTAL BEFORE GST		\$ 15,914.24
GST 8%		\$ 1,273.14
TOTAL (PARTS & LABOUR):		\$ 17,187.38

**Adjustments / Recommendations**

Our estimator have throughly inspected each and every item on the estimate against physical damage found on the vehicle and have listed the breakdown of our finding and recommendation.

Our Workshop has agreed to undertake the job at a sum of \$ 17,187.38 for lump sum with the third party insurance.

Yours Faithfully,

Ck Loh  
Claims Estimator

**LKK Auto Consultants** hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer  
Signature:  
Date:

*Rahul*  
Hp 90010068  
8 days  
L/S  
23/03/23 @ 1230  
Rebg after repair