

(08/11/13) wef
ASS. REC. BY: Marcus

REF:

CS/LAW 23003422/UV43

ASSIGNMENT

From: _____ Date: _____
Estimated Cost: _____
OD / TP / WS / TP RES / OD RES / EVA / INV / MV
To Inspect Vehicle No: FBS 4950H
at Workshop m/s HL cycle 12.30pm
of _____
Insured: SLD 7532Y
Policy No. RT/CT/17/2023/gn
Claims No. JEQ/220241/0422/HC/PD/PI/kv
Sum Insured: _____ Excess: _____
(Client's Record)
Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

N/S	O/S

Bal. or Market Value: _____
IDAC Accident Rpt: _____ Consistent?: Yes or No
GIA / PR Seen: _____ Consistent?: Yes or No
Est. Repairs: 6 days Res.: Yes or No
Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: Allen 64844842

Vehicle: IN / OUT

Veh No: FBS 4950H Yr Regn: 10/05/21
Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
Truck / Trailer or
Make: Yamaha MTN 155 c.c. 155
Colour: white A/C: Insured / Std / NI / NA
Sp. Reading: 4833 T/Radio: Insured / Std / NI / NA
Eng/No: _____
C/No: MH3RG711000001148
Gen. Cond: Good / Fair / Poor / Burnt
Steering: In order / Jammed / Leaked / Burnt or
Brake: In order / Jammed / Leaked / Burnt or
Modi: Nil / S/Rim / STD A/Rim or
Tyre Size: F: 110/70R17
R: 140/70R17

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or IRC

Front	Rear
R/Bal. <u>7</u> mm	R/Bal. <u>7</u> mm
L/Bal. _____ mm	L/Bal. _____ mm
D.O.A. <u>16/04/22</u>	D.O.I. <u>6/4/23</u>

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

13/4/23 MTN
submit 4/5 @ 4250 (red 2950, 40%)

Date/Time, File Pass to?

1)

Date/Time, File Return to?

2) 26/4/23-typist

Report Format: TP RES

Lum Sum / t.B.I: (\$ 4250)

Days Of Repair: 6

Resurvey No. of Trip: _____

Add Fee:

☐ : Site Insp (\$ _____)
☐ : Interview (\$ _____)
☐ : Tech. Invs (\$ _____)
☐ : Weekend (\$ _____)

Survey Fee:

Transportation:

____ S + RS, ____ SI

Photos

Others

TOTAL

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	530F
Vehicle Details	
Vehicle No.:	FBS4950H
Vehicle to be Exported:	No
Intended Deregistration Date:	06 Apr 2023
Vehicle Make:	YAMAHA
Vehicle Model:	MTN155
Primary Colour:	Grey
Manufacturing Year:	2020
Engine No.:	G3R1E0002347
Chassis No.:	MH3RG711000001146
Maximum Power Output:	-
Open Market Value:	\$3,005.00
Original Registration Date:	10 May 2021
First Registration Date:	10 May 2021
Transfer Count:	1
Actual ARF Paid:	\$451.00
Intended PARF Rebate Details	
PARF Eligibility:	No
PARF Eligibility Expiry Date:	-
PARF Rebate Amount:	\$0.00
Intended COE Rebate Details	
COE Expiry Date:	09 May 2031
COE Category:	D - Motorcycle
COE Period(Years):	10
QP Paid:	\$8,011.00
COE Rebate Amount:	\$6,482.00
Total Rebate Amount:	\$6,482.00

The information contained herein is correct as at 06 Apr 2023

OK

FormTeam Consultancy Pte Ltd

No.33, Ubi Ave 3
#02-15, Vertex
Singapore 408868

Tel : (65) 6509 1788
Fax : (65) 6509 6221

Email: motorsurvey@fta.com.sg

Co.Reg No: 200819280D

GST Reg No: 200819280D

Our Reference : NTUC22-041022/PRS/GS/ADJ/GS/cg

Your Reference: MT/1169124-001

Date : 30-May-2022

Motor Claims Department
NTUC Income Insurance Co-operative Limited
73 Bras Basah Road
#05-01 NTUC Trade Union House
Singapore 189556

Attention : Ms Rajeswary

Dear Sir/Mdm,

SURVEY OF VEHICLE NO. FBS 4950H

Pursuant to your instruction on **23-May-2022**.

We recommend a repair cost of **\$4,150.00** (see report) based on lump sum repair and
the estimated duration of repairs would take **06 days**.

Thank you for this assignment.

Your faithfully

FormTeam Consultancy Pte Ltd
Adjusters & Surveyors (Licensed Appraiser)



Gary Soon
Automobile Appraiser

(Email : gary@fta.com.sg)

Encl. Survey Report

AUTOMOBILE ASSESSMENT REPORT

Page No. 1

Our Reference : NTUC22-041022/PRS/GS/ADJ/GS/cg

Your Reference: MT/1169124-001

Date : 30-May-2022

Attention : Ms Rajeswary

TO : Motor Claims Department
NTUC Income Insurance Co-operative Limited
73 Bras Basah Road
#05-01 NTUC Trade Union House
Singapore 189556

Assessment of Vehicle No : **FBS 4950H**
Date of Accident : **16-April-2022**
Date of Inspection : **20-April-2022**
Address of Inspection : **1 Kaki Bukit Ave 6 #02-58 S'417883**

We have carried out a physical assessment of **FBS 4950H** at **M/S H L Cycle Pte Ltd** according to your instructions on **20-Apr-2022**, dismantled items on **22-Apr-2022**, post repair survey on **29-Apr-2022** and are pleased to submit our report herewith.

1. VEHICLE PARTICULARS

Registration No. : FBS 4950H
Make & Model : Yamaha MT-15
Year of Registration : 2021
Engine Capacity : 155 cc
Chassis No. : MH3RG711000001146
Engine No. : G3R1E0002347
Colour : Silver
Mileage (km) : 3305

2. VEHICLE CONDITION

Body Paint : Good
Steering : Serviceable
Foot Brake : Serviceable
Parking Brake : Nil

3. TYRE PARTICULARS & CONDITION

Front

RH Make/Size : IRC 110/70 R17 - 70%
LH Make/Size :

Rear

RH Make/Size : IRC 140/70 R17 - 70%
LH Make/Size :

Note : % denotes the remaining percentage of the tyre


FormTeam Consultancy Pte Ltd

Our Reference : NTUC22-041022/PRS/GS/ADJ/GS/cg
Your Reference : MT/1169124-001
Vehicle Number : FBS 4950H

Page No. 2

4. DESCRIPTION OF DAMAGE

At the time of inspection, this vehicle sustained damages to the **N/S & O/S** portion. Please see attached scheduled for details.

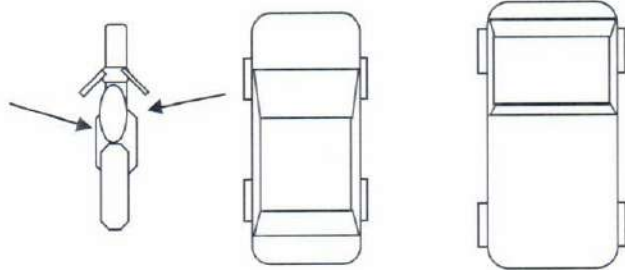

5. REMARKS

Market Value : -
Salvage Value : -
Repair Limit (Nett Loss) : -
Repairer's estimate : **Not Provided**
Nett Saving : -
Excess : -
Sum Insured : -
Our adjusted amount : **\$ 4,150.00**
Estimated Repair Days : **06 days**

Additional photographs will be submitted upon request by our principal.

Pursuant to your instruction, we have **NOT AUTHORIZED** repair.

The assessment was conducted on a "**Without Prejudice**" basis.

If we are not notified of anything to the contrary within **14 days** from the date hereof, this report shall be treated as correct.

Disclaimer

This report is intended for the exclusive use of the addressee solely in relation to the loss occurrence in which the assessed vehicle is involved. No liability or responsibility whatsoever shall be held by **FormTeam Consultancy Pte Ltd** for any reliance on this report by any third party, unless with the permission of the addressee.

FormTeam Consultancy Pte Ltd

Our Reference : NTUC22-041022/PRS/GS/ADJ/GS/cg

Page No. 3

Your Reference : MT/1169124-001

Vehicle Number : FBS 4950H

[illegible]

FormTeam Consultancy Pte Ltd

Our Reference : NTUC22-041022/PRS/GS/ADJ/GS/cg
 Your Reference : MT/1169124-001
 Vehicle Number : FBS 4950H

Page No. 4

QTY	DESCRIPTION	CONDITION	REPAIRER'S ESTIMATE (S\$)	OUR ASSESSMENT (S\$)
	<u>SPECIAL NETT ITEMS</u>			
1	Rear Number Plate	Necessary	-	18 15.00
2	Fork Oils	Necessary	-	40.00
2	Fork Oil Seals	Necessary	-	70.00
1	Steering Cone (Set)	Necessary	-	95 80.00
1	Rear Tyre (Depreciation)	Cut	-	150.00
1	Rear Camera	Malfunction	-	280.00
		Special Nett Total :	-	635.00
		Parts Total :	-	4,917.20

FormTeam Consultancy Pte Ltd

Our Reference : NTUC22-041022/PRS/GS/ADJ/GS/cg
Your Reference : MT/1169124-001
Vehicle Number : FBS 4950H

Page No. 5

S/N	DESCRIPTION	REPAIRER'S ESTIMATE (S\$)	OUR ASSESSMENT (S\$)
	LABOUR		
1	To provide towing service. (LOD)	-	-
2	To check electrical system, wire harness and focus headlamp.	-	-
3	To remove, cut out damage portion, jack out, straighten, panel beating, welding, align and renew replaced parts.	-	300.00
	Labour Total :	-	300.00
	TOTAL (PARTS & LABOUR) :	-	5,217.20

The final adjusted Lump Sum contract amount is \$ **4,150.00**
(SINGAPORE DOLLARS FOUR THOUSAND ONE HUNDRED AND FIFTY ONLY)



Frankie Pang
AMSAE(AUST), AMIRTE, AMSOE,
MASPACI, MSAAA
Licensed Appraiser



Gary Soon
Automobile Appraiser

LCL APPRAISER PTE LTD

24 Penshurst Place, Singapore 556440

Email: clappraiser@yahoo.com Hp: 9068 8689 Fax: 6452 9783

Reg No: 201000228E

VEHICLE INSPECTION REPORT

To: Tan Xinda Edmund
C/o: H L Cycle Pte Ltd
No.1 Kaki Bukit Ave 6
#02-58/60 AutoBay, Singapore 417883

Date : 9 May 2022
Our ref : HLC/04/2201/TP

Accident Date : 16 April 2022
Inspection Date : 20 April 2022
Repairer Name : H L Cycle Pte Ltd
No.1 Kaki Bukit Ave 6
#02-58/60 AutoBay, Singapore 417883

Type of Survey : Third Party

PARTICULARS OF VEHICLE

Registration No : FBS 4950 H
Make / Model : Yamaha MTN 155
Chassis No : MH3RG711000001146
Engine No : G3R1E0002347

Year / Capacity : 2021 / 155 cc
Colour : Silver
Mileage : 3305

CONDITION OF TYRES

	Make	Size	Thread Balance	Rim
Front	IRC	110/70 -17	5 mm	Sport
Rear	IRC	140/70 -17	5 mm	Sport

GENERAL DESCRIPTION OF DAMAGE VEHICLE

The impact damages sustained on the vehicle at the time of inspection is on the rear, o/s and front n/s portion.
(Details refer to the photographs attached)

Enclosed number of photographs: 120 copies

REMARKS

This inspection was conducted entirely on a "**WITHOUT PREJUDICE**" basis and we have not given authorization and instruction to the repairer to proceed with the repair.

RECOMMENDATIONS

We have thoroughly inspected each and every item on the estimate against the physical damage found on the vehicle and we have listed the breakdown of our finding and our recommendation.

The repairer has agreed to undertake the job at a **Lump Sum of \$7,200.00** on a contractual basis.

Under normal circumstances, the repair period would be about 10 (Ten) working days.

SCL APPRAISER PTE LTD

Vehicle Registration No.: FBS 4950 H

Our Ref No.: HLC/04/2201/TP

Qty	Description	Conditions	Repairer's Estimate	Revised Amount
-----	-------------	------------	---------------------	----------------

SPARE PARTS - LIST ITEMS

Rep = Replaced

1	Front fender	Damage	\$ 230.00	\$ Rep 230.00 ✓
1	Front o/s fork assy	Damage	\$ 1,278.00	\$ R 1,278.00 ✓
1	Front n/s fork assy	Damage	\$ 1,278.00	\$ R 1,278.00 ✓
1	Fork under bracket	Intact	\$ 650.00	\$ Svc X
1	O/s side mirror	Damage	\$ 80.00	\$ Repair 80.00 ✓
1	Handle-bar	Damage	\$ 255.00	\$ Rep 255.00 ✓
1	Handle-bar balancer (1 set)	Damage	\$ 45.00	\$ Rep 45.00 ✓
1	Brake lever	Damage	\$ 80.00	\$ Svc 80.00 X
1	Fuel tank centre cover	Damage	\$ 255.00	\$ R 255.00 X
1	O/s side board	Damage	\$ 85.00	\$ Svc 85.00 X ^R
1	Front o/s footrest	Damage	\$ 45.00	\$ Rep 45.00 ✓
1	Front o/s footrest bracket	Damage	\$ 90.00	\$ Rep 90.00 ✓
1	Brake pedal	Damage	\$ 75.00	\$ Rep 75.00 ✓
2	Rear footrests	Damage	\$ 110.00	\$ O/S Rep 110.00 1pc 55
2	Rear footrest brackets	Damage	\$ 210.00	\$ S/O/S Rep 210.00 1pc 105
2	Rear tailboards	Damage	\$ 570.00	\$ R 570.00 X
2	Rear signals	Damage	\$ 150.00	\$ Rep 150.00 ✓
1	Exhaust assy	Damage	\$ 855.00	\$ Rep 855.00 ✓
1	Exhaust end cap	Damage	\$ 48.00	\$ Rep 48.00 ✓
1	Exhaust protector	Damage	\$ 65.00	\$ Rep 65.00 ✓
1	Rear fender	Damage	\$ 85.00	\$ Rep 85.00 ✓
1	Rear fender inner bracket	Damage	\$ 175.00	\$ Rep 175.00 ✓
1	Swing arm	Damage	\$ 1,050.00	\$ Rep 1,050.00 ✓
1	Chain cover	Damage	\$ 55.00	\$ Rep 55.00 ✓
1	Rear taillamp	Damage	\$ 195.00	\$ Rep 195.00 ✓
1	Rear sport rim	Damage	\$ 850.00	\$ Rep 850.00 ✓
1	Rear rim shaft	Necessary	\$ 65.00	\$ Rep 65.00 ✓
1	Rear brake disc	Damage	\$ 185.00	\$ Rep 185.00 ✓
			\$ 9,114.00	\$ 8,464.00
			Less 10%	\$ 911.40
			\$ 8,202.60	\$ 7,617.60
Total Cost - List Items				

n/s svc
n/s svc

SCL APPRAISER PTE LTD

Vehicle Registration No.: FBS 4950 H

Our Ref No.: HLC/04/2201/TP

Qty	Description	Conditions	Repairer's Estimate	Revised Amount
List Items Total c/f			\$ 8,202.60	\$ 7,617.60

SPECIAL NETT ITEMS

1	Rear number plate	Damage	\$ 18.00	\$ <i>Repart</i> 18.00 ✓
2	Fork oils	Necessary	\$ 40.00	\$ <i>rec</i> 40.00 ✓
2	Fork oil seals	Necessary	\$ 70.00	\$ <i>rec</i> 70.00 ✓
1	Steering cone (1 set)	Necessary	\$ 95.00	\$ <i>rec</i> 95.00 ✓
1	Rear tyre (Depreciation)	Damage	\$ 350.00	\$ <i>Rep</i> 175.00 <i>150</i>
1	Rear camera	Damage	\$ 450.00	\$ <i>Rep</i> 450.00 <i>280</i>
Total Cost - Special Nett items			\$ 1,023.00	\$ 848.00

Total cost of parts

\$ 9,225.60 \$ 8,465.60

Vehicle Registration No.: FBS 4950 H

Our Ref No.: HLC/04/2201/TP

S/No	Description	Repairer's Estimate	Revised Amount
------	-------------	---------------------	----------------

Total cost of parts c/f

\$ 9,225.60 \$ 8,465.60

LABOUR

1	To provide towing service. <i>10hr LOD</i>	\$ 50.00	\$ 50.00 <i>X</i>
2	To check electrical system, wire harness and focus headlamp.	\$ 80.00	\$ 11 50.00 <i>X</i>
3	To provide labour charges, workmanship to dismantle above damaged parts ; re-align body structure and damaged consistent to the accident. <i>}</i>	\$ 450.00	\$ 400.00 <i>38v</i>

GRAND TOTAL

\$ 9,805.60 \$ 8,965.60

C L APPRAISER PTE LTD

Vehicle Registration No.: FBS 4950 H

Our Ref No.: HLC/04/2201/TP

The repairer has agreed to undertake the repair under a Lump Sum Basis. We have further adjusted the amount to a **Lump Sum Repair Contract of : \$ 7,200.00**

By accepting to carry out the repairs on a contract lump sum basis, the repairer has the discretion to replace the damaged parts with used, reconditioned or new parts, or to repair it to a roadworthy condition.

Note: The revised estimate was made from a visual inspection. Should there be any discrepancy or unseen damage / item in this survey, kindly notified the company within seven (7) from the date hereof. Otherwise, the revised amount shall be deemed to be valid.

Disclaimer

The rates and assessment of damages as stated in this report is to be used solely for legal proceedings in relation to the surveyed vehicle and the accident in which the surveyed vehicle was involved in. The rates and assessment of damages must not be used in any circumstances for comparison with other vehicle and/or other accident in other legal proceedings.

C L APPRAISER PTE LTD



Cheong K. H
Automotive Appraiser

2-4788
102
2-4282-2
S.N-653
L-380
53182
203
4252