ASS. REC. BY:	230037941KV.
	Veh No: GBL 58792 Yr Regn: 11 1 11  Type: M.Car / M.Cycle / Bus / Yan / Lorry / Taxi / Prime Mover.  Truck / Trailer or A) ',  Make: New Vito 114 CB1 2143  Colour Real AC: Insured / Std / NI / NA  Sp.Reading 38592 T/Radio: Insured / Std / NI / NA  Eng/No:  C/No: WI V 44 7603 23891533  Gen. Cond: Geod / Fair / Poor / Burnt  Steering: Inorder / Jammed / Leaked / Burnt or  Brake: Inorder / Jammed / Leaked / Burnt or  Modi: MT S/Rim / STD A/Rim or  Tyre Stze: F:  R: 215/60R16  BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHT SU / PIR / SUMI /  TOYO / YOKO or Wilch lander  Eton! Rear  R/Bai. 9 mm R/Bai. 9 mm  L/Bai. 9 mm  L/Bai. 9 mm  L/Bai. 9 mm  D.O.A. 2 / 4/23  Survey held at
CA / REV / REP. / 24 HRS  Vehicle: IN / OUT  Date:Person Contacted:  Date / Time   Action / Instruction	Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or /57 //S  The U/C / Chassis frame / Body Structure affected due to collision.
R II.	
	Days Of Repair:  Resurvey No. of Trip:  Survey Fee:
Add Fee: eport Format : imp Sum / I.B.I: (S	Transportative  Site Insp (\$ ) _ \$ - RS \$I  Interview (\$ ) Fire / \$  Tech Invs (\$ ) Others  Weekend (\$ )
	ICTAL



### TONG LUCK AUTO PTE LTD

160 SIN MING DRIVE #07-01/06 SIN MING AUTOCITY, SINGAPORE 575722

Tel: 6250 0088 Fax: 6250 5545 Email: operation@tlauto.com.sq

GST No: 201700521W UEN No: 201700521W

PAGE: 1

M/S : ALLIANZ INSURANCE SINGAPORE PTE TLD

: OWN DAMAGE

79, ROBINSON ROAD #09-01 Not Northwise

Rearry B& pains X: ExTBA

ATTN: MOTOR CLAIMS DEPT

**ACCIDENT DATE : 02/04/2023** 

TEL :

YOUR REF NO

**CLAIM TYPE** 

FAX:

**ESTIMATE** 

NO : QUOT202304-000028(00)

DATE : 12/04/2023 **POLICY NO** : SP2003902365

VEH REG NO : GBL5879L MAKE/MODEL : MERCEDES BENZ VITO 114 CDI

PANEL VAN LONG AT ABS 5DR

CHASSIS NO : W1V44760323891533

**ENGINE NO** : 65195035425360

REG. DATE : 2021

#### Estimate Repair Cost to Vehicle No: GBL5879L

Description	Qua	antity	Uni	t Price	Amount
				<u>s\$</u>	<u>\$\$</u>
PARTS		_		950.00	24 950.00 L
1 Bonnet	0/17	1 2	NISE	85.00	170.00
2 Bonnet hinges - RH / LH	-,,	1		115.00	115.00 7
3 Bonnet lock 4 Bonnet catch		1		45.00	1 45.00 ×
5 Bonnet pull handle		1		98.00	98.00 7
6 Bonnet cable		1		48.00	48.00 7
7 Support panel		1		325.00	M 325.00
8 Support panel top garnish	V .	1		78.00	CM 78.00 -
9 Support panel top bracket - RH / LH	1	1		23.00	23.00 7
10 Brace panel		1		88.00	R 88.00 X
11 Headlamp assy - LH		1		580.00	Br 580.00
12 Front bumper		1		780.00	CM 780.00
13 Front bumper reinforcement		1		620.00	€ 620.00 ×
14 Front bumper side retainer - LH		1		58.00	CM 58.00 -
5 Front bumper inner carrier - LH		1		115.00	CM 115.00 -
6 Front bumper centre logo		1		92.00	Nec 92.00 -
7 Front bumper support - LH		1		58.00	Mi'Y 58.00 -
8 Support panel side sponge - LH		1		24.00	Ary 24.00 -
9 Front bumper holder - LH		1		24.00	mry 24.00 L
Front bumper lower frame		1		226.00	226.00
Front bumper under cover		1		112.00	112.00
2 Front grille inner support		1		480.00	480.00
Front fender - LH		1		590.00	R 590.00 €
Front fender wheel house extension member- LH		1		780.00	~
		1		125.00	4.44
		1		30.00	
Front fender inner shield cover - LH				12.00	
Front fender rail - LH		1			
Front fender - LH			Report		175
Front door hinges - LH		:	2	112.0	0 / 224.00
					7,970.00
				Add 10	742.00
					8,712.00



## TONG LUCK AUTO PTE LTD

160 SIN MING DRIVE #07-01/06 SIN MING AUTOCITY, SINGAPORE 575722

Tel: 6250 0088 Fax: 6250 5545 Email: operation@tlauto.com.sg GST No: 201700521W UEN No: 201700521W

PAGE: 2

: ALLIANZ INSURANCE SINGAPORE PTE TLD

79. ROBINSON ROAD #09-01

SINGAPORE 068897

ATTN: MOTOR CLAIMS DEPT

TEL :

FAX:

YOUR REF NO

: OWN DAMAGE CLAIM TYPE

ACCIDENT DATE : 02/04/2023

**ESTIMATE** 

NO

: QUOT202304-000028(00)

DATE

: 12/04/2023

**POLICY NO** 

: SP2003902365

VEH REG NO : GBL5879L

MAKE/MODEL: MERCEDES BENZ VITO 114 CDI PANEL VAN LONG AT ABS 5DR

CHASSIS NO : W1V44760323891533

**ENGINE NO** 

: 65195035425360

REG. DATE

: 2021

### Estimate Repair Cost to Vehicle No: GBL5879L

	Description	Quantity	Unit Price	Amount
31	Front quater glass sealant - LH	1	<u>\$\$</u> 40.00	Nec 40.00 301
	LABOUR			65.00
32	To remove and refit LH quater glass to facilitates the repairs	1	80.00	80.00
33	To transfer LH front door interior mechanism and glass to new door	1	150.00	nn 150.00 X
34	To check and rectify wiring system	1	80.00	80.00
	To panel beat and straighten LH front fender inner panel, LH front chassis frame, LH front door pillar, to cut and weld LH front wheel house extension member, including replacement of parts and align where necesary, to refit and adjust the same	1	1,800.00	1,800.00 //s
	To putty and spray paint on affected areas	1	1,500.00	1,500.00
37	To compterise check wheel alignment	1	120.00	120.00
	GK.			3,730.00
			TOTAL	S\$ 12,507.00
			ADD GST @ 8%	1,000.56
			GRAND TOTAL	S\$ 13,507.56

SINGAPORE DOLLAR THIRTEEN THOUSAND FIVE HUNDRED SEVEN AND CENTS FIFTY-SIX ONLY

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

FOR TONG LUCK AUTO PTE LTD

# **C** SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report <u>correctly</u> the details of the accident to speed up the claims process.

2. This Form must be <u>completed by the Policyholder and/or the Actual Driver</u>

3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or witholding of material facts may allow insurance companies to repudiate Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or witnoiding of material racts may allow insurance companies.
 The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
 Any false reporting may be referred to the Police for investigation.
 This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
 By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

#### **ACCIDENT STATEMENT**

Date of Submission Reported by **Date of Accident Exact Location of Accident** Additional Location Information Country/State of Loss

03/04/2023 15:58 (SGT) **Actual Driver** 02/04/2023 09:00 (SGT) Woodlands Street 31, Singapore **NEXT TO BLK 343 OSCP** Singapore

#### **DETAILS OF OWN VEHICLE**

Vehicle Registration Number

GBL5879L

INSURED/POLICYHOLDER

Is company?

Name Of Registered Owner

Company Reg No **Email Address** 

Mobile Phone No Alternative Phone No.

MERCEDES-BENZ FLEET MANAGEMENT SINGAPORE PTE

1XXXXX778Z

too\_tong.tan@mercedes-benz.com

(Phone) +65-88511742 (Office) +65-82821711

VEHICLE PARTICULARS

Manufacturer

Model Variant

Exact purpose for which vehicle was being used at time of

Are you claiming under your own insurance policy for repair to

your vehicle? Vehicle Category

**Transmission** 

CC

Mercedes

Vito

**Employment** 

Yes

Commercial vehicle

Auto

2143

30/08/1974

INSURANCE COMPANY

Name of Insurance Company

Policy Number / Cover Note Number

Allianz Insurance Singapore Pte. Ltd. SP2003902365

DRIVER

Name of Driver NRIC No

Date Of Birth

MOHAMMAD NOH BIN OSMAN SXXXX586Z



#### SKETCH PLAN

#### IMPORTANT NOTICE

- 1. Please correctly report the details of the accident to speed up the claims process.
- 2. This Form must be completed by the Policyholder and/or the Authorized Driver.
- 3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
- 4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
- 5. Any false reporting may be referred to the Police for investigation.
- 6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association
- of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
- 7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the center and to copies of the report being made available aforesaid.
- 8. Consent under the Personal Data Protection Act (PDPA)

lunderstand, acknowledge, agree and consent that:

- (a) My insurer , my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of :
- (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to
- (ii) investigating the accident and/or my claims.
- (ii) carrying out and/or dealing with my instructions or responding to any enquiries by me.
- (v) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
- (v) complying with applicable law in administering, processing, handling and/or dealing with my claims. (Collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use disclose and/or process my Personal Information for one or more of the above Purposes; and

(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third-party service providers or agents(including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.


Policyholder's Signature / Date & Time

Driver's Signature (If driver is not the policyholder) / Date & Time 02042023 - 1430

Witnessed by Reporting Centre Personnel

FLASH ACCIDENT REPORTING OFFICER **FRO VICKY** 

Sketch Plan

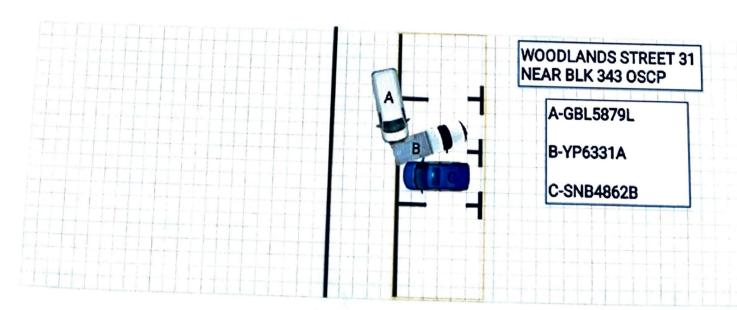

#### k to OneMotoring

## nquire PARF/COE Rebate for Registered Vehicle

**Vehicle Owner Particulars** 

Owner ID Type:

Owner ID:

**Vehicle Details** 

Vehicle No.:

Vehicle to be Exported:

**Intended Deregistration Date:** 

Vehicle Make:

Vehicle Model:

Primary Colour:

Manufacturing Year:

Engine No.:

Linguic 110..

Chassis No.:

Maximum Power Output:

Open Market Value:

**Original Registration Date:** 

First Registration Date:

Transfer Count:

Actual ARF Paid:

**Intended PARF Rebate Details** 

PARF Eligibility:

PARF Eligibility Expiry Date:

**PARF Rebate Amount:** 

**Intended COE Rebate Details** 

**COE Expiry Date:** 

COE Category:

COE Period(Years):

QP Paid:

COE Rebate Amount: Total Rebate Amount:

The information contained herein is correct as at 12 Apr 2023

Company

778Z

**GBL5879L** 

No

30 Jun 2023

MERCEDES BENZ

VITO 114 CDI PANEL VAN LONG AT ABS 5DR

White

2021

65195035425360

W1V44760323891533

\$32,999.00

05 Nov 2021

05 Nov 2021

0

\$1,650.00

No

140

\$0.00

04 Nov 2031

C - Goods Vehicle & Bus

10

\$39,000.00

\$32,543.00

\$32,543.00