

ASS. REC. BY:

REF:

A15/23003937/Kp

C

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD/TP/WS/TP RES/OD RES/EVA/INV/MY

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

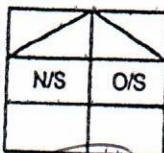

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

05

days

Res.:

Yes or No

Lum Sum:

30

%

3 Val.:

Yes or No

CA / REV / REP.

24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

PJG 5137B Yr Regn: 07, 08

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Honda Proton C.C. 1799

Colour

M. Gray A/C: Insured / Std / NI / NA

Sp. Reading

318933 T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Mod: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Front

Rear

R/Bal.

mm

R/Bal.

mm

L/Bal.

mm

L/Bal.

mm

D.O.A.

12/4/23

D.O.I.

17/4/2023

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

28/4 21:00 @ 3450h Car

Date/Time, File Pass to?

☐

: Prell. Report

1)

Date/Time, File Return to?

☐

: Final Report

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S - RS. SI

Parking

Others

TOTAL

Report Format :

Lump Sum / I.B.I: (\$

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Accord Auto Services Pte Ltd (Co.Reg.No:201113141K)

10 Ang Mo Kio Ind Park 2A #03-11, AMK Auto Point

Singapore 568047

Tel: 64819517/85715140 Fax: 64819515 Email: admin@mycarworkshop.com.sg

TP INSURER:
CHUA ZHENG-LI**Allianz Insurance Singapore Pte. Ltd. (HQ)**

Singapore

PARTICULARS OF CLAIM

Claim Type:	THIRD PARTY	Ref. No:	
Policy No:		Date of Loss:	12/04/2023
Vehicle Reg. No.:	SJG5137B	Driveable?	
Party At Fault:	UNKNOWN		
Driver (TP):	CHUA ZHENG-LI		
Make/Model:	HONDA STREAM, 1.8 (A)	Vehicle Reg. Date:	03/07/2008
Vehicle Colour:	SILVER		
Engine No:	R18A1753949	Chassis No:	RN61048308
Odometer:	318932 KM		
Paint Type:			<i>Not Noted</i>
Total Loss?	NO		<i>61 Png @ 3450h</i>
Est. Duration of Repair (day)	5 ✓		<i>Recovery After Paint</i>
Present Location:	ACCORD AUTO SERVICES PTE LTD (HQ)		

COST OF CLAIMS

	Amount
Parts	4,084.30
Miscellaneous Items	725.00
Labour	3,210.00
Paintwork Labour	0.00
Towing	0.00
Gross Total (\$\$)	8,019.30
+ GST 8.00% (\$\$)	641.54
Nett Amount (\$\$)	8,660.84

This claim is handled by: GOH JACQUELINE

Generated using Merimen e-Claims Internet Estimation & Adjusting System

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 14 Apr 2023)
Parts: M1-MPV HONDA STREAM 1.8 (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's (Price-denominated Standard List)
Print Code: (Unsubmitted, no print-code for SJG5137B)
Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Estimates on Parts

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount	
1	1		*REAR TAILGATE	By 0.00	0.00	*480.00 F	✓
2	1		*REAR TAILGATE WINDSCREEN MOULDING	Nu 0.00	0.00	*35.00 F	✓
3	1		*REAR WINDSCREEN	Shatter 0.00	0.00	*1,200.00 F	✓
4	1		*REAR TAILGATE LOGO	Nu 0.00	0.00	*15.00 F	✓
5	1		*REAR TAILGATE H EMBLEM PANEL	By 0.00	0.00	*160.00 F	✓
6	1		*REAR TAILGATE LOGO STREAM	Nu 0.00	0.00	*40.00 F	✓
7	1		*REAR TAILGATE RUBBER	Dis 0.00	0.00	*85.00 F	✓
8	1		*REAR BUMPER	By 0.00	0.00	*350.00 F	✓
9	1		*REAR BUMPER SIDE RETAINER LH	By 0.00	0.00	*18.00 F	X
10	1		*REAR BUMPER SIDE RETAINER RH	By 0.00	0.00	*18.00 F	X
11	1		*REAR END PANEL TOP GARNISH	Nu 0.00	0.00	*90.00 F	✓
12	1		*REAR END PANEL INNER	R 0.00	0.00	*95.00 F	X
13	1		*REAR END PANEL OUTER	By 0.00	0.00	*200.00 F	✓
14	1		*TOWING COVER	By 0.00	0.00	*12.00 F	X
15	1		*SPARE TYRE BRACKET	R 0.00	0.00	*80.00 F	X
16	1		*EXHAUST BOX MOUNTING	By 0.00	0.00	*10.00 F	X
17	1		*SPARE TYRE FLOOR PANEL	R 0.00	0.00	*600.00 F	X
18	1		*REAR WIPER ARM WITH BLADE	mi 0.00	0.00	*45.00 F	✓
19	1		*REAR WIPER MOTOR	By 0.00	0.00	*180.00 F	X

F=Franchise part.

Sub Total (S\$)	3,713.00
+ Margin on L,N Items 10.00% (S\$)	371.30
Total Parts (S\$)	4,084.30

Report was unsubmitted during this print-out.
 Generated using Merimen e-Claims IEAS

Estimates on Miscellaneous Items

No Qty Particulars

Amount

Miscellaneous Items

1	1	REAR BUMPER CLIPS	na	35.00	✓
2	1	REAR END PANEL TOP GARNISH CLIPS	na	35.00	✓
3	2	REAR FENDER INNER SHIELD CLIPS	na	140.00	X
4	1	REAR NUMBER PLATE WITH FRAME	na	50.00	X
5	1	REAR TAILGATE GLASS SEALANT	na	80.00	
6	1	REAR TAILGATE INNER BOARD CLIPS	na	35.00	✓
7	1	REVERSE SENSOR SET	na	350.00	
Sub Total (S\$)				725.00	

Estimates on Labour

No Particulars

Lab.Type

Amount

Labour Items

1	SPRAY PAINT ON ALL AFFECTED AREA	New	6801	1,000.00	
2	LABOUR REMOVE/REFIX ACCIDENT DAMAGE PARTS TO KNOCK, JACK, CUT WELD AND REALIGN ACCIDENT AFFECTED AREA	New		1,200.00	6001
3	TO CHECK WIRING SYSTEM & LIGHT	New	201	120.00	
4	ANTI RUST TREATMENT	New	7	120.00	601
5	TO CHECK & ADJUST WHEEL ALIGNMENT	New	na	120.00	X
6	TO REMOVE/REFIX/REPLACE REAR REVERSE CAMERA	New	501	150.00	
7	TO REMOVE/REFIX/REPLACE REAR TAILGATE INNER COMPARTMENT, WIPER MOTOR, TOP SPOILER, MECHMISM TO NEW TAILGATE	New	601	200.00	
8	TO REMOVE/REPLACE REAR TAILGATE GLASS	New	1201	150.00	
9	TO REMOVE/REFIX REVERSE SENSOR	New	502	150.00	
Gross Labour Cost (S\$)				3,210.00	

Report was unsubmitted during this print-out.
Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: