

ASS. REC. BY:

REF:

AG / 23004206 / Ky

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

Trans Cab

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

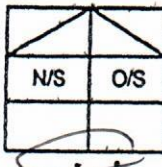

Bal. or Market Value:

IDAC Accident Rpt: Consistent? : Yes or No

GIA / PR Seen: Consistent? : Yes or No

Est. Repairs: 02 days Res.: Yes or No

Lum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

PHD 53847

Yr Regn:

01, 19

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Toyota Prius

c.c.

1700

Colour

M.P. White / R

A/C:

Insured / Std / NI / NA

Sp. Reading

573783

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

JTDKBB3FUX03078928

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Mod: NII / S/Rim / STD / R/Rim or

Tyre Size:

F:

195/65R15

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Greenlander

Front

Rear

R/Bal.

9

mm

R/Bal.

5

mm

L/Bal.

9

mm

L/Bal.

5

mm

D.O.A.

14/4/23

D.O.I.

17/4/2023

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

14/5 11Pm @ 2000h Caber

Date/Time, File Pass to?

☐

Prel. Report

1)

☐

Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trlp:

Survey Fee:

Transportation:

S - RS - SI

P. m/s

Others

TOTAL

Report Format :

Lump Sum / I.B.I. (\$) 1

Add Fee:

☐

Site Insp (\$

☐

Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Not Notarized
11 Pny @ 2000p

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel Nc Fax No. : 62571330

CO./ GST Reg. No. 201019626G

SHD5384T

AAD2304-

Vehicle No.:

Chassis No.:

Co UEN.:

Vehicle Make:

Vehicle Model:

Date of Accident:

Third Party Insurer:

Date of Registration:

17 APR 2023

SHD5384T

JTDKB3FUX03078928

200303878K

TOYOTA

PRIUS

14/4/2023

SDX6690U/AIG

11/1/2019

PART

LIST

- 1 COVER, REAR BUMPER
- 1 COVER, REAR BUMPER, LOWER
- 1 GUARD, REAR BUMPER, CENTER
- 1 SEAL, REAR BUMPER SIDE, LH
- 1 SEAL, REAR BUMPER SIDE, RH
- 1 FILLER, REAR BUMPER EXTENSION, RH
- 1 FILLER, REAR BUMPER EXTENSION, LH
- 1 RETAINER, REAR BUMPER SIDE, LH
- 1 RETAINER, REAR BUMPER SIDE, RH
- 1 REINFORCEMENT SUB-ASSY, REAR BUMPER
- 1 COVER, FLOOR UNDER, RH
- 1 COVER, FLOOR UNDER, LH
- 1 COVER, REAR FLOOR
- 1 COVER, DECK TRIM, REAR
- 1 PAN, REAR FLOOR
- 1 PANEL SUB-ASSY, BODY LOWER BACK
- 1 LENS & BODY, REAR COMBINATION LAMP, LH
- 1 LENS AND BODY, REAR LAMP, LH
- 1 COVER, REAR COMBINATION LAMP, LH
- 1 LENS & BODY, REAR COMBINATION LAMP, RH (UPPER)
- 1 LENS AND BODY, REAR LAMP, RH
- 1 COVER, REAR COMBINATION LAMP, RH
- 1 PANEL SUB-ASSY, BACK DOOR
- 1 STAY ASSY, BACK DOOR, LH
- 1 STAY ASSY, BACK DOOR, RH
- 1 HINGE ASSY, BACK DOOR, LH
- 1 HINGE ASSY, BACK DOOR, RH
- 1 GARNISH SUB-ASSY, BACK DOOR, OUTSIDE
- 1 PLATE, LUGGAGE COMPARTMENT DOOR NAME, NO.2
- 1 PLATE, BACK DOOR NAME, NO.1

\$	Bu	558.39	✓
\$	Ca	19.43	✓
\$	Not 10/1	726.92	✓
\$	Sm	111.41	X
\$	Sm	111.41	X
\$	Sm	155.72	X
\$	Sm	155.72	X
\$	Sm	147.11	X
\$	Sm	148.58	X
\$	Sm	419.90	✓
\$	Sm	220.50	X
\$	Sm	304.92	X
\$	Sm	290.43	X
\$	Sm	159.39	X
\$	Sm	734.90	X
\$	Sm	824.46	X
\$	Sm	559.13	} X
\$	Sm	634.73	
\$	Sm	81.48	
\$	Sm	570.15	
\$	Sm	634.73	
\$	Sm	81.48	
\$	Sm	1,443.86	
\$	Sm	305.66	}
\$	Sm	305.66	
\$	Sm	77.18	
\$	Sm	77.18	}
\$	Sm	1,171.38	
\$	Sm	68.88	
\$	Sm	68.88	✓

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No Fax No. : 62571330

CO./ GST Reg. No. 201019626G

SHD5384T

- 1 ORNAMENT SUB-ASSY, BACK DOOR

AAD2304-

	\$	<i>Mr</i> 90.30 ✓
TOTAL	\$	11,259.81
25%	\$	2,814.95
	\$	8,444.85

SPECIAL NETT**1SET PARKING AID**

- 1 REAR BUMPER CLIP
 1 BOOT STICKER TRANSCAB
 1 BOOT STICKER TEL NO.
 1 REAR LH BUMPER RETAINER CLIP
 1 REAR RH BUMPER RETAINER CLIP
 1 END PANEL INNER TRIM CLIP
 1 REAR BUMPER PROTECTOR
 2 WINDSCREEN SEALANT
 1 WINDSCREEN MOULDING
 1 WINDSCREEN INNER SPONGE SEAL

	\$	<i>Per</i> 700.00 <i>2201a</i>
	\$	<i>Mr</i> 65.00 <i>601a</i>
	\$	<i>Mr</i> 100.00 <i>301a</i> ✓
	\$	<i>Mr</i> 100.00 <i>301a</i>
	\$	<i>nn</i> 65.00 X
	\$	<i>nn</i> 65.00 X
	\$	<i>nn</i> 60.00 X
	\$	<i>nlp</i> 180.00 X
	\$	<i>nn</i> 150.00 X
	\$	<i>nn</i> 200.00 X
	\$	<i>nn</i> 130.00 X
TOTAL	\$	1,815.00
TOTAL PARTS	\$	10,259.85

LABOUR

To rust-proofing of the affected areas.

\$ *nn* 600.00 X

Putty and spray painting of the affected portion.

\$ 1,200.00 *4401*

Panel beating, knocking and straightening the necessary portion, remove and renewal of parts, adjust and realign the same

\$ 2,000.00 *2001*

To transfer of tailgate fittings and conduct water seepage test.

\$ *nn* 170.00 X

To remove and refit interior fittings, trimmings, garnish, fittings and other, to enable repair.

\$ *nn* 380.00 X

To Remove And Refit Rear W/Screen Glass To Facilitate Bodywork Repair.

\$ *nn* 170.00 X

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel Nc Fax No. : 62571330

CO./ GST Reg. No. 201019626G

SHD5384T**AAD2304-**

To transfer of tailgate fittings and conduct water seepage test.

\$ *nn* 170.00 *X*

To transfer of bootlid fittings, attachments and perform water seepage test.

\$ *h* 170.00 *X*

To reinstall rear bumper parking sensor.

\$ 170.00 *501*

To check steering geometry and computer wheel alignment

\$ *h* 220.00 *X*

To Transfer Of Fender Fittings, Attachments And Perform Water Seepage Test.

\$ *h* 170.00 *X***TOTAL \$ 5,420.00****OVERALL TOTAL \$ 15,679.85***2 days***LKK Auto Consultants** hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

[> Back to OneMotoring](#)

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:	Company
Owner ID:	878K

Vehicle Details

Vehicle No.:	SHD5384T
Vehicle to be Exported:	Yes
Intended Deregistration Date:	14 Apr 2023
Vehicle Make:	TOYOTA
Vehicle Model:	PRIUS 5DR HATCHBACK (AUTO)
Primary Colour:	Red
Manufacturing Year:	2018
Engine No.:	2ZR2B96605
Chassis No.:	JTDKB3FUX03078928
Maximum Power Output:	90.0 kW (120 bhp)
Open Market Value:	\$26,605.00
Original Registration Date:	11 Jan 2019
First Registration Date:	11 Jan 2019
Transfer Count:	0
Actual ARF Paid:	\$14,247.00

Intended PARF Rebate Details

PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	10 Jan 2027
PARF Rebate Amount:	\$10,685.00

Intended COE Rebate Details

COE Expiry Date:	10 Jan 2027
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	8
PQP Paid:	\$20,838.00
COE Rebate Amount:	\$9,739.00
Total Rebate Amount:	\$20,424.00

Message

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 14 Apr 2023

OK