

ASS. REC. BY:

REF:

TV / 23004403/Ky

C

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

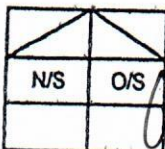
Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

10.30am

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.Bal. or Market Value: \$229k

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 06 days Res.: Yes or NoLum Sum: 1.51 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SNC 8138C Yr Regn: 11, 21Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or _____

Make: Testa Model 13 C.C. _____Colour: Black A/C: Insured / Std / NI / NASp. Reading: 20885 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: LRW3F7FA9MC 385502Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orModl: Nil / S/Rim / STD A/Rim orTyre Size: F: 235/45 ZR18

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front _____ Rear _____

R/Bal. 7 mm R/Bal. 7 mmL/Bal. 7 mm L/Bal. 7 mmD.O.A. 28/4/23 D.O.I. 28/4/2023

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

C/S Rea

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

14/6 @ 5944.94 C/S Rea

Date/Time, File Pass to?

☐ : Prel. Report

Days Of Repair: _____

1)

☐ : Final Report

Resurvey No. of Trip: _____

Date/Time, File Return to?

2)

Survey Fee: _____

Transportation: _____

Add Fee: ☐ : Site Insp (\$ _____)☐ : Interview (\$ _____)☐ : Tech Invs (\$ _____)☐ : Weekend (\$ _____)

), Fines

), Others

TOTAL

Report Format :

Lump Sum / I.B.I. (\$ _____)

Date: 26/04/2023

Vehicle No: SNC8138C

Model: TESLA MODEL 3 STANDARD RANGE

Chassis: LRW3F7FA9MC385502-2021

Reg.Year: 2021

Third Party Insurer: INDIA INSURANCE

Third Party Veh No: XE1404B

Date of Accident: 26/04/2023

Estimator: TING AN

Surveyor:

Not Notation
Minor B&Paint
6 days

ESTIMATE

NO.	DESCRIPTION	QTY	UNIT S\$	AMOUNT S\$
1	REAR DOOR RH	1		<i>Rh</i> \$953.27
2	REAR DOOR WEATHERSTRIP RH	1		<i>Rh</i> \$88.79
3	REAR DOOR INNER TRIM BOARD RH	1		<i>Rh</i> \$560.75
4	REAR DOOR REGULATOR RH	1		<i>Rh</i> \$219.63
5	REAR FENDER RH	1		<i>Rh</i> \$1,345.79
6	REAR FENDER QUARTER GLASS RH	1		<i>Rh</i> \$280.37
7	REAR RIM RH	1		<i>Rh</i> \$505.00
8	REAR RIM COVER RH	1		<i>Rh</i> \$32.71
9	REAR BUMPER	1		REPAIR
SUB TOTAL				\$3,986.31
COST +10%				\$398.63
PARTS TOTAL				\$4,384.94

NO.	SPECIAL NETT	QTY	UNIT S\$	AMOUNT S\$
1	REAR DOOR INNER TRIM BOARD CLIPS RH	1		<i>Rh</i> \$50.00
2	REAR FENDER QUARTER GLASS SEALANT	1		<i>Rh</i> \$80.00
3	REAR TYRE RH	1		<i>Rh</i> \$450.00
S/N TOTAL				\$580.00

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Head office

6 Kung Chong Road Singapore 159143
Tel: (+65) 6472 1313 | Fax: (+65) 6472 2112

Branch

9A Serangoon North Ave 5 Singapore 554500
Tel: (+65) 6484 9919 | Fax: (+65) 6481 1993

Branch (Motor Insurance Claims)

Blk 10 Ang Mo Kio Ind. Park 2A #01-05 Singapore 568047
Tel: (+65) 6481 1522 | Fax: (+65) 6481 1011



Date: 26/04/2023
 Vehicle No: SNC8138C
 Model: TESLA MODEL 3 STANDARD RANGE
 Chassis: LRW3F7FA9MC385502-2021
 Reg.Year: 2021

Third Party Insurer: INDIA INSURANCE
 Third Party Veh No: XE1404B
 Date of Accident: 26/04/2023
 Estimator: TING AN
 Surveyor:

LABOUR CHARGES:

LABOUR CHARGES TO REMOVE, REPLACE, REFIX, REPAIR & READJUST REAR ACCIDENT AREAS & ETC.

700
\$800.00

LABOUR CHARGES FOR PAINTING & TO SUPPLY PAINT & FURNISHING MATERIALS AT REAR DOOR RH, REAR FENDER RH, REAR BUMPER & ETC.

500
\$800.00

LABOUR CHARGES TO REMOVE & REPLACE REAR QUARTER GLASS RH, REAR QUARTER GLASS SEALANT & ETC. TO EFFECT REPLACE OF REAR FENDER RH.

150
\$150.00

LABOUR CHARGES TO REMOVE & REFIX REAR FENDER INNER TRIM RH, UPHOLDSTERY CUSHION SET & ETC. TO EFFECT REPLACE OF REAR FENDER RH.

120
\$350.00

LABOUR CHARGES TO REMOVE & REPLACE REAR RIM RH.

20
\$120.00

TO WHEEL ALIGNMENT & BALANCING.

80
\$80.00

TO TUFF KOTE & UNDERSEAL MATERIALS.

150
\$150.00

TO CHECK WIRING & ELECTRICAL SYSTEM.

120
\$120.00

LABOUR TOTAL \$2,570.00

TING AN

TOTAL \$7,534.94

Head office

6 Kung Chong Road Singapore 159143

Tel: (+65) 6472 1313 | Fax: (+65) 6472 2112

Branch

9A Serangoon North Ave 5 Singapore 554500

Tel: (+65) 6484 9919 | Fax: (+65) 6481 1993

Branch (Motor Insurance Claims)

Blk 10 Ang Mo Kio Ind. Park 2A #01-05 Singapore 568047

Tel: (+65) 6481 1522 | Fax: (+65) 6481 1011



[> Back to OneMotoring](#)

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	193D
Vehicle Details	
Vehicle No.:	SNC8138C
Vehicle to be Exported:	No
Intended Deregistration Date:	27 Apr 2023
Vehicle Make:	TESLA
Vehicle Model:	MODEL 3 STANDARD RANGE
Primary Colour:	Black
Manufacturing Year:	2021
Engine No.:	-
Chassis No.:	LRW3F7FA9MC385502
Maximum Power Output:	239.0 kW (320 bhp)
Open Market Value:	\$59,432.00
Original Registration Date:	17 Nov 2021
First Registration Date:	17 Nov 2021
Transfer Count:	0
Actual ARF Paid:	\$33,978.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	16 Nov 2031
PARF Rebate Amount:	\$25,483.00
Intended COE Rebate Details	
COE Expiry Date:	16 Nov 2031
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$80,210.00
COE Rebate Amount:	\$68,621.00
Total Rebate Amount:	\$94,104.00

The information contained herein is correct as at 26 Apr 2023

OK