

ASS. REC. BY:

REF: INC/ 23004598/Kqy3

C

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s SMRT

of _____

Insured: _____

Policy No. _____

Claims No. _____


Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

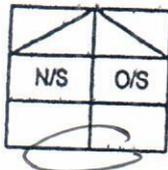

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 03 days Res.: Yes or No

Lum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: SHD 61885 Yr Regn: 11, 17

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Traller or

Make: Toy Prius C.C. 1798

Colour: M. Brown A/C: Insured / Std / NI / NA

Sp. Reading: 489061 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: JTDKB3FU X03574019

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Mod: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 195/65R15

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Pailun

Front R/Bal. 8 mm

L/Bal. 8 mm

D.O.A. 4/5/23

Survey held at _____

Des. of Damages: Rear / O/S / N/S / UIC / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
<u>6/6</u>	<u>21 Rm @ 2400L Car m/crd @ 1195.98, 83%</u>

Date/Time, File Pass to? : Prell. Report : Final Report

Days Of Repair: 4
Resurvey No. of Trip: 2

Add Fee: : Site Insp (\$)
 : Interview (\$)
 : Tech Invs (\$)
 : Weekend (\$)

Survey Fee:
Transportation:
S - RS. SI
Fees
Others
TOTAL

Report Format : TP
Lump Sum / I.B.I: (\$) 2400

TP

ARV L-4

R-4

66



SMRT Accident Vehicle Repair Estimates

SMRT Automotive Services Pte Ltd
60 Woodlands Industrial Park E4, Singapore 757705
FAX Number : 63685592
Estimator Telephone Number : 68662623
Accident Reporting Number : 68662672

Date Generated : 05/05/2023
 User ID : BoonChewTay

Section A - Accident Details

Registration Number	SHD6186S
Case Reference Number	TAX/05/23/2013
Registration Date	3/11/2017
Company Type	Strides Taxi Pte Ltd
Make	TOYOTA
Model	PRIUS4
Name of Driver	WONG CHONG PENG (HUANG ZHONGPING)
Type of Accident	Head To Side
Accident Date and Time	4/5/2023 9:24 PM
Accident Reported Date and Time	5/5/2023 9:55 AM
Surveyor Required?	No
Surveyed by	
Vehicle Towed Back?	No
Towed Back Date and Time	
Replacement Vehicle issued?	No
Job Card Number	24118341
Special Instruction to ARC, if any	REAR PORTION
Prepared Date and Time	5/5/2023 1:01 PM
Chassis Number	
Mileage	
Work Shop	
Repair Completion Date and Time	

Section B - Summary of Repair Estimates

Summary of Repair Estimates		
	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Cost	\$845.00	\$0.00
Total Spray Cost	\$1,636.00	\$0.00
Total Spare Part Cost	\$6,507.26	\$0.00
Total Other Cost	\$796.88	\$0.00
TOTAL COST	\$9,785.14	\$0.00
ump Sum Total	\$9,800.00	\$0.00
Number of Repair Days	8.0	3 days
Prepared / Adjusted By	Boon Chew Tay	
ARC / Surveyor Sign Off Date	05/05/2023 1:27 PM	
Signature	<input type="checkbox"/>	<input checked="" type="checkbox"/> Kenneth
Remarks		

Section C - Quotation and Accident Invoice Details

Quotation Number		Invoice Number	
Quotation Date		Invoice Date	
Invoice Amount		Prepared Date	

- LKK Auto Consultants** hence notify the Repairer of the following:
- To resurvey before/after spray painting
 - To display damaged part(s) during resurvey
 - Parts prices are subject to confirmation
 - Third party survey is on a "Without Prejudice" basis
 - No illegal modification(s) is allowed
 - Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

SMRT Accident Vehicle Repair Estimates

SMRT Automotive Services Pte Ltd
60 Woodlands Industrial Park E4, Singapore 757705
FAX Number : 63685592
Estimator Telephone Number : 68662623
Accident Reporting Number : 68662672

Date Generated : 05/05/2023

User ID : BoonChewTay

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from AR	Adjusted by Surveyor, if applicable
O REPAIR REAR PORTION	\$845.00 <i>200L</i>	
Total Labour	\$845.00	

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
O RESPRAY REAR BUMPER	\$378.00 <i>200L</i>	
O RESPRAY REAR PANEL	\$220.00 <i>NR 250L X</i>	
O RESPRAY BUMPER BEAM	\$220.00 <i>NR X</i>	
O RESPRAY TAIL GATE	\$378.00 <i>X</i>	
O RESPRAY TAILGATE OUTSIDE GARNISH	\$220.00 <i>150L</i>	
O RESPRAY REAR SPARE TYRE PANEL	\$220.00 <i>X</i>	
Total Spray Painting & Panel Beating	\$1,636.00	

Part 3 - Other Costs - Accident and Accident Repair Related Expense

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
O WASH AND VACUUM	\$60.00 <i>X</i>	
O CHECK WIRING AND SYSTEM FUNCTION	\$120.00 <i>20L</i>	
O APPLY RUST-PROOFING ON AFFECTED AREA	\$100.00 <i>X</i>	
O TEST AND REFIX REVERSE SENSOR SYSTEM	\$120.00 <i>30L</i>	
O REPLACE SUNDRY PARTS	\$100.00 <i>X</i>	
O PROVIDE LABOUR & MATERIAL FOR ADVERTISEMENT STICKER (NET)	\$296.88 <i>✓</i>	
Total Other Costs	\$796.88	

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Approved
		5215947913	COVER, RR BUMPER ASSY	1.00	\$478.90	25.00	\$359.17	Replace <i>359.18</i>	<i>BT ✓</i>
		5202347030	REAR BUMPER REINFORCEMENT	1.00	\$360.10	25.00	\$270.08	Replace	<i>BT ✓ X SVC</i>
		5246247030	PAD, RR BUMPER, RH & LH, 1	2.00	\$4.30	25.00	\$6.45	Replace	<i>NR ✓</i>
		5246247020	PAD, RR BUMPER, RH & LH, 2	2.00	\$4.30	25.00	\$6.45	Replace	<i>NR ✓</i>
		5246247010	PAD, RR BUMPER, RH & LH, 3	2.00	\$4.30	25.00	\$6.45	Replace	<i>NR ✓</i>
		5246147010	PAD, RR BUMPER, CTR	3.00	\$2.50	25.00	\$5.63	Replace	<i>NR ✓</i>
		5219147030	SEAL, RR BUMPER ARM, RH & LH	1.00	\$12.30	25.00	\$9.23	Replace	<i>NR ✓</i>
		5259968030	STOPPER, RR BUMPER, RH & LH	1.00	\$4.80	25.00	\$3.60	Replace	<i>NR X</i>
		5257547040	RETAINER, RR BUMPER, RH	1.00	\$127.40	25.00	\$95.55	Replace	<i>NR X</i>
		5257647040	RETAINER, RR BUMPER, LH	1.00	\$127.40	25.00	\$95.55	Replace	<i>NR X</i>
		5259147050	SEAL, RR BUMPER, RH	1.00	\$95.50	25.00	\$71.63	Replace	<i>NR X</i>
		5259247040	SEAL, RR BUMPER, LH	1.00	\$95.50	25.00	\$71.63	Replace	<i>NR X</i>
		5216116010	CLIPS PIECE, FRT & RR BUMPER	10.00	\$4.80	25.00	\$36.00	Replace	<i>NR ✓</i>
		5245347010	GUARD, RR BUMPER, LOWER	1.00	\$623.50	25.00	\$467.63	Replace	<i>BT ✓</i>
		5256547900	FILLER, RR BUMPER, RH	1.00	\$168.60	25.00	\$126.45	Replace	<i>NR X</i>
		5256647900	FILLER, RR BUMPER, LH	1.00	\$168.60	25.00	\$126.45	Replace	<i>NR X</i>

SMRT Accident Vehicle Repair Estimates

SMRT Automotive Services Pte Ltd
60 Woodlands Industrial Park E4, Singapore 757705
FAX Number : 63685592
Estimator Telephone Number : 68662623
Accident Reporting Number : 68662672

Date Generated : 05/05/2023

User ID : BoonChewTay

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Approved
		5216947020	COVER, GUARD RR BUMPER LOWER	1.00	\$16.70	25.00	\$12.52	Replace	Sm X
			SENSOR REVERSE	1.00	\$180.00	0.00	\$180.00	Replace	Sm ✓
		8999730100	ANTENNA, ELECTRICAL KEY	1.00	\$78.00	25.00	\$58.50	Replace	Sm X
		9018906029	REAR BUMPER GROMMET SCREW	1.00	\$2.20	25.00	\$1.65	Replace	Sm X
		8155147281	LENS & BODY, REAR COMBINATION LAMP, RH	1.00	\$489.00	10.00	\$440.10	Replace	Sm X
		8156147151	LENS & BODY, REAR COMBINATION LAMP, LH	1.00	\$489.00	10.00	\$440.10	Replace	Sm X
		8158147010	LENS & BODY ASSY, RR BUMPER, RH	1.00	\$544.40	10.00	\$489.96	Replace	Sm X
		8159147010	LENS & BODY ASSY, RR BUMPER, LH	1.00	\$544.40	10.00	\$489.96	Replace	Sm X
		8149747020	COVER, REAR COMBINATION LAMP, RH	1.00	\$69.90	25.00	\$52.43	Replace	Sm X
		8149847020	COVER, REAR COMBINATION LAMP, LH	1.00	\$69.90	25.00	\$52.43	Replace	Sm X
		5839847050	COVER, REAR FLOOR UNDER, RH	1.00	\$189.20	25.00	\$141.90	Replace	Sm X
		5839947030	COVER, REAR FLOOR UNDER, LH	1.00	\$261.60	25.00	\$196.20	Replace	Sm X
		6625947010	COVER, REAR FLOOR UNDER CENTER	1.00	\$249.10	25.00	\$186.83	Replace	Sm ✓
		6700547440	TAIL GATE PANEL SUB-ASSY, BACK DOOR	1.00	\$1,238.40	25.00	\$928.80	Replace	Sm X
		6788147050	TAIL GATE WEATHERSTRIP, BACK DOOR	1.00	\$402.50	25.00	\$301.88	Replace	Sm X
		7680147110A1	TAIL GATE BACK DOOR OUTSIDE GARNISH SUB-ASSY	1.00	\$992.30	25.00	\$744.22	Replace	Sm X
		7544147090	NAME PLATE (HYBRID), LUGGAGE COMPARTMENT DOOR	1.00	\$59.10	25.00	\$44.33	Replace	Sm —
		7544247130	NAME PLATE (PRIUS), LUGGAGE COMPARTMENT DOOR	1.00	\$59.10	25.00	\$44.33	Replace	Sm —
		6935047050	TAIL GATE LOCK ASSY, BACK DOOR	1.00	\$505.50	10.00	\$454.95	Replace	Sm X
		6932147010	TAIL GATE LOCK COVER, BACK DOOR	1.00	\$32.70	25.00	\$24.53	Replace	Sm X
		7540348010	EMBLEM SUB-ASSY REAR	1.00	\$77.40	25.00	\$58.05	Replace	Sm ✓
			STRIDES LOGO	1.00	\$7.80	0.00	\$7.80	Replace	Sm ✓
			STICKER DECAL 6555 8888	1.00	\$21.60	0.00	\$21.60	Replace	Sm ✓
		5830747090	END PANEL SUB-ASSY, BODY LOWER BACK	1.00	\$707.10	25.00	\$530.33	Replace	Sm X
		5831147130	SPARE TYRE PANEL, PAN, REAR FLOOR	1.00	\$630.30	25.00	\$472.72	Replace	Sm X
			SEALANT SIKAFLEX	1.00	\$37.00	0.00	\$37.00	Replace	Sm X
total					\$10,237.00		\$8,171.07		

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Stock Number	Part Name	Quantity	List Price \$	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check
total									


REQUEST FOR SUPPLYMENT PARTS

Contractor:	WEGA ENGINEERING PTE LTD		
Accident Case Number	TAX/05/23/2013	Date of Collection	9/15/23
Vehicle No	SHD 6186 S	Date of Request	9/15/23
Vehicle Model	TOYOTA PRIUS 4	Number of Days to Extend (If any)	1 day

S/N	Part Number	Part Description	Quantity	Unit Price
	2827, 28, 29	Rear Bumper Reinforcement	121	\$ 360.10 ✓
	2830, 31, 32	Cover Rear Floor Under Centre	CM	\$ 249.10 ✓
		TO Respray End Panel		\$ 220.00 15%
	2833, 34, 35, 36	TO Request Labour For Repair		
		The Accident Puriton End panel,		
		Spare Tyre panel, Rear Tail Gate The		
		Labour Is To Low		\$ 500.00 25%

<<<Please submit photographs for damaged parts>>>

I, (Name) CHIA
 (Position) _____

Do solemnly and sincerely declare that: Supplementary Parts are raised for replacement for the aforesaid vehicle.
  Signature of person making this declaration
 [To be signed in front of an authorised witness]

I acknowledge that this declaration is true and correct, and I make it with the understanding and belief that a person who makes a false declaration is liable to the damages of perjury.

For SMRT Staff		
Acknowledge By	ARC Executive / Supervisor / SA	
Approval By	Surveyor / In-house Staff	
Parts Ordering	SMRT Store / Contractor Supply / Form 22 / WOC	Form22 / PO / WOC/ Reservation / Number
Photo Submitted	YES / NO	Date of submission