

(02/11/13) wef  
ASS. REC. BY: Marcus

REF:

CS/6123004931/49

### ASSIGNMENT

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost:

☒ OD / ☐ TP / ☐ WS / ☐ TP RES / ☐ OD RES / ☐ EVA / ☐ INV / ☐ MV

To Inspect Vehicle No: GBJ 1345Y  
at Workshop m/s Sme 11am

of \_\_\_\_\_

Insured: \_\_\_\_\_

Policy No. \_\_\_\_\_

Claims No. \_\_\_\_\_

Sum Insured: \_\_\_\_\_ Excess: 350

(Client's Record)

Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its  
repair at the time of inspection.

|     |     |
|-----|-----|
|     |     |
| N/S | O/S |
|     |     |

Bal. or Market Value: 87216

IDAC Accident Rpt: \_\_\_\_\_ Consistent?: Yes or No

GIA / PR Seen: \_\_\_\_\_ Consistent?: Yes or No

Est. Repairs: \_\_\_\_\_ days Res.: Yes or No

Lum Sum: \_\_\_\_\_ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

C 100C

Vehicle: IN / OUT

Date: \_\_\_\_\_ Person Contacted: 21A513323

Veh No: GBJ 1345Y Yr Regn: 09/01/19

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or CM

Make: Toyota Dyno c.c. 2982

Colour: Silver A/C: Insured / Std / NI / NA

Sp. Reading: 235611 T/Radio: Insured / Std / NI / NA

Eng/No: \_\_\_\_\_

C/No: JTFAT35440K2/2259

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: \_\_\_\_\_

R: 195-215  
155-212 hab, lead

BS / DUN / EXNOVA / GY / FS / LZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or \_\_\_\_\_

Front

R/Bal. 72 mm

L/Bal. 72 mm

D.O.A. 10/05/23

Survey held at \_\_\_\_\_

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Frt

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction Dep 13/11

partic bold

repairer want 2/p repair because no 2nd hand parts only few item

Date/Time, File Pass to?

☐ : Preli. Report

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Add Fee: ☐ : Site Insp (\$ \_\_\_\_\_)

Transportation:

☐ : Interview (\$ \_\_\_\_\_)

Photos

☐ : Tech. Invs (\$ \_\_\_\_\_)

Others

☐ : Weekend (\$ \_\_\_\_\_)

TOTAL

Report Format :

Lump Sum / I.B.I: (\$ \_\_\_\_\_)

1)

Date/Time, File Return to?

2)

☐ : Final Report

> Back to OneMotoring

## Enquire PARF/COE Rebate for Registered Vehicle

|                                     |                         |
|-------------------------------------|-------------------------|
| <b>Vehicle Owner Particulars</b>    |                         |
| Owner ID Type:                      | Company                 |
| Owner ID:                           | 100C                    |
| <b>Vehicle Details</b>              |                         |
| Vehicle No.:                        | GBJ1345Y                |
| Vehicle to be Exported:             | No                      |
| Intended Deregistration Date:       | 17 May 2023             |
| Vehicle Make:                       | TOYOTA                  |
| Vehicle Model:                      | DYNA 150 5MT            |
| Primary Colour:                     | Silver                  |
| Manufacturing Year:                 | 2018                    |
| Engine No.:                         | 1KD2836991              |
| Chassis No.:                        | JTFAT35Y40K212259       |
| Maximum Power Output:               | -                       |
| Open Market Value:                  | \$27,082.00             |
| Original Registration Date:         | 09 Jan 2019             |
| First Registration Date:            | 09 Jan 2019             |
| Transfer Count:                     | 0                       |
| Actual ARF Paid:                    | \$1,355.00              |
| <b>Intended PARF Rebate Details</b> |                         |
| PARF Eligibility:                   | No                      |
| PARF Eligibility Expiry Date:       | -                       |
| PARF Rebate Amount:                 | \$0.00                  |
| <b>Intended COE Rebate Details</b>  |                         |
| COE Expiry Date:                    | 08 Jan 2029             |
| COE Category:                       | C - Goods Vehicle & Bus |
| COE Period(Years):                  | 10                      |
| PQP Paid:                           | \$23,613.00             |
| COE Rebate Amount:                  | \$13,323.00             |
| <b>Total Rebate Amount:</b>         | <b>\$13,323.00</b>      |

The information contained herein is correct as at 17 May 2023

OK

**Post an Advertisement**  
Sell it yourself! Advertise it at just  
**\$68 until it's SOLD!**

[Post an Ad](#)[Advertiser Login](#)[Ways of Selling](#)

Glc43 selling at \$29k/Year!



Full Agent Maintained 1 Owner  
Unit! Great Combination Of  
Comfort And Power!  
AutoPrestige Gallery StarAd

■ Free VICOM evaluation  
 ■ Free grooming and 6 months maintenance  
 ■ In-house workshop ensures quality service  
 ■ Member of SVTA and hire purchase association  
 ■ 100% deposit refund for unapproved loan

**YONG LEE SENG MOTOR PTE LTD**

Sort by   results/page

12 vehicles



Toyota Dyna

Any Category

Advanced Search



Search

|   | Make   | Model    | Price    | Depreciation | Reg Date    | Eng Cap  | Mileage   | Veh Type | Status    |
|---|--|----------|----------|--------------|-------------|----------|-----------|----------|-----------|
| Search Selection  | Toyota Dyna  |          | Any      | Any          | 2019        | Any      | Any       | Any      | Available |
|   | Toyota Dyna  | 150 3.0M | \$88,800 | \$14,080 /yr | 05-Sep-2019 | 2,982 cc | -         | Truck    | Available |
| <b>Fuel Type:</b> Diesel<br>10 feet lorry with box in excellent condition! All wear and tear replaced! No repair required! Catch this gem before it's gone! High trade in for your current vehicle! High loan available! Contact us now for a non obligatory consultation or book a viewing and test drive!<br>Lek Auto Pte Ltd<br>Posted: 17-May-2023  |  |          |          |              |             |          |           |          |           |
|   | Toyota Dyna  | 150 3.0M | \$91,800 | \$14,700 /yr | 14-Aug-2019 | 2,982 cc | -         | Truck    | Available |
| <b>Fuel Type:</b> Diesel<br>Beautiful white Toyota Dyna with tailgate for sale. Excellent condition. 100% loan available. Trade in welcome. Come view.<br>ABWIN (1994) Pte Ltd<br>Posted: 16-May-2023   |  |          |          |              |             |          |           |          |           |
|   | Toyota Dyna  | 150 3.0M | \$90,800 | \$14,130 /yr | 18-Oct-2019 | 2,982 cc | 65,090 km | Truck    | Available |
| <b>Fuel Type:</b> Diesel<br>Genuine Low Mileage With 1 Owner Only! Cheapest In The Market Come With Full Canopy! Paintwork Has Been Touch Up! Grab It Before Too Late! Call / WhatsApp Our Sales Personnel Contact Below For Further Discussion Or Viewing Now!<br>Car (S) Pte Ltd<br>Posted: 16-May-2023   |  |          |          |              |             |          |           |          |           |
|   | Toyota Dyna  | 150 3.0M | \$82,800 | \$14,540 /yr | 24-Jan-2019 | 2,982 cc | 52,490 km | Truck    | Available |
| <b>Fuel Type:</b> Diesel<br>1 owner! Low mileage clocked at only abt 12k a yr! Well maintained with regular servicing! Good paint-work! Well preserved Upholstery! comes in chekered plate deck! Don't miss out this high in demand truck! Bank and in-house loan available! Trade in welcome! Call us now!<br>Posted: 16-May-2023                      |  |          |          |              |             |          |           |          |           |
|   | <b>Increase Performance &amp; Air Flow To Engine</b><br>Air Storm EGR valve design Cool Air Intake System.<br>More info about this product |          |          |              |             |          |           |          |           |
|   | Toyota Dyna  | 150 3.0M | \$90,800 | \$14,070 /yr | 29-Oct-2019 | 2,982 cc | 85,151 km | Truck    | Available |
| <b>Fuel Type:</b> Diesel<br>LOW MILEAGE OF 85KM! Original upholstery! Clean Interior! Come with Freezer box for your Goods! Reliable Toyota Dyna with 3L engine! Come with warranty and free servicing. Flexible loan available. Trade in available. Whatsapp/Call our friendly salesman below to view thi...<br>Car (S) Pte Ltd<br>Posted: 15-May-2023 |  |          |          |              |             |          |           |          |           |
|   | Toyota Dyna  | 150 3.0M | \$88,800 | \$14,590 /yr | 17-Jun-2019 | 2,982 cc | 42,000 km | Truck    | Available |
| <b>Fuel Type:</b> Diesel<br>One Owner Only Due To Retention Number, We Provide Doorstep Viewing, Low Mileage, Canopy, Well-kept Condition, High Loan And Trade In Available, Call For Viewing And Test Drive, See To Believe!<br>Posted: 15-May-2023  |  |          |          |              |             |          |           |          |           |

[Compare](#)



SME Motor Pte Ltd  
1 Kaki Bukit Ave 6, BLK D, #02-15  
417883

Insurer Reference:  
Repairer Reference: 23/CN/OD-263 (05)  
Date calculated: 11/05/2023 1:17 PM

Full Report  
Registration: GBJ1345Y  
Printed: 11/05/2023 1:17 PM

Summary Information

|                        |                |                   |   |
|------------------------|----------------|-------------------|---|
| Claim Location:        | Singapore (SG) | Work Provider:    | China Taiping Insurance (Singapore) Pte Ltd |
| Printed by:            | Gary Seah      | Currency:         | SGD   |
| Claim Reference:       |                | Date of Incident: | 10/05/23                                    |
| Estimated Repair Time: |                | Hire Car Start:   |   |
| Actual Repair Days:    |                | Hire Car End:     |   |

Vehicle Details

|                       |                     |                  |              |
|-----------------------|---------------------|------------------|--------------|
| Vehicle Manufacturer: | TOYOTA              |                  |              |
| Model:                | DYNA                |                  |              |
| Sub Model:            | BASE MODEL          |                  |              |
| Model Sheet Number:   | 70 1C 01            |                  |              |
| Registration:         | GBJ1345Y            |                  |              |
| VIN number:           |                     |                  |              |
| Odometer:             |                     |                  |              |
| Model Specs           |                     |                  |              |
| PAINTED RAD GRILLE    | 4.0 LTR 73KW        | WHEELBASE 2525MM | STANDARD CAB |
| TWO COAT METALLIC     | PREPARE OFF VEHICLE |                  |              |

Not Authorized  
du  
tel: 62563561  
EX 1158 & 350  
5 days.  
try 2/5 &  
who photo taken early.

LKK Auto Consultants have notified the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer  
Signature:  
Date:


Vehicle Condition

Vehicle Status

Pre-Accident Damage:  
Date of Inspection:

Damage Areas

All ☐  
Underbody ☐

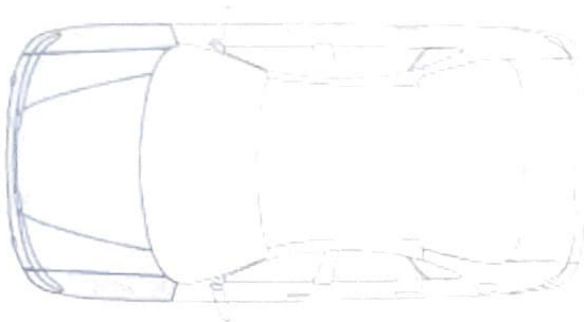

Tyres Condition

| Tyre Brand       | Tread (Left Middle), Tread (Left Outer), Tread (Left Inner), Tread (Right Inner),Tread (Right Outer),Tread (Right Middle), mm |    |    |    |    |    | Condition |
|------------------|---|----|----|----|----|----|-----------|
|                  | mm  | mm | mm | mm | mm | mm |           |
| Spare Tyre Brand | Tread (Spare), mm   |    |    |    |    |    |           |

Labour

| Code      | Description  | Time Base 10 WU/h | Price = 42.00 SGD/h |           |
|-----------|--|-------------------|---------------------|-----------|
|           |  |                   | WU                  | Price SGD |
| NO NUMBER | RENEW ENGINE COVER   | 60.0              |                     | 252.00    |
| NO NUMBER | R + R BADGE "DYNA"   | 2.0               |                     | 8.40      |
| 520011    | RENEW FRONT BUMPER   | 10.0              |                     | 42.00     |
|           | INCLUDES: R + R BUMPER AND NECESSARY ATTACHED PARTS              |                   |                     |           |
| 751011    | R + R RADIATOR GRILLE  | 3.0               |                     | 12.60     |
| 810051)   | R + R L/HEADLAMP   | 1.0               |                     | 4.20      |
|           | (RADIATOR GRILLE REMOVED)  |                   |                     |           |
|           | DOES NOT INCLUDE: ADJUST HEADLAMP                                |                   |                     |           |
| 810051)   | R + R R/HEADLAMP   | 1.0               |                     | 4.20      |
|           | (RADIATOR GRILLE REMOVED)  |                   |                     |           |
|           | DOES NOT INCLUDE: ADJUST HEADLAMP                                |                   |                     |           |
| 810151A   | ADJUST HEADLAMPS   | 3.0               |                     | 12.60     |
| 554011)   | R + R WINDSCREEN   | 30.0              |                     | 126.00    |
|           | INCLUDES: R + R SUN VISORS, UPPER FRONT PANEL AND A-PILLAR TRIMS |                   |                     |           |
| 670051)   | R + R LEFT FRONT DOOR  | 3.0               |                     | 12.60     |
| 670051)   | R + R RIGHT FRONT DOOR   | 3.0               |                     | 12.60     |

| Code                             | Description                              | WU                 | Price SGD |
|----------------------------------|--|--------------------|-----------|
| NO NUMBER                        | R + R FRONT CROSSMEMBER                  | 25.0               | 105.00    |
| 743201)                          | DETACH + REFIT HEADLINING                | 4.0                | 16.80     |
| 883621)                          | R + R HEATING CPL                        | 21.0               | 88.20     |
| 870151)                          | R + R HEATER BLOWER                      | 4.0                | 16.80     |
| 550451)                          | R + R INSTRUMENT PANEL                   | 9.0                | 37.80     |
| NO NUMBER                        | R + R INSTRUMENT PANEL CARRIER (REMOVED) | 2.0                | 8.40      |
| 850161)                          | R + R WIPER MOTOR (WIPER UNIT REMOVED)   | 7.0                | 29.40     |
| NO NUMBER                        | R + R AIR FILTER HOSE                    | 1.0                | 4.20      |
| NO NUMBER                        | DRAIN + REFILL COOLANT                   | 3.0                | 12.60     |
| 461201)                          | R + R BRAKE FLUID RESERVOIR              | 2.0                | 8.40      |
| 442151 ZAX                       | R + R STEERING COLUMN ASSY               | 4.0                | 16.80     |
| 441101                           | R + R STEERING WHEEL                     | 4.0                | 16.80     |
| NO NUMBER                        | DETACH + REFIT STEERING COLUMN           | 2.0                | 8.40      |
| 1482                             | RIGHT FRONT DOOR REPAIR                  | 5.0*               | 21.00 ✓   |
| <b>Labour Cost</b>               |  |                    |           |
| <b>Panel / Mechanical Labour</b> |  | Hrs 20.90 WU 209.0 | 877.80    |
| <b>Total of Labour</b>           |  |                    | 877.80    |

Paint

| Paint Work |                                       | SYSTEM AZT | Time Basis 10 WU/h |           |
|------------|---------------------------------------|------------|--------------------|-----------|
| Code       | Description - TWO COAT METALLIC       |            | WU                 | Price SGD |
|            | L/F BUMPER BRACKET NEW PART PAINTING  |            | 6.0                |           |
|            | R/F BUMPER BRACKET NEW PART PAINTING  |            | 6.0                |           |
|            | ENGINE FIREWALL NEW PART PAINTING     |            | 30.0               |           |
|            | OUTER ENG FIREWALL NEW PART PAINTING  |            | 8.0                |           |
|            | FRONT CROSSMEMBER SURFACE PAINT       |            | 5.0                |           |
|            | FRONT BUMPER NEW PART PAINT K1R       |            | 7.0                |           |
|            | GRILLE NEW PART PAINT K1R             |            | 5.0                |           |
|            | RIGHT FRONT DOOR REPAIR PAINTING <50% |            | 17.0               |           |

Paint Material Per Part

| Code | Description                           | Price SGD |
|------|---------------------------------------|-----------|
| 0293 | L/F BUMPER BRACKET NEW PART PAINTING  | 1.55      |
| 0294 | R/F BUMPER BRACKET NEW PART PAINTING  | 1.55      |
| 0413 | ENGINE FIREWALL NEW PART PAINTING     | 41.25     |
| 0418 | OUTER ENG FIREWALL NEW PART PAINTING  | 10.32     |
| 3010 | FRONT CROSSMEMBER SURFACE PAINT       | 4.98      |
| 0281 | FRONT BUMPER NEW PART PAINT K1R       | 26.57     |
| 0410 | GRILLE NEW PART PAINT K1R             | 11.81     |
| 1482 | RIGHT FRONT DOOR REPAIR PAINTING <50% | 28.75     |

| Labour Cost - Paint            |                | Hrs          | WU           | Price SGD     |
|--------------------------------|----------------|--------------|--------------|---------------|
| Factor                         | 42.00 SGD/h    |              | 84.0         |               |
| Time Paint                     |                | 2.50         | 25.0         | 105.00        |
| Preparation Main Work Metal    |                | 0.50         | 5.0          | 21.00         |
| Preparation Comp. Work Plastic |                |              |              |               |
| <b>Total</b>                   | <b>10 WU/h</b> | <b>11.40</b> | <b>114.0</b> | <b>478.80</b> |



**Material Cost - Paint**

|                                     |
|-------------------------------------|
| New Part Painting                   |
| New Part Painting - Plastic K1R     |
| Repair Painting                     |
| Surface-/Blend Paint                |
| Material-constant Metal Preparation |
| Material-constant Plastic           |
| <b>Total</b>                        |

|                  |
|------------------|
| <b>Price SGD</b> |
| 54.67            |
| 38.38            |
| 28.75            |
| 4.98             |
| 28.60            |
| 9.00             |
| 164.38           |

**Spare Parts**

| Code             | Description         | Part Number   | Part Source | prices as at 2015-06-01/01 |                 |
|------------------|---------------------|---------------|-------------|----------------------------|-----------------|
|                  |                     |               |             |                            | Price SGD       |
| 0281             | FRONT BUMPER        | 52111 37301   | Original    | DD/2e                      | 320.00          |
| 0293             | L/F BUMPER BRACKET  | 52012 37033   | Original    | n1                         | 160.00          |
| 0294             | R/F BUMPER BRACKET  | 52011 37034   | Original    |                            | 160.00          |
| 0410             | GRILLE              | 53111 37A01A0 | Original    | cur/cu                     | 235.00          |
| 0413             | ENGINE FIREWALL     | 55700 37440   | Original    | DD                         | 480.00          |
| 0418             | OUTER ENG FIREWALL  | 55078 37120   | Original    | Buy                        | 225.00          |
| 0428             | CLIP FASTENING      | 90467 W0009   | Original    | neu                        | 30.00           |
| 0431             | BADGE               | 75315 37080   | Original    | neu                        | 55.00           |
| 0433             | BADGE MODEL         | 75311 37160   | Original    | neu                        | 65.00           |
| 0571             | LEFT HEADLAMP ASSY  | 81170 37121   | Original    | n1                         | 420.00          |
| 0572             | RIGHT HEADLAMP ASSY | 81130 37120   | Original    |                            | 420.00          |
| 1410             | WINDSCREEN SEAL     | 56121 25040   | Original    |                            | 125.00          |
| 1411             | WINDSCREEN BOND KIT | PZ49I 00C1131 |             |                            | 0.00            |
| 3010             | FRONT CROSSMEMBER   | 51211 37090   | Original    | R                          | 225.00          |
| 4411             | HEATER CPL          | 87010 37090   | Original    | n1                         | 1,250.00        |
| 4415             | HEATER BLOWER CPL   | 87210 37050   | Original    | n1                         | 450.00          |
| f: OEM Parts     |                     |               |             |                            | <b>Savings</b>  |
| n: Non-OEM Parts |                     |               |             |                            | <b>Subtotal</b> |
| u: Used parts    |                     |               |             |                            |                 |
| <b>Total</b>     |                     |               |             |                            | <b>4,620.00</b> |

**Extras**

| Code                | Description              | Price SGD     |
|---------------------|--------------------------|---------------|
| 1000                | F/R DOOR CO STICKER 1000 | 25.00*        |
| 1001                | FRT NUMBER PLATE 1001    | 35.00*        |
| 1002                | AIRCON COOLANT 1002      | 50.00*        |
| <b>Total Extras</b> |                          | <b>110.00</b> |

Final Calculation

|                                    | SGD      | SGD      |
|------------------------------------|----------|----------|
| Parts                              | 4,620.00 |          |
| Total Parts                        |          | 4,620.00 |
| Labour Time Base 10 WU/h           |          |          |
| Total 209.0 WU X 42.00 SGD/h       | 877.80   |          |
| Total of Labour                    |          | 877.80   |
| Total Of Extras                    |          | 110.00   |
| Paint Work Time Base 10 WU/h       |          |          |
| Labour Cost 114.0 WU X 42.00 SGD/h | 478.80   |          |
| Material Cost                      | 164.38   |          |
| Total Paint Including Material     |          | 643.18   |
| Repair Cost Excludes GST           |          | 6,250.98 |
| GST (+8.0%)                        |          | 500.08   |
| Repair Cost Included GST           |          | 6,751.06 |

Comments

- \* - USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
- ) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.