

ASS. REC. BY:

REF:

INC1

Kenneth

## ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its  
repair at the time of inspection.

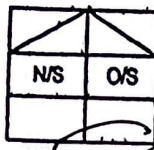

Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

04 days

Res.: Yes or No

Lum Sum:

20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Date / Time

Action / Instruction

Veh No:

SHC 47475

Yr Regn:

021 16

Type: M.Car / M.Cycle / Bus / Van / Lorry (Taxi) Prime Mover /

Truck / Trailer or

Make:

Toy PNU

C.G

1798

Colour

M. Brown

A/C:

Insured / Std / NI / NA

Sp. Reading

F17090

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

JTDKN36UX05767444

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modl: Nil / S/Rim / STD A/Rim or

Tyre Size:

F: Giti

195/65R15

R: Sailun

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal.

9

mm

Rear

R/Bal.

8

mm

L/Bal.

9

mm

L/Bal.

8

mm

D.O.A.

21/5/23

D.O.I.

23/5/2023

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

Rear O/S

The UIC / Chassis frame / Body Structure affected due to collision.

Date/Time, File Pass to?



: Prell. Report

1)



: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S - RS. SI

F. P. A. S.

Others

Add Fee:



: Site Insp (\$



: Interview (\$



Tech Invs (\$



Weekend (\$

TOTAL

Report Format :

Lump Sum / I.B.I. (\$)

TP  
Income  
87

**STRIDES**  
AUTOMOTIVE

SHB 5284J

**SMRT Accident Vehicle Repair Estimates**

SMRT Automotive Services Pte Ltd  
60 Woodlands Industrial Park E4, Singapore 757705  
FAX Number : 63685592  
Estimator Telephone Number : 68662623  
Accident Reporting Number : 68662672


Date Generated : 22/05/2023

User ID : BoonChewTay

**Section A - Accident Details**

Registration Number	SHC4747S
Case Reference Number	TAX/05/23/2063
Registration Date	19/2/2016
Company Type	Strides Taxi Pte Ltd
Make	TOYOTA
Model	PRIUS
Name of Driver	MOHAMED AMANULLAH BIN PEER MOHAMED
Type of Accident	Head to Rear
Accident Date and Time	21/5/2023 8:00 AM
Accident Reported Date and Time	22/5/2023 12:07 PM
Is Surveyor Required?	No
Survey by	
Vehicle is Towed Back?	No
Towed Back Date and Time	
Replacement Vehicle issued?	No
Job Card Number	24118473
Special Instruction to ARC, if any	REAR PORTION DAMAGED
Prepared Date and Time	22/5/2023 3:37 PM
Chassis Number	
Mileage	
Work Shop	
Repair Completion Date and Time	

**Section B - Summary of Repair Estimates**

Summary of Repair Estimates		
	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Cost	\$1,014.00	\$0.00
Total Spray Cost	\$1,636.00	\$0.00
Total Spare Part Cost	\$6,758.22	\$0.00
Total Other Cost	\$1,355.00	\$0.00
<b>TOTAL COST</b>	<b>\$10,763.22</b>	<b>\$0.00</b>
Jump Sum Total	\$10,750.00	\$0.00
Number of Repair Days	8.0	08 days
Prepared / Adjusted By	Boon Chew Tay	
ARC / Surveyor Sign Off Date	22/05/2023 3:54 PM	
Signature		x Kenneth
Remarks		

**Section C - Quotation and Accident Invoice Details**

Quotation Number		Invoice Number	
Quotation Date		Invoice Date	
Invoice Amount		Prepared Date	

Not Notified  
11 May 23  
Resurvey After Paint

**SMRT Accident Vehicle Repair Estimates**

 SMRT Automotive Services Pte Ltd  
 60 Woodlands Industrial Park E4, Singapore 757700  
 FAX Number : 63685592  
 Estimator Telephone Number : 68662623  
 Accident Reporting Number : 68662672

 Date Generated : 22/05/2023  
 User ID : BoonChewTay

**Section D - Details of Repair Estimates**
**Part 1 - Labour Works**

Job Scope	Quotation from AR	Adjusted by Surveyor, if applicable
O REPAIR REAR PORTION	\$1,014.00 <i>400l</i>	
<b>total Labour</b>	<b>\$1,014.00</b>	

**Part 2 - Spray Painting & Panel Beating Related Works**

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
O RESPRAY BUMPER BEAM	\$220.00 <i>7</i>	
O RESPRAY REAR BUMPER	\$378.00 <i>200l</i>	
O RESPRAY REAR PANEL	\$220.00 <i>7</i>	
O RESPRAY REAR SPARE TYRE PANEL	\$220.00 <i>7</i>	
O RESPRAY TAIL GATE	\$378.00 <i>200l</i>	
O RESPRAY TAILGATE OUTSIDE GARNISH	\$220.00	
<b>total Spray Painting &amp; Panel Beating</b>	<b>\$1,636.00</b>	

**Part 3 - Other Costs - Accident and Accident Repair Related Expense**

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
O WASH AND VACUUM	\$60.00 <i>X</i>	
O CHECK WIRING AND SYSTEM FUNCTION	\$120.00 <i>200l</i>	
O APPLY RUST-PROOFING ON AFFECTED AREA	\$100.00 <i>30l</i>	
O TRANSFER REAR TAILGATE MECHANISM	\$120.00 <i>60l</i>	
O PROVIDE LABOUR & MATERIAL FOR SOLAR FILM (NET)	\$475.00 <i>X</i>	
O TEST AND REFIX REVERSE SENSOR SYSTEM	\$120.00 <i>50l</i>	
O REMOVE AND REFIX REAR WINDSCREEN	\$240.00 <i>120l</i>	
O REPLACE SUNDRY PARTS	\$120.00 <i>X</i>	
<b>total Other Costs</b>	<b>\$1,355.00</b>	

**Part 4 - Spare Parts / Material Usage**

Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Approved
		52159-47905	BUMPER REAR	1.00	\$478.90	25.00	\$359.17	Replace	<i>Ben</i> ✓
		90467-07211	BUMPER CLIPS (10 PCS)	10.00	\$2.40	25.00	\$18.00	Replace	<i>Ben</i> ✓
		52023-12240	BUMPER REINFORCEMENT REAR	1.00	\$234.70	25.00	\$176.02	Replace	<i>?</i>
		52015-47050	ARM SUB-ASSY. RR BUMPER RH	1.00	\$157.90	25.00	\$118.43	Replace	<i>?</i>
		52016-47030	ARM SUB-ASSY. RR BUMPER LH	1.00	\$157.90	25.00	\$118.43	Replace	<i>?</i>
		89997-30070	ANTENNA, ELECTRICAL LOWER REAR	1.00	\$208.10	10.00	\$187.29	Replace	<i>?</i>
			SENSOR REVERSE	1.00	\$180.00	0.00	\$180.00	Replace	<i>Ben</i> ✓
		76088-47020	BUMPER LIP COVER RR/LH	1.00	\$93.90	25.00	\$70.43	Replace	<i>Ben</i> X
		76087-47020	BUMPER LIP COVER RR/RH	1.00	\$155.40	25.00	\$116.55	Replace	<i>?</i>
		76891-47020	BUMPER LIP REAR	1.00	\$301.90	25.00	\$226.42	Replace	<i>Ben</i> ✓
		58308-47011	UNDER COVER SUB-ASSY. RR FLOOR	1.00	\$586.10	25.00	\$439.58	Replace	<i>?</i>
		51442-12210	UNDER COVER RR SHIELD	1.00	\$66.10	25.00	\$49.57	Replace	<i>Ben</i> X
		52576-47020	BUMPER SIDE RETAINER RR/LH	1.00	\$108.70	25.00	\$81.53	Replace	<i>Ben</i> X
		52575-47020	BUMPER SIDE RETAINER RR/RH	1.00	\$108.70	25.00	\$81.53	Replace	<i>?</i>
		58307-47060	END PANEL	1.00	\$755.10	25.00	\$566.33	Replace	<i>Ben</i> ?

**SMRT Accident Vehicle Repair Estimates**

SMRT Automotive Services Pte Ltd  
60 Woodlands Industrial Park E4, Singapore 757705  
FAX Number : 63685592  
Estimator Telephone Number : 68662823  
Accident Reporting Number : 68662672

Date Generated : 22/05/2023

User ID : BoonChewTay

Part 4 - Spare Parts / Material Usage									
Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Approved
		58311-47071	SPARE TYRE PANEL	1.00	\$755.10	25.00	\$566.33	Replace	R X
			SEALANT SIKAFLEX	1.00	\$37.00	0.00	\$37.00	Replace	nn X
		67005-47241	TAILGATE ASY	1.00	\$1,260.70	25.00	\$945.53	Replace	R ✓
		75574-47020	TAILGATE DOOR GLASS MOULDING, RH	1.00	\$33.60	25.00	\$25.20	Replace	nn —
		75574-47020	TAILGATE DOOR GLASS MOULDING, RH	1.00	\$33.60	25.00	\$25.20	Replace	nn —
		68105-47122	TAILGATE DOOR GLASS	1.00	\$1,273.10	25.00	\$954.82	Replace	nn ✓
		75575-47030	MOULDING BACK WINDOW, LOWER NO.1	1.00	\$33.60	25.00	\$25.20	Replace	nn —
		75575-47020	MOULDING, BACK WINDOW, LOWER NO.2	1.00	\$33.60	25.00	\$25.20	Replace	nn —
		64821-47030	TAILGATE LOWER WINDOW GLASS	1.00	\$827.50	25.00	\$620.63	Replace	nn X
		56117-50140	TAIL GATE DAM, BACK DOOR GLASS UPPER ADHESIVE	1.00	\$31.30	25.00	\$23.48	Replace	nn —
		68294-47050	DAM, BACK DOOR GLASS ADHESIVE, NO.2	1.00	\$22.30	25.00	\$16.73	Replace	nn —
			SEALANT W/SCREEN (3PCS)	3.00	\$37.00	0.00	\$111.00	Replace	nn —
		68810-47010	TAILGATE DOOR HINGE LH/RH (2 PCS)	2.00	\$61.20	25.00	\$91.80	Replace	R X
		69350-47030	TAILGATE DOOR LOCK	1.00	\$631.90	10.00	\$568.71	Replace	?
		69415-47020	TAILGATE LOCK, COVER	1.00	\$20.70	25.00	\$15.52	Replace	?
		69431-47010	STRIKER, BACK DOOR	1.00	\$55.80	25.00	\$41.85	Replace	R X
		67881-47022	TAILGATE DOOR WEATHER STRIP	1.00	\$402.50	25.00	\$301.88	Replace	?
		76801-47070-B0	TAILGATE OUTSIDE GARNISH	1.00	\$574.80	25.00	\$431.10	Replace	nn X
		75310-47020	EMBLEM REAR	1.00	\$68.70	25.00	\$51.53	Replace	nn X
		75374-47051	NAME PLATE (HYBRID)	1.00	\$59.20	25.00	\$44.40	Replace	nn X
		75442-47030	NAME PLATE (PRUIS)	1.00	\$69.40	25.00	\$52.05	Replace	nn X
		75443-47030	NAME PLATE (TOYOTA)	1.00	\$59.20	25.00	\$44.40	Replace	nn X
			STRIDES LOGO	1.00	\$7.80	0.00	\$7.80	Replace	nn X
			STICKER DECAL 85558888	1.00	\$21.60	0.00	\$21.60	Replace	nn X
		52562-47010	TAIL LAMP BRACKET, RH	1.00	\$35.20	25.00	\$26.40	Replace	nn X
		81551-47180	TAIL LAMP RH	1.00	\$618.60	10.00	\$556.74	Replace	nn X
		52563-47010	TAIL LAMP BRACKET, LH	1.00	\$35.20	25.00	\$26.40	Replace	nn X
		81561-47170	TAIL LAMP LH	1.00	\$618.60	10.00	\$556.74	Replace	nn X
					<b>\$11,314.60</b>		<b>\$9,004.52</b>		

**ed Spare Parts / Material Usage After Surveyor Signed off**

Number	Portion	Stock Number	Part Name	Quantity	List Price \$	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check

**LKK Auto Consultants hence notify the Repairer of the following:**

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

## SINGAPORE ACCIDENT STATEMENT

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

### ACCIDENT STATEMENT

Date of Submission	23/05/2023 09:23 (SGT)
Reported by	Actual Driver
Date of Accident	21/05/2023 08:00 (SGT)
Exact Location of Accident	Crawford St, Singapore
Additional Location Information	SLIP ROAD FROM BEACH ROAD TOWARDS CRAWFORD STREET
Country/State of Loss	Singapore

### DETAILS OF OWN VEHICLE

Vehicle Registration Number ..... SHC4747S

#### INSURED/POLICYHOLDER

Is company?	Yes
Name Of Registered Owner	Strides Taxi Pte Ltd
Company Reg No	1XXXXX369K
Email Address	AUTO-SVCS-TARC@SMRT.COM.SG
Mobile Phone No	(Phone) +65-68662671
Alternative Phone No	-

#### VEHICLE PARTICULARS

Manufacturer	Toyota
Model	Prius
Variant	-
Exact purpose for which vehicle was being used at time of accident	-
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Taxi
Transmission	Auto
CC	1800

#### INSURANCE COMPANY

Name of Insurance Company	MS First Capital Insurance Ltd
Policy Number / Cover Note Number	D-23100854MFSH

#### DRIVER

Name of Driver	MOHAMED AMANULLAH BIN PEER MOHAMED
NRIC No	SXXXX305I
Date Of Birth	17/03/1955

Occupation	Outdoor
Date Of Driving Pass	04/03/1980
Driving experience	43 YEARS AND 2 MONTHS
Gender	Male
Mobile Number	(Phone) +65-68662672
Alt. Phone Number	-
Email Address	AUTO-SVCS-TARC@SMRT.COM.SG
Address	11
Address complement	-
Postcode	-
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Hirer
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

#### GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collision - Head to Rear
Weather Conditions	Clear
Road Surface	Dry

#### OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	1
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No
Translator's name	-
Translator's ID	-
Translator's phone number	-
Translator's email	-
Original language used in the statement	-

#### DETAILS OF POLICE ACTION

Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	-

#### CIRCUMSTANCES OF ACCIDENT

MY VEHICLE WAS STATIONARY AT THE SLIP ROAD OF BEACH ROAD TOWARDS CRAWFORD STREET WHEN A VEHICLE SMR4220G HIT ONTO THE REAR OF MY VEHICLE, NO INJURY REPORTED NO PAX INSIDE MY TAXI

#### ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	Yes
Reasons for not uploading a video of the accident	FILE TOO BIG

#### DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SMR4220G
Vehicle Manufacturer	-
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-

Describe

21 May 2022  
around 1218 hrs

Towards  
Lavender Street

CRAWFORD STREET



A- SHC 4747C

B- SMR 4220G

**Declaration**

I/We declare the foregoing particulars are true in every respect.



*[Signature]*

*[Signature]*

Policyholder's Signature / Date & Time

Actual Driver's Signature (if driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel (Name as in NRIC/ID card)