

ASS. REC. BY:

REF:

A15/230055061K_y

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

B1-C

of

02-05

467C

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

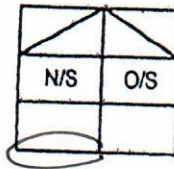

Bal. or Market Value:

\$70k

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

04

days

Res.:

Yes or No

Lum Sum:

20

%

3 Val.:

Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SLP 4564P

Yr Regn:

08/16

Type: M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Toy Harrier

C.C.

1986

Colour

Black

A/C:

Insured / Std / NI / NA

Sp. Reading

109456

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

85460

0081025

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Mod: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

R:

255/55R18

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Front

Rear

R/Bal.

8

mm

R/Bal.

9

mm

L/Bal.

8

mm

L/Bal.

9

mm

D.O.A.

22/5/23

D.O.I.

6/6/2023

Survey held at

Des. of Damages: Fnt / Rear / O/S / N/S / UIC / Rooftop or

Rear N/S

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Can reject

Date/Time, File Pass to?

☐

: Prel. Report

1)

Date/Time, File Return to?

☐

: Final Report

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation

S + RS. SI

Fees

Others

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech Invs (\$

☐

: Weekend (\$

Report Format :

Lump Sum / I.B.I. (\$

TOTAL



Sin Ming Autocare BFG Pte Ltd

176 Sin Ming Drive
#02-05 Sin Ming Autocare
Singapore 575721
Tel : 6455 0600 | Fax : 6455 6192
Website: www.autocare.com.sg
GST Reg. No: 20-0210033-N

Allianz Insurance Singapore Pte Ltd
79 Robinson Road
#09-10
Singapore 068897
Attn: Motor Claim Dept

Not Withheld

11 Pys &

Penury After Pain

4 days

ESTIMATE

VEHICLE NO: **SLF4564P**
MAKE/MODEL: **TOYOTA HARRIER**

DATE: **26.05.2023**

CHASSIS : ZSU600081025

No.	Descriptions	Qty	Unit Price	Amount S\$
-----	--------------	-----	------------	------------

LIST ITEM:

1	TAIL GATE	1	2,126.40	<i>Bu</i> 2,126.40 ✓
2	TAIL GATE WEATHERSTRIP	1	446.90	<i>Bu</i> 446.90 X
3	TAIL GATE LOCK	1	320.15	<i>Bu</i> 320.15 X
4	TAIL GATE EMBLEM LOGO	1 <i>na</i>	85.60	<i>Bu</i> 85.60 X
5	TAIL GATE EMBLEM HARRIER	1	123.15	<i>Bu</i> 123.15 ✓
6	TAIL GATE GARNISH OUTER	1	1,055.20	<i>Bu</i> 1,055.20 X
7	REAR BODY PANEL	1	1,006.40	1,006.40 7
8	REAR BODY PANEL TOP GARNISH	1	438.30	<i>Bu</i> 438.30 X
9	REAR BUMPER	1	1,744.70	<i>Bu</i> 1,744.70 ✓
10	REAR BUMPER SIDE RETAINER LH	1	85.60	<i>Bu</i> 85.60 X
11	REAR BUMPER LOWER COVER CLIPS	8	5.50	<i>Bu</i> 44.00 ✓
12	REAR BUMPER REFLECTOR LH	1	96.80	<i>Bu</i> 96.80 X
13	REAR WINDSCREEN MOULDING LOWER	1	101.50	<i>Bu</i> 101.50 ✓
14	REAR WINDSCREEN MOULDING RH	1	60.50	<i>Bu</i> 60.50 ✓
15	REAR WINDSCREEN MOULDING LH	1	60.50	<i>Bu</i> 60.50 ✓
16	REAR BEZA SENSOR	1	285.15	<i>Bu</i> 285.15 X
17	REAR BUMPER LOWER GARNISH	1	566.00	<i>Bu</i> 566.66 X
18	REAR TAIL GATE REFLECTOR LH	1	608.60	<i>Bu</i> 608.60 1

Sub Total (S\$) : 9,256.11

Discount (25%) : 2,314.03

Total Parts (S\$) : **6,942.08**

SPECIAL NETT ITEMS

1	REAR BUMPER REVERSE SENSOR COVER LH CENTRE	1	44.50	<i>Bu</i> 44.50 X
2	REAR GLASS SEALANT	1	50.00	<i>Bu</i> 50.00 40.00
3	REAR REVERSE SENSOR SIDE LH	1	280.00	280.00 7
Sub Total (S\$) :			374.50	374.50

LABOUR:

1	TO DISMANTLE & REPLACE DAMAGE PARTS,PANEL BEAT WHERE NECESSARY	1,200.00	4001
2	TO PUTTY,APPLY PRIMER & SPRAY PAINT ON AFFECTED PORTION	1,000.00	4401
3	TO APPLY RUST PROOFING ON REPAIR	80.00	301
4	TO REMOVE/REFIT REAR GLASS TO FACILITATE REPAIRS	150.00	1201
5	TO REMOVE/TRANSFER REAR TAILGATE MECHANISMS	120.00	601
6	TO CHECK WIRING FUNCTIONS	60.00	201
Total Labour (S\$) :		<u>2,610.00</u>	

Total Amount (S\$) : 9,552.08



for Sin Ming Autocare BFG Pte Ltd

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

**Sin Ming Autocare BFG Pte Ltd**

176 Sin Ming Drive
#02-05 Sin Ming Autocare
Singapore 575721
Tel : 6455 0600 | Fax : 6455 6192
Website: www.autocare.com.sg
GST Reg. No: 20-0210033-N

Allianz Insurance Singapore Pte Ltd
79 Robinson Road
#09-10
Singapore 068897
Attn: Motor Claim Dept

CHASSIS : ZSU600081025

ESTIMATE

VEHICLE NO: SLF4564P
MAKE/MODEL: TOYOTA
HARRIER
DATE: 06.06.2023

No.	Descriptions	Qty	Unit Price	Amount S\$
SUPPLEMENTARY ITEM:				
1	REAR BUMPER SPONGE	1	137.30	137.30
				repeated CM ✓
Sub Total (S\$) :				137.30
Discount (25%) :				34.33
Total Parts (S\$) :				102.98
<u>SPECIAL NETT ITEMS</u>				
1	REAR GLASS SEALANT	1	50.00	50.00
Sub Total (S\$) :				50.00

Total Amount (S\$) : 102.98



for Sin Ming Autocare BFG Pte Ltd