



PROMINENT APPRAISER SERVICES PTE LTD

Qualified Loss Adjusters And Motor Appraisers

Correspondence Mail Address: My Mail Box 886259 Singapore 919191
Mobile 9295 2204 Fax: 6722 8508 Email pasvcs@hotmail.com

Business Reg 201404434D

VEHICLE INSPECTION REPORT

Report No. : PAS/IP/0230423

Date of Report : 08/05/2023

To : M/s. Absolut Car Leasing Pte Ltd
C/o. 48 Toh Guan Road East
#01-119 Enterprise Hub
Singapore 608586

Date of Assignment : 18/04/2023
Report requested by : M/s. Absolut Car Leasing Pte
Date of Accident : 13/04/2023
Date of Inspection : 18/04/2023
Claim No. : Third Party Claim
Policy No. : -

PARTICULARS OF DAMAGED VEHICLE

Vehicle Registration No. : SLB7894M
Make & Model : Toyota Corolla Altis
Date of Registration : 22/04/2016
Colour : Met. Grey

Engine Capacity (cc) : 1598
Mileage (km) : 152930km
Chassis / Frame No. : MR053REH104548757
Engine No. : 1ZRX562679

TYRE CONDITION

Front LH : 7 mm
Make : Westlake

Front RH : 7 mm
Make : Westlake

Rear LH : 7 mm
Make : Westlake

Rear RH : 7 mm
Make : Westlake

Road wheels Type : Alloy

(The above represents the approximate remaining life of tyre treads)

PRE-ACCIDENT CONDITION OF DAMAGED VEHICLE (Static tests only)

General Bodywork : Good
Paintwork : Good
Handbrake : Serviceable
Footbrake : Serviceable
Steering : Serviceable
Apparent Engine Modification : Nil

PLACE OF REPAIRER OFFICE/WORKSHOP

Location : M/s. Gold Autoworks Pte Ltd
48, Toh Guan Road East, #01-119, Enterprise Hub, Singapore 608586

ASSESSMENT

Repairer's Estimate : \$ 12,623.45
Revised Amount : \$ 9,443.23
Less Excess : \$ -
Recommended Reserve : \$ 7,550.00 (Lump Sum)

Estimated Normal Period of Repairs : 8 Working Days

Disclaimer: The information contained in this report is intended for exclusive use of the addressees (including any attachments) solely in relation to the loss occurrence in which the assessed vehicle involved. It is confidential and may be protected by legal privilege. No liability or responsibility whatsoever shall be held by PROMINENT APPRAISER SERVICES PTE LTD for any reliance on this report by any third party. If you are not the intended recipient, please contact us immediately to arrange for its return and you should not disseminate, distribute, copy any information contained herein or use of this communication is strictly prohibited.



PROMINENT APPRAISER SERVICES PTE LTD

Qualified Loss Adjusters And Motor Appraisers

Correspondence Mail Address: My Mail Box 886259 Singapore 919191
Mobile: 9295 2204 Fax: 6722 8508 Email: pasvos@hotmail.com

Business Reg: 201404434D

Vehicle No : SLB7894M

Report No. : PAS/TP/0230423

GENERAL REMARKS

WITHOUT PREJUDICE

THE ASSIGNMENT

The survey was conducted at M/s. Gold Autoworks Pte Ltd, 48, Toh Guan Road East, #01-119, Enterprise Hub, Singapore 608586.

(Subsequent inspections have been conducted)

POINT OF IMPACT

At the RHR portion. (The RHR roadwheel was also affected)

DAMAGES

The rear bumper, RHR fender, RHR fender inner panel, RHR wheel house, RHR door, RHR alloy rim, RHR wheel bearing, rear axle beam assy, etc.

Other parts were also found damaged. (See schedule for details)

ADJUSTMENT / RECOMMENDATION

We have inspected thoroughly each and every item on the repairer's estimate against the actual damaged found on the vehicle. We list the breakdown of our findings and our recommendation as per schedule attached.

Our adjusted amount for the cost of repairs is SGD \$9,443.23.

CONCLUSION

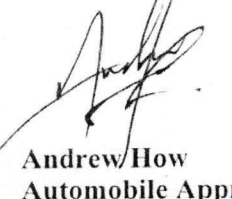
The repairer has agreed to undertake the repairs at a lump sum of SGD \$7,550.00.

This inspection was conducted entirely on a 'Without Prejudice' basis. We have not given an authorization and/or instruction to the repairer to proceed with the repairs.

We hereby reverting the matter to you for your discretion on repairs.

Assuring you of our best services always.

Yours Truly,
Prominent Appraiser Services Pte Ltd


Andrew How
Automobile Appraiser
MSAAA
Licensed Appraiser



PROMINENT APPRAISER SERVICES PTE LTD

Qualified Loss Adjusters And Motor Appraisers
Correspondence Mail Address: My Mail Box 886259 Singapore 919191
Mobile: 9295 2204 Fax: 6722 8508 Email: pasvcs@hotmail.com

Business Reg. 201404434D

Vehicle No : SLB7894M

Report No. : PAS/TP/0230423

APPRAISEMENT SCHEDULE

S/No.	Qty	Parts Descriptions	Condition	Repairer's Estimate (\$\$)	Our Assessment (\$\$)
1	1 pc	Taillamp RH	Cracked/Broken	\$ 502.00	\$ 391.90
2	1 pc	Taillamp panel RH	Dented/Distorted	\$ 112.30	\$ 502.00
3	1 pc	Rr bumper	Dented	\$ 561.50	\$ 112.30
4	1 pc	Rr bumper reflector RH	Broken	\$ 60.40	\$ 561.50
5	6 pcs	Rr bumper clip	Necessary	\$ 3.80	\$ 60.40
6	1/2 pcs	Rr bumper side guide R/L	Cracked/Necessary	\$ 61.00	\$ 22.80
7	1/2 pcs	Rr bumper retainer R/L	Cracked/Necessary	\$ 110.50	\$ 122.00
8	1 pc	Rr bumper reinforcement	Refit	\$ 403.70	\$ 221.00
9	1 pc	Rr end panel	Dented/Repair	\$ 676.60	\$ 221.00
10	1 pc	Rr windscreen dam kit	Necessary	\$ 41.50	\$ -
11	1 pc	Rr fender panel RH	Dented	\$ 1,160.20	\$ 41.50
12	1 pc	Rr fender inner panel RH repair	Dented/Distorted	\$ 394.80	\$ 1,160.20
13	1 pc	Rr fender inner wheel house RH	Dented/Repair	\$ 526.70	\$ 394.80
14	1 pc	Rr fender inner trim RH	Refit	\$ 333.30	\$ -
15	6 pcs	Rr fender inner trim clip RH	Necessary	\$ 3.20	\$ 19.20
16	1 pc	Rr door panel RH	Dented/Repair	\$ 1,260.00	\$ 19.20
17	1 pc	Rr alloy rim RH	Dented/Defaced	\$ 1,031.50	\$ 1,031.50
18	1 pc	Rr wheel hub assy RH	Warped/Damaged	\$ 967.40	\$ 967.40
19	1 pc	Rr shock absorber RH XSVL	Bent/Jammed	\$ 220.60	\$ 220.60
20	1 pc	Rr axle beam assy XSVL	Bent/Distorted	\$ 3,287.10	\$ 3,287.10
21	1 pc	Rr fender inner wheel house RH	Dented/Repair		
22	1 pc	Rr door panel RH	Dented/Repair		
				(Refer labour no. 3, 6 & 7)	(Refer labour no. 3, 6 & 7)
				\$ 11,924.60	\$ 8,724.30
Less Discount : 25%				\$ 2,981.15	\$ 2,181.08
List Parts Sub-Total :				\$ 8,943.45	\$ 6,543.23
1	1 pc	Rr windscreen sealant	Necessary	\$ 50.00	\$ 30.00
2	1 pc	Rr fender panel sealant RH	Necessary	\$ 50.00	\$ 30.00
3	1 pc	Rr tyre RH XSVL (Depreciate 10%)	Cut	\$ 200.00	\$ 180.00
4	1 pc	Brake fluid	Necessary	\$ 20.00	\$ 20.00
Special Nett Sub-Total :				\$ 320.00	\$ 300.00
Parts Total :				\$ 9,263.45	\$ 6,843.23



PROMINENT APPRAISER SERVICES PTE LTD

Qualified Loss Adjusters And Motor Appraisers

Correspondence Mail Address: My Mail Box 886259 Singapore 919191

Mobile 9295 2204 Fax: 6722 8508 Email: pasvcs@hotmail.com

Business Reg 201404434D

Vehicle No : SLB7894M

Report No. : PAS/TP/0230423

S/No.	Labour Descriptions	Repairer's Estimate (S\$)	Our Assessment (S\$)
1	To remove and reinstall electrical wiring system for necessary repairs. To check rear electrical wiring system.	\$ 50.00	\$ 30.00
2	To remove and reinstall rear windscreen for necessary repairs.	\$ 120.00	\$ 120.00
3	To remove and reinstall rear interior trims, garnishes, seats, etc. for necessary repairs.	\$ 120.00	\$ 80.00
4	To remove, check and replace RH/rear undercarriage parts. (Include flush and bleed brakes system)	\$ 300.00	\$ 250.00
5	To conduct wheel alignment (2x).	\$ 140.00	\$ 140.00
6	To straighten, repair, realign on affected area and replace damaged parts.	\$ 1,300.00	\$ 1,100.00
7	To spray painting, blending on affected and adjacent area.	\$ 1,300.00	\$ 850.00
8	To spray anti-rust coating on new and affected panels.	\$ 30.00	\$ 30.00
Labour Total :		\$ 3,360.00	\$ 2,600.00
Total (Parts & Labour) :		\$ 12,623.45	\$ 9,443.23

For Lump Sum Repairs

The final adjusted Lump Sum contract amount is \$ 7,550.00

Under normal circumstances, the repairs should be completed within a reasonable period of **8 Working Days**. (Exclude waiting days of PRI, Sunday, Public Holiday and awaiting of shipment for spare parts)

52 Photographs were taken at the time of inspection.

N.B: By accepting to carry out the repairs on a contract Lump Sum basis, the repairer shall have the prerogative and discretion to replace the damaged parts with new, used, OEM or reconditioned parts and/or to repair the vehicle on a roadworthy condition to the entire satisfaction of owner.

2083157
400100
80100
1850
4413.57
208
3530.85

L/S-83,500
6 days