

ComfortDelGro Engineering Pte Ltd (Co.Reg.No:199506048W)59 Loyang Drive
Singapore 508969
Tel: 6214 8300

Lim Tien Siong

TP INSURER:
CTPL**India International Insurance Pte Ltd (HQ)**

(45)

Singapore

LKK-

PARTICULARS OF CLAIM

Claim Type:	THIRD PARTY	Ref. No:	
Policy No:	DOR, 201217	Date of Loss:	16/06/2023
Vehicle Reg. No.:	SHA1173C	Driveable?	
Party At Fault:	UNKNOWN		
Make/Model:	HYUNDAI I40, 1.7 D CRDI (A)	Vehicle Reg. Date:	20/12/2017
Vehicle Colour:	BLUE		
Engine No:	D4FDHU728026	Chassis No:	KMHLB41UMHU099851
Odometer:	0 KM		
Paint Type:			
List Item Discount:	20.00 %		
Total Loss?	NO		
Est. Duration of Repair (day)	6		

Present Location: COMFORTDELGRO ENGINEERING PTE LTD (LOYANG)**COST OF CLAIMS**

	Amount
Parts	11,457.62
Miscellaneous Items	11.00
Labour	4,080.00
Paintwork Labour	0.00
Towing	0.00
Gross Total (S\$)	15,548.62
+ GST 8.00% (S\$)	1,243.89
Nett Amount (S\$)	16,792.51

This claim is handled by: LIM TIEN SIONG

Generated using Merimen e-Claims Internet Estimation & Adjusting System

19/6 @ 09:01 hrs

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 19 Jun 2023) Lim Tien Siang
 Parts: 143 HYUNDAI I40 1.7 D CRDi (A) (Catalogue:Merimen Singapore 1.0)
 Labour: Repairer's (Price-denominated Standard List)
 Print Code: ComfortDelGro Engineering Pte Ltd/SHA1173C/19/06/2023 09:01
 Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
 Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Estimates on Parts

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1		*BOOTLID	20.00	0.00	bt ✓ *2,609.80 FL
2	1		*BOOTLID (H) EMBLEM	20.00	0.00	rel ✓ *63.10 FL
3	1		*BOOTLID (CRDi) EMBLEM	20.00	0.00	rel ✓ *52.40 FL
4	1		*BOOTLID (I40) EMBLEM	20.00	0.00	rel ✓ *67.90 FL
5	1		*BOOTLID LOWER GARNISH	20.00	0.00	af ✓ *227.90 FL
6	1		*REAR BUMPER	20.00	0.00	de ✓ *553.00 FL
7	1		*REAR BUMPER UNDER COVER	20.00	0.00	de ✓ *228.00 FL
8	1		*REAR BUMPER REINFORCEMENT	20.00	0.00	? *428.40 FL
9	10		*REAR BUMPER CLIPS	20.00	0.00	rel ✓ *22.00 FL
10	2		*REAR REINFORCEMENT BRKT RH / LH	20.00	0.00	rel ? *71.20 FL
11	1		*REAR END PANEL	20.00	0.00	? *526.70 FL
12	1		*REAR END PANEL GARNISH	20.00	0.00	? *57.70 FL
13	1		*REAR END LOWER PANEL	20.00	0.00	? *495.50 FL
14	1		*REAR FENDER RH	20.00	0.00	Rx ✓ *2,171.40 FL
15	2		*BOOTLID LAMP RH / LH	20.00	0.00	? *1,244.40 FL
16	2		*TAILLAMP RH / LH	20.00	0.00	? *1,395.60 FL
17	1		*REVERSE SENSORS	0.00	0.00	rel ✓ *135.70 F
18	1		*REAR BUMPER MAT	0.00	0.00	rel ✓ *50.00 F
19	1		*REAR BUMPER ADV.STICKER	0.00	0.00	rel ✓ *50.00 F
20	2		*REAR FENDER ADV.STICKER RH / LH	0.00	0.00	rel ✓ *200.00 F
21	1		*BOOTLID ADV.STICKER	0.00	0.00	rel ✓ *100.00 F
22	1		*REAR WINDSCREEN MOULDING	20.00	0.00	X *51.80 FL
23	2		*REAR WINDSCREEN SEALANTS	0.00	0.00	X *92.00 F
24	1		*BOOTLID (COMFORTDELGRO)	0.00	0.00	rel ✓ *30.00 F
25	1		*BOOTLID (65521111)	0.00	0.00	rel ✓ *30.00 F
26	1		*REAR NO.PLATE WITH TRIM COVER	0.00	0.00	rel ✓ *55.00 F
27	1		*FRONT NO.PLATE WITH TRIM COVER	0.00	0.00	rel ✓ *55.00 F
28	1		*FRONT BUMPER	20.00	0.00	de ✓ *1,052.20 FL
29	10		*FRONT BUMPER CLIPS	20.00	0.00	rel ✓ *22.00 FL
30	1		*RADIATOR GRILLE	20.00	0.00	rel ✓ *1,480.00 FL
31	1		*RADIATOR GRILLE (H) EMBLEM	20.00	0.00	rel ✓ *129.50 FL
32	2		*FRONT BUMPER GRILLE LH / RH	RHX 20.00	0.00	rel ✓ *374.40 FL

F=Franchise part. L=ListItemDisc.

Sub Total (\$\$) 14,122.60
 - List Item Discount on L Items (\$\$) 2,664.98

Total Parts (\$\$) 11,457.62

ComfortDelGro Engineering Pte Ltd/SHA1173C/19/06/2023 09:01. Not valid without Reference section.
 Generated using Merimen e-Claims IEAS

Estimates on Miscellaneous Items

No Qty Particulars

Lim Tien Siong

Amount

Miscellaneous Items

1 1 OD/TP Case (Insurer)

11.00

Sub Total (S\$)

11.00

Estimates on Labour

No Particulars

Lab.Type

Amount

Labour Items

1 PANEL BEATING
(FRONT & REAR)

New

1225

1,800.00

2 SPRAY PAINTING
(FRONT & REAR)

New

1000

1,800.00

3 TUFF KOTE

New

30

150.00

4 CHECK LIGHTINGS

New

30

60.00

5 R/I REAR WINDSCREEN

New

120?

150.00

6 R/I REVERSE SENSORS

New

30

120.00

Gross Labour Cost (S\$)

4,080.00

ComfortDelGro Engineering Pte Ltd/SHA1173C/19/06/2023 09:01. Not valid without Reference section.

Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

Taighin 92495749
in, 20/6/23 2pm
4/5 busy after repair
Taighin @ Thantaw.
- 6 days

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Date/Time: 19.06.2023 10:59 Page : 1

Team: ARC Repair TP(CLSO)1

JOB CARD Sales Order: 5900703

JC NO305557966

CUSTOMER

MS COMFORT TRANSPORTATION PTE LTD

CUSTOMER NO. 7010045

DRESS 383 SIN MING DRIVE

Singapore SINGAPORE 575717

(R) 65508755

(O)

(P)

COUNT CARD NO.

REGN NO.:

SHA1173C

MILEAGE

MAKE:

HYUNDAI

FUEL

C.....1/2.....F

MODEL

I-40

DATE/TIME IN 17.06.2023 09:20

YR OF MANU.

20.12.2017

TARGET DATE

CHASSIS CODE

KMHLB41UMHU099851

COMPLETION DATE/TIME:

Merimen

JOB DESCRIPTION

LS

India

SLF

3421A

Ident Date: 16.06.2023

ATURE: 3P 16.06.2023

/NO

LABOR CODE

00010

PB


00020

20-05

DESCRIPTION

LUMPSUM REPAIR-SHA1173C-TP

TP MERIMEN

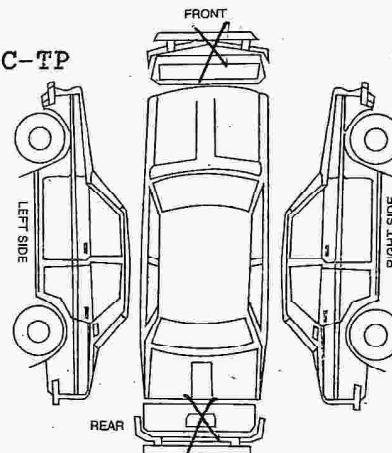

CKED & PASSED OUT BY:

SERVICE ADVISOR

CUSTOMER'S SIGNATURE

edgement Slip

Exit Pass

No.: SHA1173C

LIMITS

Vehicle No.:

SHA1173C

Service Advisor

Signature/Date

Name of Service Advisor

Date

turned to Service Reception upon collection

To be kept by Security Guard