









120 55



**Specialisation:**  
Repairing Vehicle Engines, Insurance Claims, Panel Beating, Welding, Modify & Spray Painting  
UEN 53024728C

40 Toh Guan Road East #01-57  
Enterprise Hub Singapore 608582  
H/P: 93048322, 98568137  
Tel/Fax: 62612883

**Terms:**

\$9,600.00	
------------	--

Customer's Signature \_\_\_\_\_

# PRO-OPTION SERVICES

Mailing address: Blk 189B Rivervale Drive, #04-1004, Singapore 542189

Tel: 6315 1239, Fax: 6315 3298, Mobile: 9061 0543

Chan Kian Hung, Daniel  
Blk 46 Lengkok Bahru  
#11-249  
Singapore 150046

Invoice no:	POS01226/22
Date:	25 January 2023
Report no:	1226M22.MCS
Vehicle :	SNB3935G

## INVOICE

No	Item Description	Qty	Unit Price	Total Amount(\$)
01	Being charges for the inspection of the accident vehicle, transport and photographs.			832.00
SGD(\$): Eight Hundred and Thirty-two only			Payable Amount:	832.00

"Cheque should be crossed and made payable to "Pro-Option Services"

PRO-OPTION SERVICES



.....  
Authorised Signature

# PRO-OPTION SERVICES

Mailing address: Blk 1898 Rivervale Drive, #04-1004, Singapore 542189

Fax: 6315 3298, Mobile: 9061 0543

## ACCIDENT VEHICLE INSPECTION REPORT

Report no : 1226M22.MCS  
Vehicle no : SNB3935G

### 1 REFERENCE

Date of inspection : 28 December 2022  
Requested by : Chan Kian Hung, Daniel  
Blk 46 Lengkok Bahru  
#11-249  
Singapore 150046  
Type of survey : Independent  
Repairer : Master Car Spray Service  
Blk 40 Toh Guan Road East, #01-67 Enterprise Hub, Singapore 608582  
Date of accident : 17 December 2022

### 2 VEHICLE DATA

Make/model : **B.M.W. 640I GRAN COUPE M SPORT LED SR NAV HUD**  
Chassis no : WBA6A02080DZ10439  
Engine no : 08588190N55B30A  
Date of registration : 21 August 2012 *COE Expiry Date:* 31 May 2031  
Engine capacity : 2979 cc  
Odometer reading : 152905 km  
Colour : Black

### 3 STATIC CONDITION CHECK

Steering : Affected  
Foot brakes : Serviceable  
Hand brakes : Serviceable  
Paintwork : Good  
General Condition : Good

### 4 TIRE CONDITION CHECK

	<u>RH/MAKE</u>	<u>LH/MAKE</u>	<u>SIZE</u>
Front tread	: 6 mm/Michelin	6 mm/Michelin	225/35ZR20
Rear tread	: 6 mm/Michelin	6 mm/Michelin	225/35ZR20

### 5 BRIEF DESCRIPTION OF DAMAGE

Rear bumper grazed, RH rear door scraped/bent, RH front door scraped/bent, RH front fender scraped/bent, front bumper scraped, RH front door pillar bent, RH rocker panel skirt grazed, etc. Please see para. 8 of this report for more details.

### 6 REMARKS

This inspection is carried out on a "WITHOUT PREJUDICE" basis and I have not authorized any repairs.

### 7 RECOMMENDATION

Cost of repairs : \$9,600.00 (lump sum)  
Estimated no of days : Three (3)

## 8 ASSESSMENT OF DAMAGE AND COSTS

Report no: 1226M22.MCS

Vehicle no: SNB3935G

### A SPARE PARTS

<u>SPARE PARTS</u>		<u>Assessed</u>	<u>Repairer's</u>	<u>Revised</u>
<u>Description</u>	<u>Qty</u>	<u>Condition</u>	<u>Amount</u>	<u>Amount</u>
RH rear door assy	1	scraped/bent	2,430.00	2,430.00
RH rear fender	1	to repair	1,800.00	0.00
RH front door assy	1	scraped/bent	2,433.00	2,433.00
Front bumper	1	to repair	1,465.00	0.00
RH front fender	1	scraped/bent	930.00	930.00
RH front fender splash shield	1	bent/deformed	140.00	140.00
RH front fender splash shield clip	8	necessary	40.00	40.00
RH front fender sound proof foam	1	squashed/deformed	45.00	45.00
Wiper washer tank	1	squashed	128.00	128.00
Rear bumper	1	to repair	1,345.00	0.00
RH rocker panel skirt	1	to repair	455.00	0.00
Subtotal of the above			11,211.00	6,146.00
Discount			10% / 10%	1,121.10
				614.60
<u>(Special nett)</u>				
Subtotal 1:			10,089.90	5,531.40
Sport rim set	1	Frt & Rear – dented/scraped/cut	4,020.00	4,020.00
Subtotal 2:			4,020.00	4,020.00
Total cost of parts:			14,109.90	9,551.40

### B LABOUR

To check door wiring and electrical system for condition.	60.00	45.00
To remove and transfer rear door glass.	120.00	90.00
To remove and transfer front door glass.	120.00	90.00
To apply anti-rust undercoat.	200.00	90.00
Labour charges to remove and replace, to cut and weld, to panel beating affected and damaged parts.	750.00	500.00
Spray painting charges to paint the front fender, front door, rear door, rear fender, rocker panel garnish, rear bumper and necessary areas.	2,100.00	1,500.00
	90.00	90.00
To conduct 4-wheel computerised alignment to check and realign wheels.		
Total cost of labour:	3,440.00	2,405.00
Total cost of repair:	17,549.90	11,956.40

Report no: 1226M22.MCS  
Vehicle no: SNB3935G

**9 CONCLUSION**

The revised or adjusted cost of repairs to restore the vehicle is

\$11,956.40

(a) However, the recommended cost of repair based on lump sum basis would be

\$9,600.00

(b) The estimated number of days taken to complete the repairs would be

Three (3)

(1<sup>st</sup> re-inspection conducted on 28 December 2022)


(Post Repair Inspection conducted on 30 December 2022)

*The above recommendations in my view are fair and reasonable for the restoration of the vehicle to its pre-accident condition.*

**Note: Lump Sum Repair Basis**

*This means the repairer is allowed to replace the damaged parts with used, reconditioned or new parts, or repair it to a roadworthy condition.*

Yours faithfully

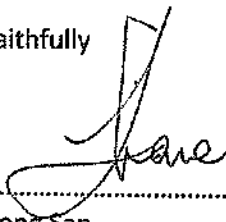

Liaw Leong San  
Licensed Automotive Appraiser

Dated: 25 January 2023



Report no: 1226M22.MCS  
Vehicle no: SNB3935G








Report no: 1226M22.MCS  
Vehicle no: SNB3935G





Report no: 1226M22.MCS  
Vehicle no: SNB3935G

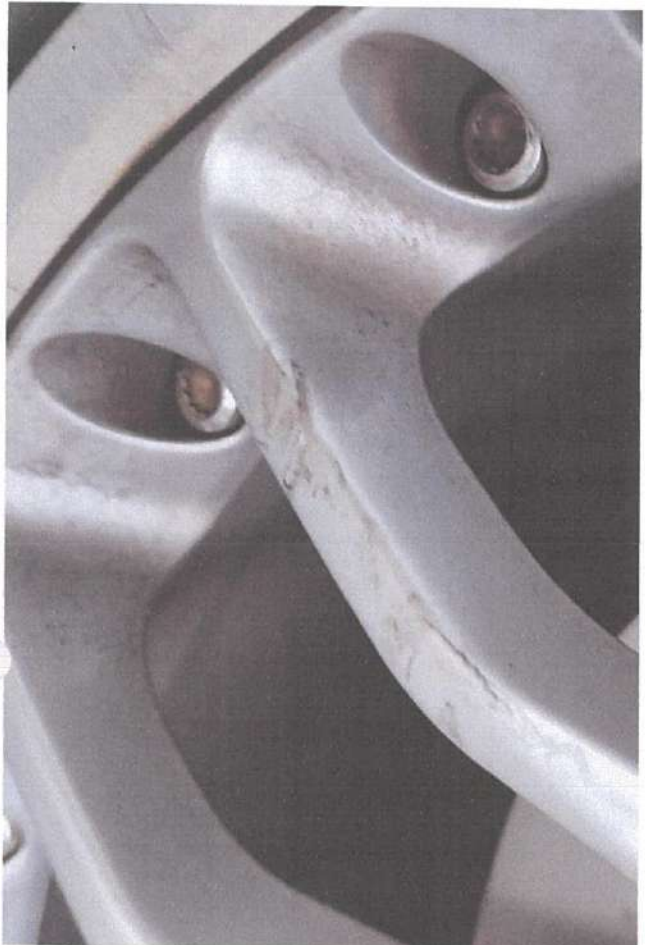



Report no: 1226M22.MCS  
Vehicle no: SNB3935G





Report no: 1226M22.MCS  
Vehicle no: SNB3935G









Report no: 1226M22.MCS  
Vehicle no: SNB3935G





Report no: 1226M22.MCS  
Vehicle no: SNB3935G





Report no: 1226M22.MCS  
Vehicle no: SNB3935G





Report no: 1226M22.MCS  
Vehicle no: SNB3935G

