

ASS. REC. BY:

REF:

SMOJ

Kenneth

## ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MY

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Report:

GIA / PR Seen:

Est. Repairs:

Lum Sum:

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Colour:

Sp. Reading:

Eng/No:

C/No:

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Mod: Nil / S/Rim / STD / R/Rim or

Tyre Size:

F:

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal.

L/Bal.

D.O.A.

Rear

R/Bal.

L/Bal.

D.O.I.

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S - RS - SI

F - RS

Others

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Report Format :

Lump Sum / I.B.I: (\$

TOTAL

**SMRT Accident Vehicle Repair Estimates**

SMRT Automotive Services Pte Ltd  
60 Woodlands Industrial Park E4, Singapore 757705  
FAX Number : 63885592  
Estimator Telephone Number : 68662623  
Accident Reporting Number : 68662672

Date Generated : 22/06/2023  
User ID : munsan

**Section A - Accident Details**

|                                    |                                |
|------------------------------------|--------------------------------|
| Registration Number                | SHB1872M                       |
| Case Reference Number              | TAX/06/23/2060                 |
| Registration Date                  | 11/12/15                       |
| Company Type                       | Strides Taxi Pte Ltd           |
| Make                               | TOYOTA                         |
| Model                              | PRIUS                          |
| Name of Driver                     | CHIA YEW MENG                  |
| Type of Accident                   | Head to Rear                   |
| Accident Date and Time             | 21/6/23 3:15 PM                |
| Accident Reported Date and Time    | 22/6/23 9:24 AM                |
| Is Surveyor Required?              | No                             |
| Survey by                          |                                |
| Vehicle is Towed Back?             | No                             |
| Towed Back Date and Time           |                                |
| Replacement Vehicle Issued?        | No                             |
| Job Card Number                    | 24118714                       |
| Special Instruction to ARC, if any | TP/ FRONT /REAR PORTION/ TOWED |
| Prepared Date and Time             | 22/6/23 9:33 AM                |
| Chassis Number                     |                                |
| Age                                |                                |
| Work Shop                          |                                |
| Repair Completion Date and Time    |                                |

**Section B - Summary of Repair Estimates**

**Summary of Repair Estimates**

|                              | Quotation from ARC                                                                  | Adjusted by Surveyor, if applicable         |
|------------------------------|-------------------------------------------------------------------------------------|---------------------------------------------|
| Total Labour Cost            | \$2,366.00                                                                          | \$0.00                                      |
| Total Spray Cost             | \$3,650.00                                                                          | \$0.00                                      |
| Total Spare Part Cost        | \$20,696.06                                                                         | \$0.00                                      |
| Total Other Cost             | \$2,206.00                                                                          | \$0.00                                      |
| <b>TOTAL COST</b>            | <b>\$28,918.06</b>                                                                  | <b>\$0.00</b>                               |
| Grand Sum Total              | \$28,900.00                                                                         | \$0.00                                      |
| Number of Repair Days        | 12.0                                                                                |                                             |
| Prepared / Adjusted By       | Boon Chew Tay                                                                       |                                             |
| ARC / Surveyor Sign Off Date | 22/06/2023 10:35 AM                                                                 |                                             |
| Signature                    |  | <input checked="" type="checkbox"/> Kenneth |
| Remarks                      |                                                                                     |                                             |

**Section C - Quotation and Accident Invoice Details**

|                  |  |                |  |
|------------------|--|----------------|--|
| Quotation Number |  | Invoice Number |  |
| Quotation Date   |  | Invoice Date   |  |
| Invoice Amount   |  | Prepared Date  |  |

*Not Authorised*  
*7/6/23*

**LKK Auto Consultants** hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:



### Section D - Details of Repair Estimates

### Part 1 - Labour Works

| Job Scope              | Quotation from AR | Adjusted by Surveyor, if applicable |
|------------------------|-------------------|-------------------------------------|
| O REPAIR FRONT PORTION | \$1,014.00        | 8001 4001                           |
| O REPAIR REAR PORTION  | \$1,352.00        | 8001                                |
| <b>total Labour</b>    | <b>\$2,366.00</b> |                                     |

## Part 2 - Spray Painting & Panel Beating Related Works

| Job Scope                                       | Quotation from ARC | Adjusted by Surveyor, if applicable |
|-------------------------------------------------|--------------------|-------------------------------------|
| 0 RESPRAY FRONT BUMPER                          | \$378.00 200l      |                                     |
| 0 RESPRAY FRONT HOOD                            | \$378.00 200l      |                                     |
| 0 RESPRAY FRONT BUMPER LOWER GRILLE             | \$220.00 X         |                                     |
| 0 RESPRAY FRONT SUPPORT PANEL                   | \$220.00 ?         |                                     |
| 0 RESPRAY REAR BUMPER                           | \$378.00 200l      |                                     |
| 0 RESPRAY BUMPER BEAM                           | \$220.00 120l      |                                     |
| 0 RESPRAY REAR PANEL                            | \$220.00 200       |                                     |
| 0 RESPRAY TAIL GATE                             | \$378.00 200       |                                     |
| 0 RESPRAY TAILGATE OUTSIDE GARNISH              | \$220.00 120l      |                                     |
| 0 RESPRAY REAR SPOILER                          | \$220.00 X         |                                     |
| 0 RESPRAY REAR SPARE TYRE PANEL                 | \$220.00 ?         |                                     |
| 0 RESPRAY FLOOR CORNER PANEL RH                 | \$220.00 ?         |                                     |
| 0 RESPRAY REAR FENDER RH                        | \$378.00 200       |                                     |
| <b>Total Spray Painting &amp; Panel Beating</b> | <b>\$3,650.00</b>  |                                     |

### Part 3 - Other Costs - Accident and Accident Repair Related Expense

| Job Scope                                        | Quotation from ARC | Adjusted by Surveyor, if applicable |
|--------------------------------------------------|--------------------|-------------------------------------|
| OWING CHARGE                                     | \$56.00 ✓          |                                     |
| O WASH AND VACUUM                                | \$60.00 X          |                                     |
| O CHECK WIRING AND SYSTEM FUNCTION               | \$120.00 401       |                                     |
| O APPLY RUST-PROOFING ON AFFECTED AREA           | \$200.00 701       |                                     |
| O TOP UP A/C GAS                                 | \$120.00 7         |                                     |
| O CONDUCT RADIATOR PRESSURE CHECK                | \$120.00 7         |                                     |
| O PROVIDE LABOUR & MATERIAL FOR SOLAR FILM (NET) | \$600.00 X         |                                     |
| O TRANSFER REAR TAILGATE MECHANISM               | \$120.00 601       |                                     |
| O TEST AND REFIX REVERSE SENSOR SYSTEM           | \$120.00 301       |                                     |
| O REMOVE AND REFIX REAR WINDSCREEN               | \$370.00 1201      |                                     |
| O REPLACE SUNDRY PARTS                           | \$200.00 X         |                                     |
| O REMOVE & REFIT REAR QUARTER GLASS RH           | \$120.00 301       |                                     |
| <b>Total Other Costs</b>                         | <b>\$2,206.00</b>  |                                     |

#### Part 4 - Spare Parts / Material Usage

| Part Number | Portion | Stock Number | Part Name                    | Quantity | List Price (\$) | Discount (%) | Final Price (\$) | Estimator Approved | Surveyor Approved |
|-------------|---------|--------------|------------------------------|----------|-----------------|--------------|------------------|--------------------|-------------------|
|             |         | 52161-16010  | CLIPS PIECE, FRT & RR BUMPER | 10.00    | \$4.80          | 25.00        | \$36.00          | Replace            | <i>me</i> ✓       |
|             |         | 52115-47040  | BUMPER SUPPORT F/RH          | 1.00     | \$66.20         | 25.00        | \$64.65          | Replace            | <i>Di</i> ✓       |
|             |         | 52611-47080  | BUMPER ENERGY ABSORBER FRT   | 1.00     | \$97.60         | 25.00        | \$73.20          | Replace            | ?                 |
|             |         | 52021-47023  | BUMPER REINFORCEMENT FRT     | 1.00     | \$567.90        | 25.00        | \$425.92         | Replace            | <i>R</i> X        |
|             |         | 57014-47030  | ARM SUB-ASSY,FR BUMPER LH    | 1.00     | \$284.00        | 25.00        | \$213.00         | Replace            | <i>X</i> X        |
|             |         | 57013-47030  | ARM SUB-ASSY,FR BUMPER RH    | 1.00     | \$284.00        | 25.00        | \$213.00         | Replace            | <i>R</i> X        |

[illegible]



**SMRT Accident Vehicle Repair Estimates**

SMRT Automotive Services Pte Ltd  
 60 Woodlands Industrial Park E4, Singapore 757705  
 FAX Number : 63685592  
 Estimator Telephone Number : 68662623  
 Accident Reporting Number : 68662672

Date Generated : 22/06/2023

User ID : munsan

**Part 4 - Spare Parts / Material Usage**

| Part Number | Portion | Stock Number   | Part Name                                     | Quantity | List Price (\$) | Discount (%) | Final Price (\$) | Estimator Approved | Surveyor Approved |
|-------------|---------|----------------|-----------------------------------------------|----------|-----------------|--------------|------------------|--------------------|-------------------|
|             |         | 56117-50140    | TAIL GATE DAM, BACK DOOR GLASS UPPER ADHESIVE | 1.00     | \$31.30         | 25.00        | \$23.48          | Replace <i>mu</i>  | <i>—</i>          |
|             |         | 76085-47910    | SPOILER REAR                                  | 1.00     | \$1,263.70      | 25.00        | \$947.78         | Replace <i>mu</i>  | <i>x</i>          |
|             |         | 61601-47090    | FENDER RR/RH                                  | 1.00     | \$980.80        | 25.00        | \$735.60         | Replace <i>mu</i>  | <i>—</i>          |
|             |         |                | STRIDES LOGO                                  | 1.00     | \$7.80          | 0.00         | \$7.80           | Replace <i>mu</i>  | <i>—</i>          |
|             |         |                | STICKER DECAL 65558888                        | 1.00     | \$21.60         | 0.00         | \$21.60          | Replace <i>mu</i>  | <i>—</i>          |
|             |         | 62710-47130    | QUARTER GLASS RR/RH                           | 1.00     | \$556.70        | 25.00        | \$417.53         | Replace            | <i>?</i>          |
|             |         |                | SEALANT W/SCREEN                              | 1.00     | \$37.00         | 0.00         | \$37.00          | Replace <i>mu</i>  | <i>—</i>          |
|             |         | 52119-47930    | BUMPER FRT                                    | 1.00     | \$602.60        | 25.00        | \$451.95         | Replace <i>mu</i>  | <i>—</i>          |
|             |         | 52116-47040    | BUMPER SUPPORT F/LH                           | 1.00     | \$86.20         | 25.00        | \$64.65          | Replace <i>mu</i>  | <i>x</i>          |
|             |         |                | NUMBER PLATE FRAME                            | 1.00     | \$25.00         | 0.00         | \$25.00          | Replace <i>mu</i>  | <i>—</i>          |
|             |         |                | NUMBER PLATE                                  | 1.00     | \$35.00         | 0.00         | \$35.00          | Replace <i>mu</i>  | <i>—</i>          |
|             |         | 81170-47500    | HEAD LAMP LH                                  | 1.00     | \$1,075.40      | 10.00        | \$967.86         | Replace            | <i>?</i>          |
|             |         | 68294-47050    | DAM, BACK DOOR GLASS ADHESIVE, NO.2           | 1.00     | \$22.30         | 25.00        | \$16.73          | Replace <i>mu</i>  | <i>—</i>          |
|             |         | 61621-47030    | TROUGH, BACK DOOR                             | 1.00     | \$126.80        | 25.00        | \$95.10          | Replace            | <i>?</i>          |
|             |         |                | SEALANT W/SCREEN ( 3PCS )                     | 3.00     | \$37.00         | 0.00         | \$111.00         | Replace <i>mu</i>  | <i>—</i>          |
|             |         | 68810-47010    | TAILGATE DOOR HINGE L/RH (2 PCS )             | 2.00     | \$61.20         | 25.00        | \$91.80          | Replace <i>mu</i>  | <i>x</i>          |
|             |         | 67881-47022    | TAILGATE DOOR WEATHER STRIP                   | 1.00     | \$402.50        | 25.00        | \$301.88         | Replace <i>mu</i>  | <i>x</i>          |
|             |         | 76801-47070-B0 | TAILGATE OUTSIDE GARNISH                      | 1.00     | \$574.80        | 25.00        | \$431.10         | Replace <i>mu</i>  | <i>—</i>          |
|             |         | 75310-47020    | EMBLEM REAR                                   | 1.00     | \$68.70         | 25.00        | \$51.53          | Replace <i>mu</i>  | <i>—</i>          |
|             |         | 75374-47051    | NAME PLATE (HYBRID)                           | 1.00     | \$59.20         | 25.00        | \$44.40          | Replace <i>mu</i>  | <i>—</i>          |
|             |         | 75442-47030    | NAME PLATE (PRUIS)                            | 1.00     | \$69.40         | 25.00        | \$52.05          | Replace <i>mu</i>  | <i>—</i>          |
|             |         | 75443-47030    | NAME PLATE (TOYOTA)                           | 1.00     | \$59.20         | 25.00        | \$44.40          | Replace <i>mu</i>  | <i>—</i>          |
|             |         | 65637-47021    | FENDER LINE RR/RH                             | 1.00     | \$159.80        | 25.00        | \$119.85         | Replace <i>mu</i>  | <i>x</i>          |
|             |         | 52562-47010    | TAIL LAMP BRACKET, RH                         | 1.00     | \$35.20         | 25.00        | \$26.40          | Replace <i>mu</i>  | <i>—</i>          |
|             |         | 81551-47180    | TAIL LAMP RH                                  | 1.00     | \$618.60        | 10.00        | \$556.74         | Replace <i>mu</i>  | <i>—</i>          |
|             |         | 53113-47040    | GRILLE, RADIATOR LOWER NO.2                   | 1.00     | \$118.30        | 25.00        | \$88.73          | Replace            | <i>?</i>          |
|             |         | 76851-47020    | BUMPER LIP FRT                                | 1.00     | \$182.70        | 25.00        | \$137.02         | Replace <i>mu</i>  | <i>x</i>          |
|             |         | 52618-47050    | BUMPER FRT ABSORBER LOWER                     | 1.00     | \$159.30        | 25.00        | \$119.48         | Replace <i>mu</i>  | <i>x</i>          |
|             |         | 53301-47060    | HOOD PANEL                                    | 1.00     | \$988.50        | 25.00        | \$741.38         | Replace <i>mu</i>  | <i>—</i>          |
|             |         | 53341-47020    | HOOD PANEL INSULATOR                          | 1.00     | \$445.00        | 25.00        | \$333.75         | Replace <i>mu</i>  | <i>x</i>          |
|             |         | 53420-47070    | HOOD HINRE LH                                 | 1.00     | \$63.70         | 25.00        | \$47.78          | Replace <i>mu</i>  | <i>x</i>          |
|             |         | 53410-47070    | HOOD HINGE RH                                 | 1.00     | \$63.70         | 25.00        | \$47.78          | Replace <i>mu</i>  | <i>x</i>          |
|             |         | 53510-47102    | HOOD LOCK                                     | 1.00     | \$146.10        | 25.00        | \$109.57         | Replace <i>mu</i>  | <i>x</i>          |
|             |         | 58307-47060    | END PANEL                                     | 1.00     | \$755.10        | 25.00        | \$566.33         | Replace <i>mu</i>  | <i>x</i>          |
|             |         | 58311-47071    | SPARE TYRE PANEL                              | 1.00     | \$755.10        | 25.00        | \$566.33         | Replace <i>mu</i>  | <i>x</i>          |
|             |         | 87005-47241    | TAILGATE ASY                                  | 1.00     | \$1,280.70      | 25.00        | \$945.53         | Replace <i>mu</i>  | <i>—</i>          |
|             |         | 75574-47020    | TAILGATE DOOR GLASS MOULDING, RH              | 1.00     | \$33.60         | 25.00        | \$25.20          | Replace <i>mu</i>  | <i>—</i>          |
|             |         | 75574-47020    | TAILGATE DOOR GLASS MOULDING, RH              | 1.00     | \$33.60         | 25.00        | \$25.20          | Replace <i>mu</i>  | <i>—</i>          |
|             |         | 68105-47122    | TAILGATE DOOR GLASS                           | 1.00     | \$1,273.10      | 25.00        | \$954.82         | Replace <i>mu</i>  | <i>x</i>          |
|             |         | 75575-47030    | MOULDING BACK WINDOW, LOWER NO.1              | 1.00     | \$33.60         | 25.00        | \$25.20          | Replace <i>mu</i>  | <i>—</i>          |



**SMRT Accident Vehicle Repair Estimates**

SMRT Automotive Services Pte Ltd  
 60 Woodlands Industrial Park E4, Singapore 757705  
 FAX Number : 63885592  
 Estimator Telephone Number : 68662623  
 Accident Reporting Number : 68662672

Date Generated : 22/06/2023

User ID : munsan

**Part 4 - Spare Parts / Material Usage**

| Part Number | Portion | Stock Number | Part Name                      | Quantity | List Price (\$) | Discount (%) | Final Price (\$) | Estimator Approved | Surveyor Approved |
|-------------|---------|--------------|--------------------------------|----------|-----------------|--------------|------------------|--------------------|-------------------|
|             |         | 53293-47040  | DEFLECTOR, RADIATOR RH         | 1.00     | \$94.30         | 25.00        | \$70.73          | Replace            | Sh X              |
|             |         | 53294-47030  | DEFLECTOR, RADIATOR LH         | 1.00     | \$86.90         | 25.00        | \$65.18          | Replace            | Sh X              |
|             |         | 52114-47140  | BRACKET, FR BUMPER             | 1.00     | \$126.10        | 25.00        | \$94.57          | Replace            | R X               |
|             |         | 52128-47903  | COVER, FR BUMPER HOLE LH       | 1.00     | \$21.40         | 25.00        | \$16.05          | Replace            | Sh X              |
|             |         | 52127-47903  | COVER, FR BUMPER HOLE RH       | 1.00     | \$21.40         | 25.00        | \$16.05          | Replace            | Sh X              |
|             |         | 53102-47020  | BUMPER GRILLE SUB-ASSY, LOWER  | 1.00     | \$389.90        | 25.00        | \$292.42         | Replace            | ?                 |
|             |         | 75310-47010  | EMBLEM FRONT                   | 1.00     | \$98.70         | 25.00        | \$74.03          | Replace            | Sh                |
|             |         | 53395-47020  | HOOD END PANEL SEAL            | 1.00     | \$80.60         | 25.00        | \$60.45          | Replace            | R X               |
|             |         | 53289-47032  | COVER, RADIATOR                | 1.00     | \$139.30        | 25.00        | \$104.48         | Replace            | ?                 |
|             |         | 53111-47040  | GRILLE, RADIATOR               | 1.00     | \$389.30        | 25.00        | \$291.98         | Replace            | ?                 |
|             |         | 53201-47902  | SUPPORT SUB-ASSY               | 1.00     | \$1,839.70      | 25.00        | \$1,379.78       | Replace            | R X               |
|             |         | 81130-47500  | HEAD LAMP RH                   | 1.00     | \$1,075.40      | 10.00        | \$967.86         | Replace            | ?                 |
|             |         | 88460-47150  | A/C CONDENSER                  | 1.00     | \$1,695.90      | 25.00        | \$1,271.93       | Replace            | ?                 |
|             |         | 16400-37230  | RADIATOR ASSY                  | 1.00     | \$2,245.70      | 25.00        | \$1,684.27       | Replace            | ?                 |
|             |         | 16534-37010  | SUPPORT RADIATOR, LH           | 1.00     | \$23.40         | 25.00        | \$17.55          | Replace            | ?                 |
|             |         | 16533-28051  | SUPPORT RADIATOR, RH           | 1.00     | \$72.00         | 25.00        | \$54.00          | Replace            | ?                 |
|             |         | 16535-20030  | SUPPORT, RADIATOR (2 PCS)      | 2.00     | \$24.80         | 25.00        | \$37.20          | Replace            | ?                 |
|             |         |              | COOLANT ( ADD QTY )            | 4.00     | \$12.32         | 0.00         | \$49.28          | Replace            | ?                 |
|             |         | 16711-37040  | FAN SHROUD                     | 1.00     | \$321.40        | 25.00        | \$241.05         | Replace            | Sh X              |
|             |         | 16712-37030  | FAN SHROUD TOP                 | 1.00     | \$131.50        | 25.00        | \$98.63          | Replace            | Sh X              |
|             |         | 16361-37010  | FAN BLADE                      | 1.00     | \$236.90        | 25.00        | \$177.68         | Replace            | Sh X              |
|             |         | 16361-28360  | FAN BLADE NO.2                 | 1.00     | \$305.50        | 25.00        | \$229.13         | Replace            | Sh X              |
|             |         | 16363-37010  | FAN MOTOR NO.1                 | 1.00     | \$708.40        | 10.00        | \$637.56         | Replace            | Sh X              |
|             |         | 16363-37020  | FAN MOTOR NO.2                 | 1.00     | \$708.40        | 10.00        | \$637.56         | Replace            | Sh X              |
|             |         | 8837047092   | AIR CON COMPRESSOR ASSY        | 1.00     | \$5,160.70      | 25.00        | \$3,870.52       | Replace            | Sh X              |
|             |         | 52159-47905  | BUMPER REAR                    | 1.00     | \$478.90        | 25.00        | \$359.17         | Replace            | CRS ✓             |
|             |         | 90467-07211  | BUMPER CLIPS (10 PCS)          | 10.00    | \$2.40          | 25.00        | \$18.00          | Replace            | Sh ✓              |
|             |         | 52023-12240  | BUMPER REINFORCEMENT REAR      | 1.00     | \$234.70        | 25.00        | \$176.02         | Replace            | Sh ✓              |
|             |         | 52015-47050  | ARM SUB-ASSY. RR BUMPER RH     | 1.00     | \$157.90        | 25.00        | \$118.43         | Replace            | ?                 |
|             |         | 52016-47030  | ARM SUB-ASSY. RR BUMPER LH     | 1.00     | \$157.90        | 25.00        | \$118.43         | Replace            | ?                 |
|             |         | 89997-30070  | ANTENNA, ELECTRICAL LOWER REAR | 1.00     | \$208.10        | 10.00        | \$187.29         | Replace            | ?                 |
|             |         |              | SENSOR REVERSE                 | 1.00     | \$180.00        | 0.00         | \$180.00         | Replace            | Per ✓             |
|             |         | 52576-47020  | BUMPER SIDE RETAINER RR/LH     | 1.00     | \$108.70        | 25.00        | \$81.53          | Replace            | Sh ✓              |
|             |         | 52575-47020  | BUMPER SIDE RETAINER RR/RH     | 1.00     | \$108.70        | 25.00        | \$81.53          | Replace            | CRS ✓             |
|             |         | 52592-47021  | BUMPER SEAL, RR LH             | 1.00     | \$101.80        | 25.00        | \$76.35          | Replace            | ?                 |
|             |         | 52591-47021  | BUMPER SEAL, RR RH             | 1.00     | \$74.40         | 25.00        | \$55.80          | Replace            | ?                 |
|             |         | 76088-47020  | BUMPER LIP COVER RR/LH         | 1.00     | \$93.90         | 25.00        | \$70.43          | Replace            | Sh X              |
|             |         | 76087-47020  | BUMPER LIP COVER RR/RH         | 1.00     | \$155.40        | 25.00        | \$116.55         | Replace            | Sh X              |
|             |         | 76891-47020  | BUMPER LIP REAR                | 1.00     | \$301.90        | 25.00        | \$226.42         | Replace            | Sh X              |
|             |         |              | SEALANT SIKAFLEX               | 1.00     | \$37.00         | 0.00         | \$37.00          | Replace            | Sh X              |

## SMRT Accident Vehicle Repair Estimates

SMRT Automotive Services Pte Ltd  
60 Woodlands Industrial Park E4, Singapore 757705  
FAX Number : 63885592  
Estimator Telephone Number : 68862623  
Accident Reporting Number : 68862672

Date Generated : 22/06/2023

User ID : munsan

| Part 4 - Spare Parts / Material Usage |         |              |                                   |          |                    |              |                    |                    |                   |
|---------------------------------------|---------|--------------|-----------------------------------|----------|--------------------|--------------|--------------------|--------------------|-------------------|
| Part Number                           | Portion | Stock Number | Part Name                         | Quantity | List Price (\$)    | Discount (%) | Final Price (\$)   | Estimator Approved | Surveyor Approved |
|                                       |         | 75575-47020  | MOULDING, BACK WINDOW, LOWER NO.2 | 1.00     | \$33.60            | 25.00        | \$25.20            | Replace <i>sm</i>  | <i>—</i>          |
|                                       |         | 64821-47030  | TAILGATE LOWER WINDOW GLASS       | 1.00     | \$827.50           | 25.00        | \$620.63           | Replace <i>sm</i>  | <i>X</i>          |
| <b>total</b>                          |         |              |                                   |          | <b>\$33,927.12</b> |              | <b>\$26,426.82</b> |                    |                   |

| Added Spare Parts / Material Usage After Surveyor Signed off |         |              |           |          |               |              |                  |           |                |
|--------------------------------------------------------------|---------|--------------|-----------|----------|---------------|--------------|------------------|-----------|----------------|
| Part Number                                                  | Portion | Stock Number | Part Name | Quantity | List Price \$ | Discount (%) | Final Price (\$) | ARC Check | Surveyor Check |
| <b>total</b>                                                 |         |              |           |          |               |              |                  |           |                |



## SINGAPORE ACCIDENT STATEMENT

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

### ACCIDENT STATEMENT

|                                 |                                             |
|---------------------------------|---------------------------------------------|
| Date of Submission              | 22/06/2023 11:07 (SGT)                      |
| Reported by                     | Actual Driver                               |
| Date of Accident                | 21/06/2023 15:15 (SGT)                      |
| Exact Location of Accident      | Yio Chu Kang Rd, Singapore                  |
| Additional Location Information | YIO CHU KANG ROAD TOWARDS SERANGOON CENTRAL |
| Country/State of Loss           | Singapore                                   |

### DETAILS OF OWN VEHICLE

Vehicle Registration Number SHB1872M

#### INSURED/POLICYHOLDER

|                          |                            |
|--------------------------|----------------------------|
| Is company?              | Yes                        |
| Name Of Registered Owner | Strides Taxi Pte Ltd       |
| Company Reg No           | 1XXXXX369K                 |
| Email Address            | AUTO-SVCS-TARC@SMRT.COM.SG |
| Mobile Phone No          | (Phone) +65-68662671       |
| Alternative Phone No     | -                          |

#### VEHICLE PARTICULARS

|                                                                              |                           |
|------------------------------------------------------------------------------|---------------------------|
| Manufacturer                                                                 | Toyota                    |
| Model                                                                        | Prius                     |
| Variant                                                                      | -                         |
| Exact purpose for which vehicle was being used at time of accident           | -                         |
| Are you claiming under your own insurance policy for repair to your vehicle? | No - Claiming third party |
| Vehicle Category                                                             | Taxi                      |
| Transmission                                                                 | Auto                      |
| CC                                                                           | 1800                      |

#### INSURANCE COMPANY

|                                   |                                |
|-----------------------------------|--------------------------------|
| Name of Insurance Company         | MS First Capital Insurance Ltd |
| Policy Number / Cover Note Number | D-23100854MFSH                 |

#### DRIVER

|                |               |
|----------------|---------------|
| Name of Driver | CHIA YEW MENG |
| NRIC No        | SXXXX643H     |
| Date Of Birth  | 30/06/1963    |
| Occupation     | Outdoor       |

**IMPORTANT NOTICE**

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to reputate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Traffic Police Department for investigation.**
6. This report will be forwarded by the insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:

(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;

(ii) investigating the accident and/or my claims;

(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;

(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or

(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.

(collectively the "Purposes")

(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and


(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third-party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

Policyholder's Signature / Date & Time

Actual Driver's Signature (if driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel  
(Name as in NRIC/ID card)

## Sketch Plan

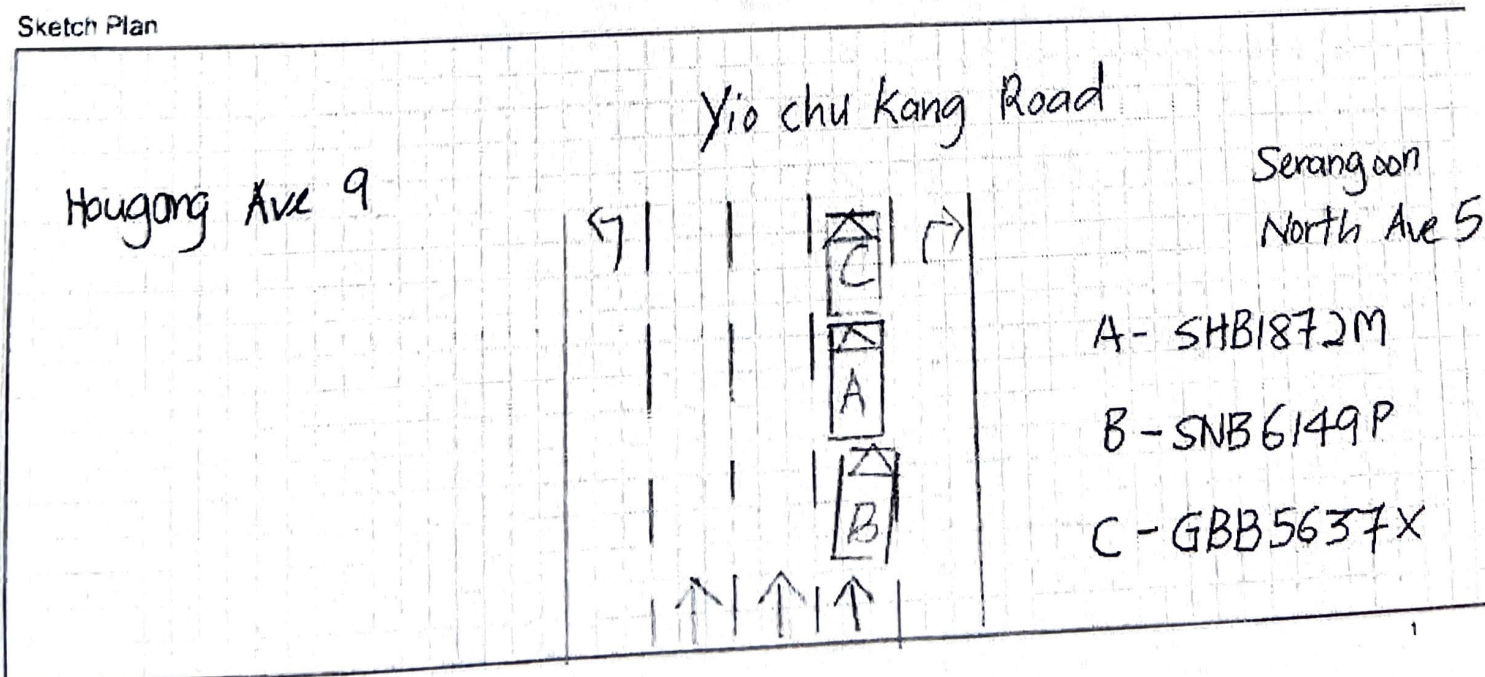



> Back to OneMotoring

## Enquire PARF/COE Rebate for Registered Vehicle

### Vehicle Owner Particulars

Owner ID Type: Company

Owner ID: 369K

### Vehicle Details

Vehicle No.: SHB1872M

Vehicle to be Exported: No

Intended Deregistration Date: 22 Jun 2023

Vehicle Make: TOYOTA

Vehicle Model: PRIUS TAXI (SMRT)

Primary Colour: Maroon

Manufacturing Year: 2015

Engine No.: 2ZR6562727

Chassis No.: JTDKN36U705766963

Maximum Power Output: 100.0 kW (134 bhp)

Open Market Value: \$29,508.00

Original Registration Date: 11 Dec 2015

First Registration Date: 11 Dec 2015

Transfer Count: 0

Actual ARF Paid: \$5,000.00

### Intended PARF Rebate Details

PARF Eligibility: Yes

PARF Eligibility Expiry Date: 10 Dec 2023

PARF Rebate Amount: \$3,000.00

### Intended COE Rebate Details

COE Expiry Date: 10 Dec 2023

COE Category: A - Car up to 1600cc & 97kW (130bhp)

COE Period(Years): 8

PQP Paid: \$45,466.00

COE Rebate Amount: \$2,647.00

Total Rebate Amount: \$5,647.00

### Message

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 22 Jun 2023

OK