



PROMINENT APPRAISER SERVICES PTE LTD

Qualified Loss Adjusters And Motor Appraisers

Correspondence Mail Address: My Mail Box 886259 Singapore 919191.

Mobile: 9295 2204 Fax: 6722 8508 Email: pasvcs@hotmail.com

Business Reg. 201404434D

VEHICLE INSPECTION REPORT

Report No. : PAS/TP/0410123

Date of Report : 22/02/2023

To : M/s. ComfortDelGro Rent-A-Car Pte Ltd
C/o. 160 Sin Ming Drive
#05-08 Sin Ming Autocity
Singapore 575722

Date of Assignment : 31/01/2023
Report requested by : M/s. ComfortDelGro Rent-A-
Date of Accident : 25/01/2023
Date of Inspection : 31/01/2023
Claim No. : Third Party Claim
Policy No. : -

PARTICULARS OF DAMAGED VEHICLE

Vehicle Registration No. : SNC819Z
Make & Model : Toyota Noah (Hybrid)
Date of Registration : 28/09/2021
Colour : Met. Silver

Engine Capacity (cc) : 1797
Mileage (km) : 96619km
Chassis / Frame No. : ZWR800504928
Engine No. : 2ZR2M74527

TYRE CONDITION

Front LH : 7 mm
Make : Davanti

Front RH : 7 mm
Make : Davanti

Rear LH : 7 mm
Make : Davanti

Rear RH : 7 mm
Make : Davanti

Road wheels Type : Alloy

(The above represents the approximate remaining life of tyre treads)

PRE-ACCIDENT CONDITION OF DAMAGED VEHICLE (Static tests only)

General Bodywork : Good
Paintwork : Good
Handbrake : Serviceable
Footbrake : Serviceable
Steering : Serviceable
Apparent Engine Modification : Nil

PLACE OF REPAIRER OFFICE/WORKSHOP

Location : M/s. Kum Chew Motor Workshop
160, Sin Ming Drive, #05-08, Sin Ming Autocity, Singapore 575722

ASSESSMENT

Repairer's Estimate : \$ 3,987.20
Revised Amount : \$ 2,825.25
Less Excess : \$ -
Recommended Reserve : \$ 2,260.00 (Lump Sum)

Estimated Normal Period of Repairs : 4 Working Days

Disclaimer: The information contained in this report is intended for exclusive use of the addressees (including any attachments) solely in relation to the loss occurrence in which the assessed vehicle involved. It is confidential and may be protected by legal privilege. No liability or responsibility whatsoever shall be held by PROMINENT APPRAISER SERVICES PTE LTD for any reliance on this report by any third party. If you are not the intended recipient, please contact us immediately to arrange for its return and you should not disseminate, distribute, copy any information contained herein or use of this communication is strictly prohibited.



PROMINENT APPRAISER SERVICES PTE LTD

Qualified Loss Adjusters And Motor Appraisers

Correspondence Mail Address: My Mail Box 886259 Singapore 919191.

Mobile: 9295 2204 Fax: 6722 8508 Email: pasvcs@hotmail.com

Business Reg. 201404434D

Vehicle No : SNC819Z

Report No. : PAS/TP/0410123

GENERAL REMARKS

WITHOUT PREJUDICE

THE ASSIGNMENT

The survey was conducted at M/s. Kum Chew Motor Workshop, 160, Sin Ming Drive, #05-08, Sin Ming Autocity, Singapore 575722.

(Subsequent inspections have been conducted)

POINT OF IMPACT

At the rear RH portion.

DAMAGES

The tailgate, rear bumper, RHR side bumper, rear end panel, RHR fender, etc.

Other parts were also found damaged. (See schedule for details)

ADJUSTMENT / RECOMMENDATION

We have inspected thoroughly each and every item on the repairer's estimate against the actual damaged found on the vehicle. We list the breakdown of our findings and our recommendation as per schedule attached.

Our adjusted amount for the cost of repairs is SGD \$2,825.25.

CONCLUSION

The repairer has agreed to undertake the repairs at a lump sum of SGD \$2,260.00.


This inspection was conducted entirely on a 'Without Prejudice' basis. We have not given an authorization and/or instruction to the repairer to proceed with the repairs.

We hereby reverting the matter to you for your discretion on repairs.

Assuring you of our best services always.

Yours Truly,

Prominent Appraiser Services Pte Ltd

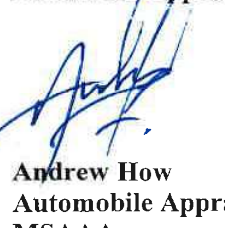

Andrew How
Automobile Appraiser
MSAAA
Licensed Appraiser



PROMINENT APPRAISER SERVICES PTE LTD

Qualified Loss Adjusters And Motor Appraisers

Correspondence Mail Address: My Mail Box 886259 Singapore 919191.

Mobile: 9295 2204 Fax: 6722 8508 Email: pasvcs@hotmail.com

Business Reg. 201404434D

Vehicle No : SNC819Z

Report No. : PAS/TP/0410123

APPRAISEMENT SCHEDULE

S/No.	Qty	Parts Descriptions	Condition	Repairer's Estimate (S\$)	Our Assessment (S\$)
1	1 pc	Rr bumper (w/col.)	Dented/Deformed	\$ 1,578.00	\$ 1,578.00
2	2 pcs	Rr bumper side R/L	Cracked/Deformed	\$ 357.20	\$ 357.20
3	1 pc	Rr bumper reflector RH	Loop Broken	\$ 75.20	\$ 75.20
4	6 pcs	Rr bumper clip	Necessary	\$ 19.20	\$ 19.20
5	2 pcs	Rr bumper retainer R/L	Cracked/Necessary	\$ 178.40	\$ 178.40
6	1 pc	Rr bumper side support RH	Dented	\$ 92.33	\$ 92.33
7	1 pc	Rr end panel assy	Dented/Repair	\$ 802.60	\$ -
8	1 pc	Tailgate	Dented/Repair		(Refer labour no. 2 & 3)
9	1 pc	Rr fender RH	Dented/Repair		(Refer labour no. 2 & 3)
10	1 pc	Rr end panel assy	Dented/Repair		(Refer labour no. 2 & 3)
				\$ 3,102.93	\$ 2,300.33
Less Discount : 25%				\$ 775.73	\$ 575.08
List Parts Sub-Total :				\$ 2,327.20	\$ 1,725.25
Parts Total :				\$ 2,327.20	\$ 1,725.25

S/No.	Labour Descriptions	Repairer's Estimate (S\$)	Our Assessment (S\$)
1	To remove and reinstall electrical wiring system for necessary repairs. To check rear electrical wiring system. To transfer rear reverse sensors to new bumper.	\$ 60.00	\$ 50.00
2	To remove and reinstall rear interior trims, garnishes, etc. for necessary repairs. To straighten, repair, realign on affected area and replace damaged parts.	\$ 800.00	\$ 400.00
3	To spray painting, blending on affected and adjacent area.	\$ 800.00	\$ 650.00
Labour Total :		\$ 1,660.00	\$ 1,100.00
Total (Parts & Labour) :		\$ 3,987.20	\$ 2,825.25

For Lump Sum Repairs

The final adjusted Lump Sum contract amount is \$ 2,260.00

Under normal circumstances, the repairs should be completed within a reasonable period

of **4 Working Days.** (Exclude waiting days of PRI, Sunday, Public Holiday and awaiting of shipment for spare parts)

20 Photographs were taken at the time of inspection.

N.B: By accepting to carry out the repairs on a contract Lump Sum basis, the repairer shall have the prerogative and discretion to replace the damaged parts with new, used, OEM or reconditioned parts and/or to repair the vehicle on a roadworthy condition to the entire satisfaction of owner.

Note: The revised estimate has been adjusted from a visual inspection. Any discrepancies or unseen damages should be notified to the company within 7 days from the date hereof. Otherwise this revised amount shall be deemed as valid.







