

ASS. REC. BY:

REF:

MSG/ 23006817/Kg

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD/TP/WS/TP RES/OD RES/EVA/INV/MY

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

N/S	O/S

Bal. or Market Value:

\$80k

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

05

days

Res.: Yes or No

Lum Sum:

1.B.1 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SGC 715A

Yr Regn:

10.17

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Hyundai

TUGSONG

1591

Colour

m. Blue

A/C:

Insured / Std / NI / NA

Sp. Reading

82335

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

KM4J3813M JU 527848

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Mod: Nil / S/Rlm / STD A/Rlm or

Tyre Size:

F:

225/55R18

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

8

mm

R/Bal.

9

mm

L/Bal.

8

mm

L/Bal.

9

mm

D.O.A.

1/7/23

D.O.I.

6/7/2023

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

O/S Frt & U/C

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Date/Time, File Pass to?

☐

: Prel. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation

S - RS. SI

F. & S.

Others

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech Invs (\$

☐

: Weekend (\$

Report Format :

Lump Sum / I.B.I: (\$

TOTAL

K.Kim Hin Auto Pte Ltd
160 Sin Ming Drive, #02-20, Sin Ming
AutoCity
575722

Insurer Reference:
Repairer Reference: SGL715A-TP
Date calculated: 04/07/2023 7:50 PM

Full Report
Registration: SGL715A
Printed: 04/07/2023 7:51 PM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	MSIG Insurance (Singapore) Pte Ltd
Printed by:	SANDRA KHONG	Currency:	SGD
Claim Reference:		Date of Incident:	01/07/23
Estimated Repair Time:	6	Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle			
Manufacturer:	HYUNDAI		
Model:	TUCSON (TL)		
Sub Model:	BASE MODEL		
Model Sheet Number:	30 46 01		
Registration:	SGL715A		
VIN number:	KMHJ3813MJU527848		
Odometer:			
Model Specs			
PAINTED RAD GRILLE	FOG LAMPS	LED DRL HEADLAMPS	WHEELS 7J X 18 ALLOY
FRONT DRIVE			

*Not Withheld
Repairing Body
5 days*

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☒

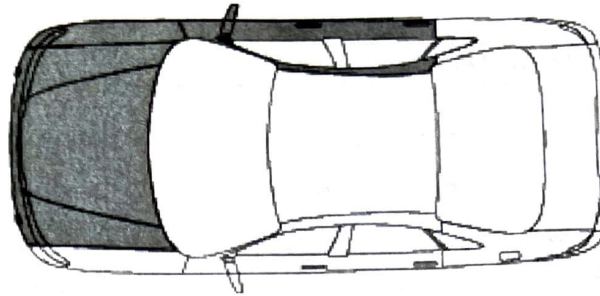

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	----------------------------	---------------------------	---------------------------	----------------------------	----------------------------	-----------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 10 WU/h	Price = 50.00 SGD/h	
			WU	Price SGD
NO NUMBER	R + R FRONT PANEL		16.0	80.00
86525R00 ZAX	RENEW FRONT BUMPER INCLUDES: R + R FRONT BUMPER, GRILLE AND NECESSARY ATTACHED PARTS		13.0	65.00
92000R00)	R + R LEFT HEADLAMP		1.0	5.00
66300R5A	RENEW R/F WING INCLUDES: HEADLAMP, WING TRIM SILL TRIM AND ATTACHED PARTS REMOVE AND REFIT. ADJUST HEADLAMPS. NOT INCLUDED : FRONT BUMPER REMOVE AND REFIT.		6.0	30.00
25300R00)	R + R RADIATOR		11.0	55.00
NO NUMBER	DETACH + REFIT R/FR BRAKE CALIPER		1.0	5.00
54840R0R)	R + R R/F STABILIZER LINKAGE		2.0	10.00
56810R0R)	R + R R/TIE ROD END		7.0	35.00
54509R0R)	R + R R/F LOWER CONTROL ARM		3.0	15.00
54650R0R ZAX	R + R RIGHT FRONT SHOCK ABSORBER		4.0	20.00

Code	Description	WU	Price SGD
54630R0R ZAX	DIS + ASS R/F SHOCK ABSORBER/COIL SPRING	4.0	20.00
51715R0R)	R + R R/F STEERING KNUCKLE	3.0	15.00
NO NUMBER	R + R R/F WHEEL	1.0	5.00
52910R00)	R + R RIGHT FRONT TYRE	3.0	15.00
54509R0B)	R + R L/F AND R/F CONTROL ARM	3.0	15.00
51715R0B)	R + R FRONT STEERING KNUCKLE L+R	4.0	20.00
51712R0B)	R + R L/F AND R/F BRAKE DISC	1.0	5.00
2226	AT R/OUTER PILLAR REPAIR	40.0*	200.00
7011	FRT AUXILIARY FRAME CHECK		

Labour Cost	Hrs	WU	Price SGD
Panel / Mechanical Labour	12.30	123.0	615.00
Total of Labour			615.00

Paint

Paint Work

SYSTEM AZT

Time Basis 10 WU/h

Code	Description	WU	Price SGD
	BONNET NEW PART PAINTING	22.0	
	R/F WING NEW PART PAINTING	10.0	
	RIGHT FRONT DOOR NEW PART PAINTING	16.0	
	FRONT BUMPER NEW PART PAINT K1R	8.0	
	GRILLE NEW PART PAINT K1R	4.0	
	AT R/OUTER PILLAR REPAIR PAINTING >50%	21.0	

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	61.66
0746	R/F WING NEW PART PAINTING	15.31
1482	RIGHT FRONT DOOR NEW PART PAINTING	38.29
0283	FRONT BUMPER NEW PART PAINT K1R	27.92
0410	GRILLE NEW PART PAINT K1R	6.28
2226	AT R/OUTER PILLAR REPAIR PAINTING >50%	22.47

Labour Cost - Paint

Factor	50.00 SGD/h	Hrs	WU	Price SGD
Time Paint			81.0	
Preparation Main Work Metal		1.70	17.0	85.00
Preparation Comp. Work Plastic		0.30	3.0	15.00
Total	10 WU/h	10.10	101.0	505.00

33023

Material Cost - Paint

New Part Painting
New Part Painting - Plastic K1R
Repair Painting
Material-constant Metal
Material-constant Plastic
Total

Price SGD
115.26
34.20
22.47
18.10
9.00
199.03

usf f 15%

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2015-06-01	
				Price SGD	
0283	FRONT BUMPER	86511D3100	Original	290.00	✓
0285	FRT LWR BUMPER COVER	86512D3000	Original	250.00	✓
0304	R/BUMPER MOULDING	86526D7110	Original	25.00	X
0318	R/F UPP BUMPER BRKT	86578D3000	Original	25.00	?
0341	FRT IMPACT ABSORBER	86520D3000	Original	70.00	X
0344	R/F INN BUMPER BRKT	86552D3000	Original	15.00	✓
0350	FRT BUMPER CLAMP KIT	USE SINGLE PARTS	Original	24.00	✓
0410	GRILLE	86350D3000RAM	Original	485.00	X
0562	RIGHT HEADLAMP ASSY	92102D3120	Original	1,150.00	✓
0638	R/F FOG LAMP CPL	92202D3000	Original	125.00	
0646	R/F BUMPER COVER	86528D3010	Original	35.00	X
0648	R/LED DAYT RUN LAMPS	92208D3000	Original	330.00	X
0746	R/F WING	66321D3000	Original	240.00	✓
0772	R/F WING INSULATOR	84142D3000	Original	38.00	?
0790	R/F WING CLAMP KIT	USE SINGLE PARTS	Original	14.40	✓
0792	R/F WING MOULDING	87712D3000CA	Original	90.00	✓
0842	R/F WHEELHOUSE COVER	86812D3000	Original	85.00	✓
0898	R/F MUDFLAP	86832D3000	Original	20.00	X
1009	FRONT PANEL	64101D3000	Original	340.00	X
1436	WASHER RESERVOIR	98620D3000	Original	55.00	?
7054	R/F LWR CONTROL ARM	54501D3000	Original	210.00	✓
7078	R/FR SHOCK ABSORBER	54661D3000	Original	165.00	?
7082	R/F STRG KNUCKLE CPL	51716D3000	Original	200.00	?
7096	R/UPP SPRING SEAT	54610D3000	Original	70.00	?
7102	R/F SUSPN BUFFER	54626D3000	Original	35.00	?
7112	R/F UPP DAMPER RING	54623C1000	Original	55.00	?
7132	R/F WHEEL HUB	51750C1000	Original	245.00	?
7202	R/FR WHEEL	52910D3300	Original	0.00	✓
7228	R/FR TYRE	205/65 R 16 .. H	Original	0.00	?
7278	R/STABI MOUNTING	54830D3000	Original	65.00	?
7312	R/TIE ROD BALL JOINT	56825D7000	Original	55.00	?
8780	UNDERBODY PROTECTION	29110D3500	Original	175.00	

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings**Subtotal****Addition(+15.00%)****Total**

0.00
4,981.40
747.21
5,728.61

Extras

Code	Description	Price SGD
------	-------------	-----------

SN

Code	Description	Price SGD	
1000	FRONT RH TYRE 18" RH TYRE 18"	380.00*	Wt
1001	SPORT RIM 18" FRONT RIM	800.00*	M
1002	WHEEL ALIGNMENT WHEEL ALIGNMENT	80.00*	
1003	TOWING TO WKSP TOWING SCENE	80.00*	Bill
Total Extras		1,340.00	7

Final Calculation

	SGD	SGD
Parts	4,981.40	
Addition(+15.00%)	747.21	
Total Parts		5,728.61
Labour Time Base 10 WU/h		
Total 123.0 WU X 50.00 SGD/h	615.00	
Total of Labour		615.00
Total Of Extras		1,340.00
Paint Work Time Base 10 WU/h		
Labour Cost 101.0 WU X 50.00 SGD/h	505.00	
Material Cost	199.03	
Total Paint Including Material		704.03
Repair Cost Excludes GST		8,387.64
GST (+8.0%)		671.01
Repair Cost Included GST		9,058.65

Comments

* - USER SUPPLIED DATA
 NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	03/07/2023 19:58 (SGT)
Reported by	Both Policyholder and Actual Driver
Date of Accident	01/07/2023 15:00 (SGT)
Exact Location of Accident	Singapore
Additional Location Information	BRADDELL ROAD
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SGL715A

INSURED/POLICYHOLDER

Is company?	No
Name Of Registered Owner	HO KEI-LEONG
NRIC No	SXXXX427D
Email Address	KLHO001@YAHOO.COM
Mobile Phone No	(Phone) +65-91261267
Alternative Phone No	-

VEHICLE PARTICULARS

Manufacturer	Hyundai
Model	Tucson
Variant	-
Exact purpose for which vehicle was being used at time of accident	-
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Commercial vehicle
Transmission	Auto
CC	1999

INSURANCE COMPANY

Name of Insurance Company	Income Insurance Limited
Policy Number / Cover Note Number	5107933134-04

DRIVER

Name of Driver	HO KEI-LEONG
NRIC No	SXXXX427D
Date Of Birth	07/07/1969
Occupation	Indoor

MOUNT
ALVERNIA

