

(08/11/13) wef

ASS. REC. BY:

REF:

CS/CT123006859/Rgp3

585H

ASSIGNMENT

From:

Date:

Estimated Cost:

OD (TP) WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No:

SHC 3277A

at Workshop m/s

PERFORMANCE

of

MEXAMARA RS

Insured:

CTI

Policy No.

Claims No.

Sum Insured:

Excess:


(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its

repair at the time of inspection.

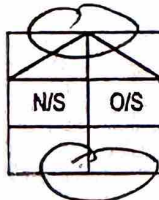

Bal. or Market Value:

135K

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

days

Res.:

Yes or No

Lump Sum:

%

3 Val.:

Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SHC 3277A

Yr Regn: 2018 / MAR

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

B.A.W 520 I LED NAV

c.c

1998

Colour

BLUE

A/C: Insured / Std / NI / NA

Sp. Reading

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

WBA JA 12050 RSJ 19037

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Disorder / Jammed / Leaked / Burnt or

Brake: Disorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

245/45R18

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

6

mm

R/Bal.

6

mm

L/Bal.

6

mm

L/Bal.

6

mm

D.O.A.

21/06/23

D.O.I.

06/07/23

Survey held at

PERFORMANCE

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

REPAIR LIMIT - 75K

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

Add Fee:

☐

: Site Insp (\$

) \$ + RS. \$

☐

: Interview (\$

) Photos

☐

: Tech. Invs (\$

) Others

☐

: Weekend (\$

)

Report Format :

Lump Sum / I.B.I. (\$

TOTAL

Performance Motors Limited

A Sime Darby Motors Company
Co. Reg. No. 197401559W GST Reg. No M2-0020081-x
Toll-Free Number (1800-2255269)

303, Alexandra Road
Sime Darby Performance Centre
Singapore 159941
Fax. 64747770

280, Kampong Arang Road
East Coast Centre
Singapore 438180
Fax. 63449773

315, Alexandra Road
Sime Darby Business Centre
Singapore 159944
Fax. 64796601 (AfterSales)
64796624 (Motorrad)



GST REG. NO : M2 - 0020081 - X

E S T I M A T E

Estimate No. : **b1 66549**
Date Estimated : **03/07/2023**
Prepared By : **Foong Shiuh Jye**

Page No. : **1 of 9**

- ESTIMATE REPAIR FOR -

Liu Hong
99 Cashew Road
#14-07 Cashew Heights Condo

Singapore 679670

- ACCOUNT - 40000

Cash Sales - Service
Singapore

REGN. NO.	CHASSIS NO.	REGN. DATE	MODEL	MILEAGE
SGC3277A	WBAJA12050BJ19037	29/03/2018	520i	71673

DESCRIPTIONVALUE

To tow accident vehicle to PML workshop. **X**

X 150.00

To supply front and rear emboss number plate.

165.00

To replace radiator assembly, fan housing with fan including pressure test, bleed cooling system and conduct check for leak. (All models except 7 series).

X 826.00

To replace auxiliary radiator assembly including pressure test, bleed cooling system and conduct check for leak.

X 767.00

To replace charge air cooler including conduct check for leak and proper function.

X 531.00

To replace rear exhaust silencer including alignment system and conduct check for leak.

? 531.00

To replace front exhaust silencer including alignment system and conduct check for leak.

X 531.00

To replace each diesel particulate filter including alignment and conduct check for leak.

X 664.00

To remove and install front suspension to facilitate the jacking of chassis and mounting of car on culette bench.

X 1,062.00

To check steering geometry and conduct wheel alignment in accordance with BMW specifications. (1x).

X 531.00

To remove and install rear suspension, rear axle and control system to facilitate the work on culette bench including replace damaged parts.

X 2,655.00

To perform brake test including bleed brake system with DSC and conduct check for leak.

X 1,003.00

Performance Motors Limited

A Sime Darby Motors Company
Co. Reg. No. 197401559W GST Reg. No M2-0020081-X
Toll-Free Number (1800-2255269)

303, Alexandra Road
Sime Darby Performance Centre
Singapore 159941
Fax. 64747770

280, Kampong Arang Road
East Coast Centre
Singapore 438180
Fax. 63449773

315, Alexandra Road
Sime Darby Business Centre
Singapore 159944
Fax. 64796601 (AfterSales)
64796624 (Motorrad)



GST REG. NO : M2 - 0020081 - X

E S T I M A T E

Estimate No. : **b1 66549**
Date Estimated : **03/07/2023**
Prepared By : **Foong Shiuh Jye**

Page No. : **2 of 9**

REGN. NO.	CHASSIS NO.	REGN. DATE	MODEL	MILEAGE
SGC3277A	WBAJA12050BJ19037	29/03/2018	5201	71673

DESCRIPTION

VALUE

To mount accident vehicle on celette bench or Car-O-liner to facilitate re-alignment of body / chassis accordance with BMW specification.	X	2,950.00
To conduct chassis alignment measuring check using Car-O-Liner measuring system accordance with BMW specification.	X	531.00
To replace rear windscreen glass.		574.00
To conduct water leak tests.	X	75.00
To replace front dashboard panel and conduct check for proper function.	X	797.00
To remove and install rear hat-tray, rear seat, carpet and roof top lining to facilitate repair.	829	873.00
To remove and install boot compartment carpet and garnish to facilitate repair.		271.00
To replace rear leather seat covers including remove and install seats to facilitate replacement job.	X	814.00
To remove and install battery cables including perform high current test and charge up battery.	X	531.00
To check electrical wiring system at the front and rear sections for proper function including adjustment of headlights.		295.00
To transfer lock mechanism from old to new bootlid including conduct check on new bootlid central locking system for proper function.	508	531.00
To replace left headlight.	X	481.00
To replace air con condenser and air con hose including vacuum system, top up freon gas and conduct check for leak. (For all models except for 7 series).	X	1,003.00
To replace front or rear PDC sensor wire harness including reset and conduct check for proper function.	?	266.00
To replace rear view camera including program and conduct check for proper		266.00

Performance Motors Limited

A Sime Darby Motors Company
Co. Reg. No. 197401559W GST Reg. No. M2-0020081-X
Toll-Free Number (1800-2255269)

303, Alexandra Road
Sime Darby Performance Centre
Singapore 159941
Fax: 64747770

280, Kampong Arang Road
East Coast Centre
Singapore 438180
Fax: 63449773

315, Alexandra Road
Sime Darby Business Centre
Singapore 159944
Fax: 64796601 (AfterSales)
64796624 (Motorrad)



GST REG. NO : M2 - 0020081 - X

ESTIMATE

Estimate No. : b1 66549
Date Estimated : 03/07/2023
Prepared By : Foong Shiuh Jye

Page No. : 3 of 9

REGN. NO.	CHASSIS NO.	REGN. DATE	MODEL	MILEAGE
SGC3277A	WBAJA12050BJ19037	29/03/2018	520i	71673

DESCRIPTION	VALUE
function.	
To replace both front seat belts and tensioners including reset and conduct check for proper function.	? 531.00
To replace both rear seat belts and tensioners including reset and conduct check for proper function.	? 531.00
To replace roof top headlining and both ITS head air bags including reset and conduct check for proper function.	967 1,048.00
To replace front dashboard passenger air bag including reset and conduct check for proper function.	X 531.00
To carry out body cavity preservation. (Per panel).	? 236.00
To carry out body cavity preservation. (For cut panel).	? 2,655.00
Sundries.	X 150.00

Total Labour 1: 25,326.00

DESCRIPTION	QTY	PRIC	VALUE
RADIATOR X	1	1,163.15	1,163.15
RADIATOR X	1	1,292.40	1,292.40
FRT SILENCER X	1	1,688.25	1,688.25
INTERMEDIATE PIPE X	1	637.40	637.40
REAR SILENCER ?	1	1,569.90	1,569.90
EXCH CATALYTIC CONVERTER CLOSE TO EX	1	3,083.65	3,083.65
REAR LH DOOR ALUMINIUM repair	1	2,006.80	2,006.80
REAR RH DOOR ALUMINIUM X	1	2,006.80	2,006.80
RR TRUNK FLOOR CROSS MEMBER ?	1	138.25	138.25
LH ENGINE HOOD HINGE X	1	107.15	107.15
RH ENGINE HOOD HINGE X	1	107.15	107.15
LUGGAGE COMPARTMENT PAN ?	1	522.80	522.80
Support strut luggage-comp ?	1	1,757.15	1,757.15
LH TRUNK FLOOR ?	1	523.85	523.85
RH TRUNK FLOOR ?	1	518.75	518.75
COMPLETE TAIL TRIM ?	1	907.85	907.85
REAR LUGGAGE COMPARTMENT FLOOR ?	1	271.60	271.60
REAR LH SIDE PANEL ?	1	2,126.50	2,126.50
REAR RH SIDE PANEL ?	1	2,126.50	2,126.50
LH C PILLAR REINFORCEMENT PLATE ?	1	58.55	58.55
RH C PILLAR REINFORCEMENT PLATE ?	1	58.55	58.55
LH REINFORCEMENT PLATE SILL ?	1	56.20	56.20

Performance Motors Limited

A Time Darby Motors Company
Co. Reg. No. 197401559M GST Reg. No. M2-0020081-X
Toll-Free Number (1800-2255259)

102, Alexandra Road
Time Darby Performance Centre
Singapore 159941
Fax: 64747775

290, Kampong Karang Road
East Coast Centre
Singapore 438190
Fax: 63449773

115, Alexandra Road
Time Darby Business Centre
Singapore 159944
Fax: 64796601 (AfterSales)
64796624 (Motorsrad)



GST REG. NO : M2 - 0020081 - X

ESTIMATE

Estimate No. : b1 66549
Date Estimated : 03/07/2023
Prepared By : Foong Shiuh Jye

Page No. : 4 of 9

REGN. NO.	CHASSIS NO.	REGN. DATE	MODEL	MILEAGE
8GC3277A	WBAJA12050BJ19037	29/03/2018	5201	71673

DESCRIPTION	QTY	PRIC	VALUE
RH REINFORCEMENT PLATE SILL ?	1	56.20	56.20
ALUMINIUM ENGINE HOOD <i>bt</i>	1	2,624.30	2,624.30
TAILGATE ALUMINIUM <i>bt</i>	1	1,939.20	1,939.20
LH TRUNK LID HINGE <i>bt</i>	1	137.45	137.45
RH TRUNK LID HINGE <i>bt</i>	1	137.45	137.45
OUTER PANEL TAIL TRIM ?	1	619.65	619.65
COVER GRILLE LH <i>com</i>	1	80.00	80.00
GRILLE AIR INLET MIDDLE (LINES) <i>at</i>	1	100.35	100.35
LH GRILLE AIR INLET OPEN (LINES) <i>and</i>	1	117.10	117.10
LH PROTECTIVE STRIP LINES (LUXURY) <i>at</i>	1	73.75	73.75
LH FOG LAMP SUPPORT X	1	124.55	124.55
RH FOG LAMP SUPPORT X	1	124.55	124.55
LH GUIDE TOP ?	1	36.20	36.20
RH GUIDE TOP ?	1	36.20	36.20
LH BUMPER GUIDE <i>des</i>	1	16.95	16.95
RH BUMPER GUIDE X	1	16.95	16.95
FRT BUMPER PANEL PRIMED (PMA/PDC) <i>de</i>	1	1,483.20	1,483.20
FRT BUMPER TOW HOOK COVER X	1	56.40	56.40
SET MOUNTING PDC/PMA SENSOR FRT <i>re</i>	1	85.45	85.45
REAR BUMPER CARRIER <i>bt</i>	1	621.20	621.20
REAR BUMPER BOTTOM REINFORCEMENT ?	1	157.80	157.80
REAR BUMPER CENTRE GUIDE <i>des</i>	1	179.90	179.90
REAR BUMPER LH SIDE GUIDE <i>des</i>	1	192.75	192.75
REAR BUMPER RH SIDE GUIDE <i>des</i>	1	179.90	179.90
REAR BUMPER TRIM STRIP <i>ca</i>	1	66.50	66.50
REAR BUMPER TOWING EYE FLAP PRIMED <i>de</i>	1	56.40	56.40
REAR BUMPER PANEL PRIMED (PDC/PMA) <i>de</i>	1	1,697.75	1,697.75
SET MOUNTING PMA SENSOR <i>re</i>	1	75.95	75.95
FRT TRIM GRILLE (CAM) ?	1	27.20	27.20
FRAME BOTTOM	1	83.25	83.25
FRT LH GRILLE (LUXURY) <i>com</i>	1	209.55	209.55
FRT RH GRILLE (LUXURY) <i>com</i>	1	209.55	209.55
AIR FLAPS TOP <i>ca</i>	1	306.30	306.30
LH LOCK ?	1	130.95	130.95
RH LOCK X	1	130.95	130.95
LOCK TOP PART X	2	78.60	157.20
BOWDEN CABLE X	1	47.05	47.05
BOWDEN CABLE X	1	47.05	47.05
RH SPINDLE DRIVE X	1	655.00	655.00
STRIKER BOOT LID ?	1	52.95	52.95
LH TENSION SPRING X	1	95.60	95.60
BOOT LID/TAILGATE PUSH BOTTON (RFK) X	1	40.75	40.75
COUNTER SUPPORT REAR VIEW CAMERA (RX	1	3.40	3.40
LOCK TRUNK LID <i>fm</i>	1	238.40	238.40
REAR WINDOW GREEN (ESG) <i>re</i>	1	954.55	954.55
RR RH DOOR SIDE WINDOW FIXED GREEN X	1	425.15	425.15
RR LH DOOR SIDE WINDOW FIXED O X	1	425.15	425.15
HEADLINING (ELFENBEINWEISS) <i>de</i>	1	1,347.20	1,347.20
INSTRUMENT PANEL SENSATEC (SCHWARZ) ?	1	4,298.95	4,298.95

Performance Motors Limited

A Sime Darby Motors Company
Co. Reg. No. 197401559W GST Reg. No M2-0020081-x
Toll-Free Number (1800-2255269)

303, Alexandra Road
Sime Darby Performance Centre
Singapore 159941
Fax. 64747770

280, Kampong Arang Road
East Coast Centre
Singapore 438180
Fax. 63449773

315, Alexandra Road
Sime Darby Business Centre
Singapore 159944
Fax. 64796601 (AfterSales)
64796624 (Motorrad)



GST REG. NO : M2 - 0020081 - X

ESTIMATE

Estimate No. : b1 66549
Date Estimated : 03/07/2023
Prepared By : Foong Shiuh Jye

Page No. : 5 of 9

REGN. NO.	CHASSIS NO.	REGN. DATE	MODEL	MILEAGE
SGC3277A	WBAJA12050BJ19037	29/03/2018	5201	71673

DESCRIPTION	QTY	PRIC	VALUE
REAR WINDOW SHELF ?	1	882.70	882.70
Ventilation grille ?	1	103.95	103.95
FITTED LUGGAGE COMPARTMENT MAT ?	1	656.60	656.60
RH TRUNK TRIM PANEL ?	1	328.30	328.30
LOADING SILL COVER ?	1	102.65	102.65
Shelf first-AID ?	1	49.65	49.65
LH STORAGE COMPARTMENT LUGGAGE COMP ?	1	229.85	229.85
LH TRUNK TRIM ?	1	328.30	328.30
RUBBER BUFFER ?	2	3.35	6.70
RH STOWAGE COMPARTMENT BOOT ?	1	197.00	197.00
REAR SILENCER HEAT INSULATION FRT ?	1	197.65	197.65
REAR SILENCER LH HEAT INSULATION ?	1	105.40	105.40
REAR SILENCER RH HEAT INSULATION ?	1	105.40	105.40
HEAT INSULATOR FLOOR PANEL TRUNK ?	1	85.70	85.70
SOUND INSULATING wheel house ?	1	155.55	155.55
SOUND INSULA ?	1	115.35	115.35
SOUND INSULATING FRT TRUNK PANEL ?	1	155.55	155.55
TRUNK LID TRIM PANEL ?	1	144.60	144.60
LH TRIM PANEL HINGE TAILGATE ?	1	47.35	47.35
RH TRIM PANEL HINGE TAILGATE ?	1	47.35	47.35
LH TRIM PANEL WATER CHANNEL ?	1	50.40	50.40
RH TRIM PANEL WATER CHANNEL ?	1	50.40	50.40
FRT PANEL SUPPORT X	1	71.25	71.25
FRONT CROSSLINK ?	1	247.85	247.85
LH HEADLIGHT MOUNTING ?	1	219.65	219.65
FRT LH WHEEL ARCH FRT SECTION COVER X	1	142.20	142.20
REAR LH WHEEL HOUSING COVER ?	1	177.70	177.70
REAR RH WHEEL HOUSING COVER X	1	177.70	177.70
AIR DUCT RADIATOR TOP ca	1	83.25	83.25
AIR DUCT RADIATOR BOTTOM ?	1	83.25	83.25
LH AIR DUCT BRAKE X	1	55.50	55.50
LH AIR DUCT BRAKE WHEEL ARCH X	1	55.50	55.50
AIR FLAP CONTROL ACTIVE TOP X	1	99.15	99.15
LH COVER BOTTOM ?	1	79.85	79.85
REAR LH UNDERBODY PANELLING ?	1	82.25	82.25
REAR RH UNDERBODY PANELLING ?	1	82.25	82.25
UNDERBODY PANELLING REAR ?	1	52.15	52.15
FRT ENGINE BONNET SEAL X	1	36.30	36.30
LH SEALING SIDE PANEL X	1	55.55	55.55
TRUNK LID GASKET new	1	137.90	137.90
LH SIDE FINISHER LEATHER (LCSW) ?	1	573.95	573.95
RH SIDE FINISHER LEATHER (LCSW) ?	1	573.95	573.95
LH HEADLIGHT LED AHL HIGH (ICON LIG ca)	1	5,211.95	5,211.95
REAR LH REAR REFLECTOR ?	1	43.90	43.90
REAR RH REAR REFLECTOR X	1	43.90	43.90
LH FOG LIGHT LED ?	1	515.80	515.80
REAR LH LIGHT IN THE SIDE PANEL X	1	683.65	683.65
REAR RH LIGHT IN THE SIDE PANEL X	1	683.65	683.65
REAR LH LIGHT IN TRUNK LID cra	1	403.80	403.80

Performance Motors Limited

A Sime Darby Motors Company
Co. Reg. No. 197401559W GST Reg. No M2-0020081-X
Toll-Free Number (1800-2253269)



103, Alexandra Road
Sime Darby Performance Centre
Singapore 159941
Fax: 64747778

360, Tampong Arang Road
East Coast Centre
Singapore 438180
Fax: 63445773

315, Alexandra Road
Sime Darby Business Centre
Singapore 159944
Fax: 64796601 (AfterSales)
64796624 (Motorrad)

GST REG. NO : M2 - 0020081 - X

ESTIMATE

Estimate No. : b1 66549
Date Estimated : 03/07/2023
Prepared By : Foong Shiuh Jye

Page No. : 6 of 9

REGN. NO.	CHASSIS NO.	REGN. DATE	MODEL	MILEAGE
SGC3277A	WBAJA12050BJ19037	29/03/2018	520i	71673

DESCRIPTION	QTY	PRIC	VALUE
REAR RH LIGHT IN TRUNK LID ?	1	403.80	403.80
LH TAIL LIGHT FINISHER TRUNK LID ?	1	37.45	37.45
RH TAIL LIGHT FINISHER TRUNK LID ?	1	32.35	32.35
DECOUPING RING PDC TORQUE CONVERTER <i>new</i>	8	5.40	43.20
PDC SENSOR MEDITERRANBLAU WC10 ?	8	391.05	3,128.40
FRT SEAT BELT LOWER STRAP (SCHWARZ) ?	2	460.80	921.60
LOWER BELT REAR CENTER ?	1	144.00	144.00
(DG) UPPER BELT REAR (SCHWARZ) ?	2	370.35	740.70
REAR CENTRE UPPER BELT (SCHWARZ) ?	1	333.30	333.30
(DG) FRT LH UPPER SEAT BELT REMA (S ?	1	978.75	978.75
(DG) FRT RH UPPER SEAT BELT REMA (S ?	1	978.75	978.75
REAR LH LOWER BELT ?	1	144.00	144.00
REAR RH LOWER BELT ?	1	144.00	144.00
(DG) LH HEAD AIRBAG <i>Act</i>	1	780.45	780.45
(DG) RH HEAD AIRBAG <i>Act</i>	1	780.45	780.45
(DG) FRT RH SEAT SIDE AIRBAG X	1	546.30	546.30
(DG) FRT LH SEAT SIDE AIRBAG X	1	546.30	546.30
(DG) AIR BAG MODULE FOR PASSENGER S <i>Act</i>	1	1,560.85	1,560.85
(DG/SL) W/SCREEN SEALANT (COLD 1 HOUR) <i>Act</i>	2	131.55	263.10

Total Parts : 71,037.35

3rd Party / Uninsured losses / Direct Settlement

File No. 06/07/23 Claim No. _____

Rafael Excess \$ _____

90010068 Approved Yes / No _____

PHOTO BY SURVEYOR Yes / No _____ PML Yes / No _____

Working Days Recommend 14 days

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:



Labour 1	:	25,326.00
Parts	:	71,037.35
Labour 2	:	0.00
Excess	:	0.00
Total GST @ 8%	:	7,709.07
Grand Total	:	104,072.42

** THIS ESTIMATE IS VALID FOR A PERIOD OF 30 DAYS ONLY**

** PRICE FOR PARTS ARE SUBJECTED TO CHANGE WITHOUT PRIOR NOTICE **

Enquire PARF/COE Rebate for Registered Vehicle

Owner ID Type:	Singapore NRIC
Owner ID:	585H
Vehicle No.:	SGC3277A
Vehicle to be Exported:	No
Intended Deregistration Date:	06 Jul 2023
Vehicle Make:	B.M.W.
Vehicle Model:	520I LED NAV
Primary Colour:	Blue
Manufacturing Year:	2017
Engine No.:	13705118B48B20A
Chassis No.:	WBAJA12050BJ19037
Maximum Power Output:	135.0 kW (181 bhp)
Open Market Value:	\$47,763.00
Original Registration Date:	29 Mar 2018
First Registration Date:	29 Mar 2018
Transfer Count:	0
Actual ARF Paid:	\$58,869.00
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	28 Mar 2028
PARF Rebate Amount:	\$41,208.00
COE Expiry Date:	28 Mar 2028
COE Category:	E - Open - all except motorcycle
COE Period(Years):	10
QP Paid:	\$39,000.00
COE Rebate Amount:	\$18,430.00
Total Rebate Amount:	\$59,638.00

The information contained herein is correct as at 06 Jul 2023

OK

BMW 5 Series 520i

\$135,800 Instalment \$1,657/mth

PREMIUM AD

- Shortlist
- Get Warranty
- Loan Calculator

mycarforum

TRENDING DISCUSSIONS

Singapore Reckless Drivers
Part XIV

READ MORE >

Overview Financial Photo Research

Depreciation	ⓘ \$23,040 / year
Reg. Date	19-Mar-2018 (4yrs 8mths 12days COE left)
Manufactured	ⓘ 2017
Mileage	90,000 km (17k / year)
Transmission	Auto
Engine Cap	1,998 cc
Road Tax	ⓘ \$1,210 / year
Power	135.0 kW (181 bhp)
Curb Weight	ⓘ 1,530 kg
COE	ⓘ \$39,001
OMV	ⓘ \$44,852
ARF	ⓘ \$54,793
Dereg Value	ⓘ \$56,702 as of today
No. of Owners	ⓘ 1

Type of Veh **Luxury Sedan**