

(08/11/13) wef

ASS. REC. BY: Marcus

REF:

CS/LIP23007556/Uny3

ASSIGNMENT

From: Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: S2C 9973A

at Workshop m/s 2-one

of

Insured: S2B1777H

Policy No.

Claims No.


Sum Insured: Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

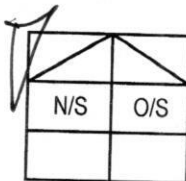

Bal. or Market Value: 842k.

IDAC Accident Rpt: Consistent? : Yes or No

GIA / PR Seen: Consistent? : Yes or No

Est. Repairs: 4 days Res.: Yes or No

Lump Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

666c

Vehicle: IN / OUT

Date: Person Contacted:

L7A820344

Veh No: S2C 9973A Yr Regn: 31/05/16

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or CA /

Make: Mazda 3 SP c.c. 1496

Colour: Red A/C: Insured / Std / NI / NA

Sp. Reading: 130466 T/Radio: Insured / Std / NI / NA

Eng/No:

C/No: JM6BM42A8G0339589

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 205/60R16

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI / TOYO / YOKO or

Front

R/Bal. 5 mm

Rear

R/Bal. 5 mm

L/Bal. 5 mm

L/Bal. 5 mm

D.O.A. 22/07/23

D.O.I. 26/7/23

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

N/S Frt &

The U/C + Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

Rep 13k

31/8/23 Normal headlamp have accident scene photo of holder L/S 4000 in hand Michael

(Red. # 8238.09, 67%)

Date/Time, File Pass to?

☐ : Preli. Report☐ : Final Report

1)

Date/Time, File Return to?

2)

Days Of Repair: 4

Resurvey No. of Trip:

Add Fee: ☐ : Site Insp (\$☐ : Interview (\$☐ : Tech. Invs (\$☐ : Weekend (\$

Survey Fee:

Transportation:

S + RS, SI

Photos

Others

TOTAL

Report Format :

Lump Sum / I.B.I. (\$))

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	666C
Vehicle Details	
Vehicle No.:	SLC9973A
Vehicle to be Exported:	No
Intended Deregistration Date:	26 Jul 2023
Vehicle Make:	MAZDA
Vehicle Model:	MAZDA3 4-DOOR SEDAN 1.5L SP.6EAT
Primary Colour:	Red
Manufacturing Year:	2016
Engine No.:	P520361259
Chassis No.:	JM6BM42A8G0339589
Maximum Power Output:	88.0 kW (118 bhp)
Open Market Value:	\$16,208.00
Original Registration Date:	31 May 2016
First Registration Date:	31 May 2016
Transfer Count:	2
Actual ARF Paid:	\$11,208.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	30 May 2026
PARF Rebate Amount:	\$6,721.00
Intended COE Rebate Details	
COE Expiry Date:	30 May 2026
COE Category:	E - Open Category
COE Period(Years):	10
QP Paid:	\$49,000.00
COE Rebate Amount:	\$13,620.00
Total Rebate Amount:	\$20,344.00

The information contained herein is correct as at 26 Jul 2023

OK

Car Accessories & Products

Pimping up your ride? Browse thousands of car products for even more choices!
Read honest reviews by our trusted consumers before you make a purchase.

Post an Advertisement
Sell it yourself! Advertise it at just
\$68 until it's SOLD!

[Post an Ad](#)
[Advertiser Login](#)
[Ways of Selling](#)

Low Interest Rate In-House Loan by GV Cars Financing



Flexible In-House Loan by GV
Cars Financing at 3.28% p.a.
Low Interest Rate.
GV Automobile Centre StarAd



« Back (1 2 3 4) Next »

Sort by [Date Posted](#) 20 results/page

77 vehicles



Mazda 3

Any Category

Advanced Search



Search

Make	Model	Price	Depreciation	Reg Date	Eng Cap	Mileage	Veh Type	Status
Mazda 3	Any	Any	Any	2016	Any	Any	Any	Available



Mazda 3 1.5A Sunroof

\$42,588

\$13,800 /yr

31-Mar-2016

1,496 cc

-

Sedan

Available

One owner unit! Non PHV unit! Spacious and reliable! Fuel efficient and easy to maintained! Quality is the key for preowned cars, check...

Posted: 26-Jul-2023



Mazda 3 1.5A

\$42,800

\$13,190 /yr

26-May-2016

1,496 cc

138,465 km

Sedan

Available

Spacious And Reliable! Fuel Efficient And Easy To Maintained! Economical Choices For Daily Drive! 100% In House Loan Scheme Availabl...

Benefit Auto Enterprise Pte Ltd

Posted: 26-Jul-2023



Mazda 3 1.5A Deluxe Sunroof

\$46,800

\$13,720 /yr

26-Jul-2016

1,496 cc

95,000 km

Sedan

Available

Good to commit mid-size sedan for short term. Easy to maintain Japanese vehicle. Sporty and economical 1.5A sedan, with excellent fue...

Hamilton Autohub Pte Ltd

Posted: 26-Jul-2023



Mazda 3 1.5A Deluxe Sunroof

\$51,111

\$13,910 /yr

19-Sep-2016

1,496 cc

120,000 km

Sedan

Available

You will never find another Mazda 3 like this again in the whole market. fitted with Knightsports body kit, carbon fiber hood, Knightsport...

Posted: 25-Jul-2023

PREMIUM AD



Sporty Car Outlook With Brake Rotor Cover

Universal Disc Brake Rotor Cover

More info about this product



DaySafe

Mazda 3 1.5A Deluxe Sunroof

\$51,800

\$14,730 /yr

15-Aug-2016

1,496 cc

81,000 km

Sedan

Available

Single owner, agent unit! Deluxe model, fresh paintwork done! Beautiful white. Sunroof/HUD. Well maintained/superb condition. Non-PH...

Tradeit.Com Pte Ltd

Posted: 25-Jul-2023

PREMIUM AD



Mazda 3 1.5A Sunroof

\$45,800

\$13,670 /yr

29-Jun-2016

1,496 cc

95,000 km

Sedan

Available

Non PHV unit! Accident free and genuine mileage, no repair needed, smooth transmission with fuel efficiency, 100% in-house loan and b...

Motor Universe Credit Pte Ltd

Posted: 25-Jul-2023



Mazda 3 1.5A Sunroof

\$49,800

\$13,010 /yr

06-Dec-2016

1,496 cc

128,000 km

Sedan

Available

Spacious And Reliable! Fuel Efficient And Easy To Maintained! Economical Choices For Daily Drive! 100% In House Loan Scheme Availabl...

Benefit Auto Enterprise Pte Ltd

Posted: 25-Jul-2023

PREMIUM AD

Compare

COMPUTERISED 4 WHEEL ALIGNMENT HUNTER DSP700

Company: Z 1
VIN: SLC 9973 A
Date: 25.7.23 15:02



SLC 9973 A

Mazda : Mazda3 : 2013-19 (BM/BN) : except Rough Road Suspension

Front : Left

Actual	Before	Specified Range
-1°24'	-1°24'	-1°12' 0°48'
6°22'	6°22'	5°29' 7°29'
-0°08'	-0°09'	-0°05' 0°16'
20°47'	20°47'	
19°23'	19°23'	

Camber
Caster
Toe
SAI
Included Angle
Turning Angle Diff.

Front : Right

Actual	Before	Specified Range
-0°09'	-0°09'	-1°12' 0°48'
6°17'	6°17'	5°29' 7°29'
-0°11'	-0°11'	-0°05' 0°16'
11°18'	11°18'	
11°09'	11°09'	

Front

Cross Camber
Cross Caster
Cross SAI
Total Toe
Cross Turn Diff.

Actual	Before	Specified Range
-1°15'	-1°15'	-1°30' 1°30'
0°04'	0°04'	-1°30' 1°30'
9°29'	9°29'	
-0°19'	-0°19'	-0°09' 0°31'

Rear : Left

Actual	Before	Specified Range
-0°52'	-0°52'	-1°59' 0°01'
0°12'	0°12'	-0°05' 0°15'

Camber
Toe

Rear : Right

Actual	Before	Specified Range
-0°56'	-0°56'	-1°59' 0°01'
0°00'	0°00'	-0°05' 0°15'

Rear

Cross Camber
Total Toe
Thrust Angle

Actual	Before	Specified Range
0°04'	0°04'	-1°30' 1°30'
0°12'	0°12'	-0°10' 0°30'
0°06'	0°06'	-0°48' 0°48'



Z-ONE AUTOMOTIVE PTE LTD

1 Kaki Bukit Ave 6, Blk D #01-85/87, Autobay@Kaki Bukit Singapore 417883

Tel: 62502115/66342112 Fax: 66342122

Email: service@z-one.com.sg; enquiry@z-one.com.sg

AUTOMOTIVE • PERFORMANCE

GST Registration No. 201118055N Company Registration No: 201118055N

Yuen Yew Khuin
911 Tampines Street 91 #13-101 Singapore
520911

Contact : 97507538

ESTIMATE

Code : C102076

Date in : 24/07/2023

Vehicle Num. : SLC9973A

Model : MAZDA3 4-DOOR SEDAN 1.5L SP.6EAT

Chassis/Eng# : JM6BM42A8G0339589/P520361259

not Authorised
26/7/23

2/s = 4000/

4 days.
the photo the rep-

Parts and Labour Assessment

Description of part	Qty	Unit Price	Amount
Front absorber 11	1	360.80	360.80 X
Front absorber bearing 11	1	55.80	55.80 X
Front absorber cover 11	1	36.30	36.30 X
Front absorber mounting 11	1	96.50	96.50 X
Front absorber stopper 11	1	46.40	46.40 X
Front bonnet 11	1	1120.70	1,120.70 X
Front bonnet hinges 11	2	43.10	86.20 X
Front bonnet lock 11	1	207.00	207.00 X
Front bonnet lock holder 11	1	11.40	11.40 X
Front bonnet lock protector 11	1	27.00	27.00 X
Front bonnet lock stay 11	1	34.10	34.10 X
Front bonnet parting seal weatherstrip 11	1	66.80	66.80 X
Front bonnet rubber weatherstrip (front) 11	1	27.20	27.20 X
Front bonnet rubber weatherstrip (rear) 11	1	92.00	92.00 X
Front bumper DLS	1	971.40	971.40 —
Front bumper cover 11	1	58.80	58.80 X
Front bumper reinforcement 11	1	593.40	593.40 X



Tel: 62502115/66342112 Fax: 66342122

Email: service@z-one.com.sg; enquiry@z-one.com.sg

AUTOMOTIVE • PERFORMANCE GST Registration No. 201118055N Company Registration No: 201118055N

Front bumper retainers	1/5 CNE	1	39.40	39.40	/
Front fender LH	BUC	1	350.60	350.60	/
Front fender outer frame LH	n	1	584.70	584.70	x
Front fender splash shield LH	Torn	1	101.90	101.90	/
Front fender stay LH	BMT	1	41.90	41.90	/
Front fog light cover LH	gross	1	45.40	45.40	/
Front fog light LH	CNE	1	165.20	165.20	/
Front headlamp LH	CNE	1	812.00	812.00	/
Front lower arm	BMT	1	509.00	509.00	/
Front MAZDA 'Logo' emblem	11	1	46.50	46.50	x
Front radiator grille bracket	11	1	107.60	107.60	x
Front radiator grille cover	CNE.	1	355.50	355.50	/
Front wheel hub with knuckle bearing	wegard	1	568.60	568.60	/
Subtotal before discount				7,620.10	
Percentage discount 10% 202				762.01	
Sub-total 1				6,858.09	
Front bumper clips (set) (sn)	neu	1	50.00	50.00	40
Front fender innershield clips (set) (sn)	neu	1	50.00	50.00	40
Front rim (sn)	n	1	550.00	550.00	x
Front tyre (sn)	11	1	280.00	280.00	x



Tel: 62502115/66342112 Fax: 66342122

Email: service@z-one.com.sg; enquiry@z-one.com.sg

AUTOMOTIVE • PERFORMANCE GST Registration No. 201118055N Company Registration No: 201118055N

Subtotal before discount	930.00
Percentage discount 0%	0.00
Sub-total 2	930.00
Parts-total	7,788.09

LABOUR

Description	Price
To remove, reinstall electrical wiring harness, check lighting and resetting headlamp focussing. (to FR)	120.00 20
Diagnose, replace and/or repair to rectify front portion electrical system for proper functioning.	150.00 80
To remove, reinstall front suspension undercarriage parts. (to FR)	450.00 120
To conduct computerise wheel alignment and adjustments	150.00 100
To re-spray painting on the change bodyparts, repair portion, and where consistent to the accident.	1,600.00 850
To provide labour, workmanship to change the above damaged bodyparts, repair, re-construct and re-align body structure, body alignments and damaged consistent to the accident.	1,800.00 580
To apply anti-rust chemical (Tuff-Kote) on repaired and replaced panel.	180.00 40
Labour Total	4,450.00
Parts & Labour Total	12,238.09

page 3

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) for resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

P- 38609.2
202
3168.72
80
1790
5038.72
202
4030.