

(08/11/13) wef

ASS. REC. BY: John

REF:

CS/CT/23007621/R9Y3

2012

ASSIGNMENT

2024/ACC

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SJQ 856Pat Workshop m/s SNG AH TEE

of _____

Insured: CTI

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value: 8K

IDAC Accident Report: _____ Consistent?: Yes or No

GIA / PR Seen: _____ Consistent?: Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lump Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: 322856P Yr Regn: 2009 / APRType: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
Truck / Trailer orMake: HYUNDAI AVANTE 1.6A c.c. 1591Colour: MARON A/C: Insured / Std / NI / NASp. Reading: 14147L T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: KMHOU 41BR94728539Gen. Cond: Good / Fair / Poor / BurntSteering: Inorder / Jammed / Leaked / Burnt orBrake: Inorder / Jammed / Leaked / Burnt orModi: Nil / S/Rim / STD A/Rim orTyre Size: F: 185/65R15

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or WESTLAKES

Front _____ Rear _____

R/Bal. 6 mm R/Bal. 6 mmL/Bal. 6 mm L/Bal. 6 mmD.O.A. 21/07/23 D.O.I. 27/07/23Survey held at SNG AH TEE

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

N/F FRONT

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

REAR LIMIT - 6K

Date/Time, File Pass to?

☐

Prell. Report

1)

☐

Final Report

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee: _____

Transportation: _____

Add Fee: ☐ Site Insp (\$

) S + RS, SI

☐ Interview (\$

) Photos

☐ Tech. Invs (\$

) Others

☐ Weekend (\$

TOTAL

Report Format: _____

Lump Sum / I.B.I. (\$) _____

Sng Ah Tee Motor Pte Ltd
Blk 3 Pioneer Road North, #01-18,
628457

Insurer Reference:

Repairer Reference: SJQ856P-TP-CHINA

Date calculated: 27/07/2023 12:45 PM

Full Report

Registration: SJQ856P

Printed: 27/07/2023 12:46 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	DARREN SNG	Currency:	SGD
Claim Reference:		Date of Incident:	21/07/23
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	HYUNDAI
Model:	AVANTE (HD)
Sub Model:	BASIS
Model Sheet Number:	30 22 50
Registration:	SJQ856P
VIN number:	KMH DU41BR9U728539
Odometer:	

Model Specs

FROM 04/2009	AIR CONDITIONING	1.6 LTR 90 KW	TWO COAT METALLIC
PREPARE OFF VEHICLE			

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

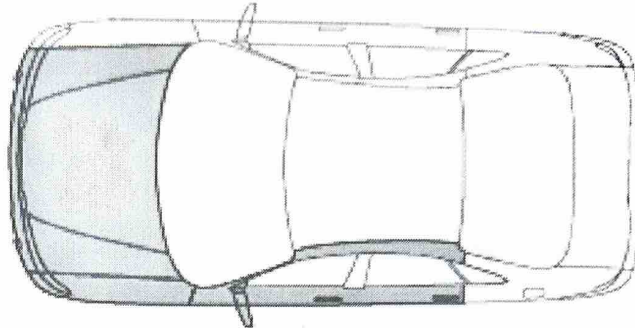

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	----------------------------	---------------------------	---------------------------	----------------------------	----------------------------	-----------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
NO NUMBER	ALIGN W/O ADJUST FRONT VEHICLE		6.0	25.20
86512R00	RENEW FRONT BUMPER		8.0	33.60
	INCLUDES: BUMPER AND REQUIRED ATTACHED PARTS R + R			
	NOT INCLUDED: REINFORCEMENT BUMPER			
	REMOVE AND REFIT			
92000R0B	REMOVE/REFIT BOTH HEADLIGHT UNITS		3.0	12.60
	INCLUDES: SET HEADLIGHT BEAMS			
66400R00	RENEW BONNET		6.0	25.20
	INCLUDES: R + R BONNET,			
	CONVERT ATTACHED PARTS, RENEW IF NECESSARY			
79110R0B)	R + R BONNET HINGES (BONNET REMOVED)		2.0	8.40
66300R00	R + R LEFT FRONT WING		7.0	29.40
NO NUMBER	R + R LEFT FRONT WING BADGE		2.0	8.40
NO NUMBER	R + R FRONT PANEL		20.0	84.00
87600R00	R + R LEFT MIRROR		2.0	8.40

Code	Description	WU	Price SGD
82110R00	R + R LEFT FRONT DOOR SEAL		
84750R00	R + R LOWER INSTRUMENT PANEL TRIM	3.0	12.60
97606R00	R + R AIR CONDITIONING CONDENSER	2.0	8.40
25300R00)	R + R RADIATOR	10.0	42.00
	INCLUDES: R + R COMPLETE RADIATOR SHROUD	7.0	29.40
NO NUMBER	R + R LEFT FRONT WHEEL		
NO NUMBER	R + R RIGHT FRONT WHEEL	1.0	4.20
NO NUMBER	R + R FRONT WHEEL(S)	1.0	4.20
62410R00)	R + R FRONT AXLE CARRIER	1.0	4.20
62410R00)	RENEW FRONT AXLE SUPPORT	5.0	21.00
	(REMOVED)	4.0	16.80
	INCLUDES: R + R STEERING GEAR AND FRONT STABILIZER		
51715R00)	R + R L/F STEERING KNUCKLE	5.0	21.00
51715R00)	RENEW L/F STEERING KNUCKLE	4.0	16.80
	(REMOVED)		
	INCLUDES: R + R BRAKE DISC, WHEEL HUB AND BRAKE DISC SHIELD		
54630R00)	R + R L/F STRUT	2.0	8.40
54630R00)	DISS/ASS L/F SUSPENSION STRUT REMOVED	2.0	8.40
54509R00)	R + R LEFT FRONT LOWER CONTROL ARM	2.0	8.40
56300R00)	R + R STEERING COLUMN	9.0	37.80
52910R00	R + R L/F TYRE	4.0	16.80
	(WHEEL REMOVED)		
	INCLUDES: BALANCE WHEEL		
NO NUMBER	DRAIN/REFILL COOLING SYSTEM	3.0	12.60
09760A00	DRAIN + REFILL AIR CONDITIONING	5.0	21.00
1481	LEFT FRONT DOOR REPAIR	15.0*	63.00
Labour Cost			
Panel / Mechanical Labour		Hrs	WU
Alignment		13.50	135.0
Measuring Work		0.60	6.0
Total of Labour			592.20

Paint

Paint Work

SYSTEM AZT

Code	Description - TWO COAT METALLIC	Time Basis 10 WU/h	WU	Price SGD
	BONNET NEW PART PAINTING		24.0	
	L/F WING NEW PART PAINTING		10.0	
	FRONT BUMPER NEW PART PAINT K1N		12.0	
	LEFT FRONT DOOR SURFACE PAINT		8.0	

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	
0741	L/F WING NEW PART PAINTING	78.43
0283	FRONT BUMPER NEW PART PAINT K1N	18.06
1481	LEFT FRONT DOOR SURFACE PAINT	53.95
		20.17

Labour Cost - Paint

Factor	42.00 SGD/h	Hrs	WU	Price SGD
Time Paint			54.0	
Preparation Main Work Metal		2.50	25.0	105.00
Preparation Comp. Work Plastic		0.80	8.0	33.60
Total	10 WU/h	8.70	87.0	365.40

Material Cost - Paint

	Price SGD
New Part Painting	96.49
New Part Painting - Plastic K1N	53.95
Surface-/Blend Paint	20.17
Material-constant Metal Preparation	28.60
Material-constant Plastic	12.70
Total	211.91

Spare Parts

				prices as at 2015-06-01
Code	Description	Part Number	Part Source	Price SGD
0283	FRONT BUMPER <i>de / m</i>	865112H000	Original	190.00
0321	L/BUMPER MNTG REINF	865132H000	Original	15.00
0471	BONNET <i>X</i>	664002H010	Original	350.00
0475	LEFT BONNET HINGE <i>X</i>	791102H000	Original	25.00
0476	RIGHT BONNET HINGE <i>X</i>	791202H000	Original	25.00
0485	INSULATION MNTG KIT <i>X</i>	8112637010	Original	15.00
0561	LEFT HEADLAMP ASSY <i>sup</i>	821012H091	Original	190.00
0741	L/F WING <i>lt</i>	663112H022	Original	230.00
0789	L/F WING CLAMP KIT <i>m</i>	USE SINGLE PARTS	Original	15.00
0811	L/F WING BADGE <i>X</i>	863162H000		0.00
0841	L/F WHEELHOUSE <i>de</i>	868112H010	Original	35.00
1009	INNER FRT PANEL CPL <i>?</i>	641012H000	Original	280.00
1737	L/DOOR MIRROR <i>cm</i>	876102H400CA	Original	175.00
7011	FRONT AXLE SUPPORT <i>?</i>	624052H000	Original	550.00
7035	L/F DRIVE SHAFT <i>?</i>	495012H000	Original	620.00
7053	L/F LWR CONTROL ARM <i>?</i>	545002H000	Original	115.00
7077	L/FR SHOCK ABSORBER <i>?</i>	546512H000	Original	140.00
7081	L/F STEERING KNUCKLE <i>?</i>	517152H000	Original	155.00
7117	L/F WHEEL BEARING <i>?</i>	517202H000	Original	55.00
7131	L/F WHEEL HUB <i>?</i>	517502H000	Original	95.00
7201	L/FR WHEEL <i>cm</i>	529102H090	Original	350.00
7217	L/F WHEEL BOLT SET <i>?</i>	5295017000	Original	100.00
7227	L/FR TYRE <i>location ?</i>	185/65 R 15 .. H	Original	0.00
7271	L/F STABI LINKAGE <i>?</i>	548302H200	Original	35.00
7371	STEERING COLUMN <i>?</i>	563102H050	Original	400.00
1000	FRT BUMPER CLIP X10 <i>m</i>		Original	15.00
1001	L/F FENDER VVT <i>m</i>	STICKER	Original	18.00
				Savings
				Subtotal
				Total
				4,193.00

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Extras

Code	Description	Price SGD
1002	L/F TYRE 185/65R15 - 70%	250.00*
1003	CHECK WIRING -	30.00*
1004	REPAIR & REPLACE UNDERCARRIAGE	150 450.00*
1005	APPLY ANTI RUST -	6. 100.00*
1006	DIAGNOSE & RESET FAULT CODE	100 150.00*
1007	WHEEL ALIGNMENT -	60 80.00*
	Total Extras	1,060.00

Final Calculation

	SGD	SGD
Parts	4,193.00	
Total Parts		4,193.00
Labour Time Base 10 WU/h		
Total 135.0 WU X 42.00 SGD/h	567.00	
Alignment		
Measuring Work	25.20	
Total of Labour		592.20
Total Of Extras		1,060.00
Paint Work Time Base 10 WU/h		
Labour Cost 87.0 WU X 42.00 SGD/h	365.40	
Material Cost	211.91	
Total Paint Including Material		577.31
Repair Cost Excludes GST		6,422.51
GST (+8.0%)		513.80
Repair Cost Included GST		6,936.31

Comments

- * - USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
-) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Paine
 Hg 900 10068
 6 days
 HS
 27/07/23
 Rep after repair

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Singapore NRIC
Owner ID: 201I

Vehicle Details

Vehicle No.: SJQ856P
Vehicle to be Exported: No
Intended Deregistration Date: 25 Jul 2023
Vehicle Make: HYUNDAI
Vehicle Model: HD AVANTE 1.6 A
Primary Colour: Red
Manufacturing Year: 2009
Engine No.: G4FC9U631263
Chassis No.: KMH DU41BR9U728539
Maximum Power Output: 89.7 kW (120 bhp)
Open Market Value: \$11,974.00
Original Registration Date: 24 Apr 2009
First Registration Date: 24 Apr 2009
Transfer Count: 4
Actual ARF Paid: \$11,974.00

Intended PARF Rebate Details

PARF Eligibility: Forfeited
PARF Eligibility Expiry Date: -
PARF Rebate Amount: \$0.00

Intended COE Rebate Details

COE Expiry Date: 23 Apr 2024
COE Category: A - Car (1600cc & below)
COE Period(Years): 5
PQP Paid: \$13,088.00
COE Rebate Amount: \$1,954.00
Total Rebate Amount: \$1,954.00

Message

Please note that the 5-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 25 Jul 2023

OK

Hyundai Avante 1.6A (COE till 03/2024)

\$7,800 Instalment \$794/mth

- ♡ Shortlist
- ✓ Get Warranty
- 📄 Loan Calculator

**KONNICHIWA!
OSAKA AWAITS!**

One-way from
\$199*

Book now
*Taxes included, terms apply.


JNTO

Overview

Financial

Photo

Research

Depreciation	 \$11,720 / year
Reg. Date	30-Mar-2009 (7mths 28days COE left)
Manufactured	 2009
Mileage	-
Transmission	Auto
Engine Cap	1,591 cc
Road Tax	 \$1,107 / year
Power	89.7 kW (120 bhp) View specs of the Hyundai Avante (2007-2011)
Curb Weight	 1,264 kg
COE	 \$12,763
OMV	 \$10,978
ARF	 \$10,978
Dereg Value	 \$1,699 as of today
No. of Owners	 4