

Ding Auto Pte Ltd
Sin Ming Industrial Est. Sec C, Blk
10, #01-20
575645

Insurer Reference:

Repairer Reference: 072334

Date calculated: 23/08/2024 4:25 PM



Full Report

Registration: SKW5277J

Printed: 23/08/2024 5:09 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Ding Auto	Currency:	SGD
Claim Reference:		Date of Incident:	19/08/24
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	KIA
Model:	CERATO/FORTE/K3 YD
Sub Model:	BASE MODEL
Model Sheet Number:	28 87 01
Registration:	SKW5277J
VIN number:	KNAFZ411MF5472107
Odometer:	
Model Specs	
4-DOOR	

*Not Authorised
L1 By D, 7/10/24
Ex TBA
14 days*

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

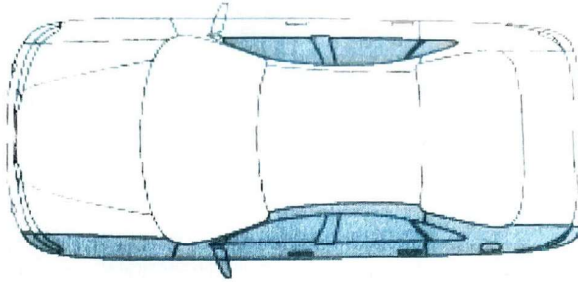

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	----------------------------	---------------------------	---------------------------	----------------------------	----------------------------	-----------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
86510R00)	DETACH + REFIT FRONT BUMPER		2.0	8.40
66300R00	R + R LEFT FRONT WING INCLUDES: L/HEADLAMP ASSY, W-HOUSE LINER AND MUDFLAP R + R		7.0	29.40
86111R00)	R + R WINDSCREEN INCLUDES: R + R BOTH WIPER ARMS AND COWL GRILLE		18.0	75.60
82850R00)	R + R LEFT ROOF MOULDING		1.0	4.20
82850R0B)	R + R ROOF MOULDINGS		1.0	4.20
NO NUMBER	RENEW L/OUTER A-PILLAR		60.0	252.00
71402R00)	RENEW L/OUTER B-PILLAR		83.0	348.60
76000R00	RENEW L/F DOOR INCLUDES: R + R DOOR AND ALL NECESSARY ATTACHED PARTS, RENEW IF NECESSARY		13.0	54.60
82300R00)	RENEW LEFT FRONT DOOR TRIM (REMOVED)		1.0	4.20
76000RF0	R + R L/F DOOR HINGE/S		3.0	12.60
77000R00	RENEW L/R DOOR INCLUDES: R + R DOOR,		14.0	58.80

Code	Description	WU	Price SGD
	CONVERT ATTACHED PARTS CPL, RENEW IF NECESSARY		
83300R00)	RENEW L/R DOOR TRIM (REMOVED)	1.0	4.20
77000RF0	R + R L/R DOOR HINGE/S	2.0	8.40
82300R00)	R + R RIGHT FRONT DOOR TRIM	2.0	8.40
82411R00)	R + R R/F DOOR WINDOW (TRIM REMOVED)	1.0	4.20
86520R00	R + R REAR BUMPER	5.0	21.00
	INCLUDES: BOTH REAR LAMPS REMOVE AND REFIT.		
69200R00)	R + R BOOTLID	5.0	21.00
87321R00	R + R BOOTLID SEAL	2.0	8.40
87111R00)	R + R REAR SCREEN	8.0	33.60
NO NUMBER	RENEW L/R SIDE PANEL	50.0	210.00
NO NUMBER	R + R L/R QTR WINDOW	5.0	21.00
85310R00	R + R HEADLINING	24.0	100.80
85835R00)	R + R LEFT B-PILLAR LOWER TRIM	1.0	4.20
85873R00	R + R L/F DOOR SILL COVER	2.0	8.40
85875R00	R + R LEFT REAR SILL PANEL	3.0	12.60
85835R0B)	R + R BOTH LOWER B-PILLAR TRIMS	1.0	4.20
85731R00)	R + R L/LOAD COMPARTMENT TRIM	2.0	8.40
85731R0B)	R + R REAR INNER BOOTLID SIDE TRIM/S	2.0	8.40
85770R00	R + R REAR END PANEL TRIM	2.0	8.40
85710R00	R + R BOOT MAT	2.0	8.40
88003R00	R + R L/F SEAT	3.0	12.60
84710R00)	R + R INSTRUMENT PANEL	14.0	58.80
52951R0B)	R + R WHEELS ADD/WORK	1.0	4.20
52951R00)	R + R LEFT REAR WHEEL	1.0	4.20
31030R00)	R + R FUEL FILLER NECK	2.0	8.40
69510R00	R + R FUEL FLAP	2.0	8.40
18600A00	ADJUST HEADLAMPS	3.0	12.60
Labour Cost		Hrs	WU
Panel / Mechanical Labour		34.90	349.0
Total of Labour			1,465.80

Paint

Paint Work	Manufacturer	Time Basis 10 WU/h	
Code	Description - MF	WU	Price SGD
991FLTR0	L/F WING PAINTING STAGE I	28.0	117.60
99KDLTR0	LEFT FRONT DOOR PAINTING STAGE I	31.0	130.20
99LDLTR0	L/R DOOR PAINTING STAGE I	31.0	130.20
99JPLTR0	L/OUTER A-PILLAR PAINTING STAGE I	19.0	79.80
99MPLTR0	L/OUTER B-PILLAR PAINTING STAGE I	21.0	88.20
9905LTR0	L/RR SIDE PANEL PAINTING STAGE I	35.0	147.00
Total Paint		Hrs	WU
		16.50	165.0
			Price SGD
			693.00

Spare Parts

prices as at 2015-06-01

Code	Description	Part Number	Part Source	Price SGD
1031	AIRBAG ECU	AIRBAG ECU	Original	<i>me</i> 520.00 ✓
1016	F/L ABS CL SPRG	F/L ABS CL SPRG	Original	380.00 ?
1015	F/L ABS DST CVR	F/L ABS DST CVR	Original	30.00 ?
1013	F/L ABS MTG	F/L ABS MTG	Original	68.00 ?
1010	F/L ABS SENSR	F/L ABS SENSR	Original	95.00 ?
1014	F/L ABS STP	F/L ABS STP	Original	35.00 ?
1003	F/L BRK CALIPER	F/L BRK CALIPER	Original	<i>SL</i> 480.00 X
1002	F/L DISC ROTOR	F/L DISC ROTOR	Original	<i>SL</i> 120.00 X
1006	F/L DRI SHAFT	F/L DRI SHAFT	Original	550.00 ?
1023	F/L DR KLS BTN	F/L DR KLS BTN	Original	86.00 ?
1025	F/L DR WIN SWTH	F/L DR WIN SWTH	Original	80.00 ?
1029	F/L GOV BX OPNR	F/L GOV BX OPNR	Original	48.00 ?
1024	F/L INN LCK CBL	F/L INN LCK CBL	Original	60.00 ?
1009	F/L KNUCKLE	F/L KNUCKLE	Original	<i>Ry</i> 280.00 ✓
1007	F/L LWR ARM	F/L LWR ARM	Original	280.00 ?
1011	F/L LWR ARM BJT	F/L LWR ARM BJT	Original	<i>me</i> 65.00 ✓
1020	F/L QTR GLS	F/L QTR GLS	Original	<i>GR</i> 220.00 ✓
1021	F/L QTR GLS C/T	F/L QTR GLS C/T	Original	<i>me</i> 155.00 ✓
1032	F/L SEAT BELT	F/L SEAT BELT	Original	<i>me</i> 480.00 ✓
1012	F/L SHOCK ABSBR	F/L SHOCK ABSBR	Original	155.00 ?
1018	F/L STB BAR	F/L STB BAR	Original	<i>SL</i> 220.00 X
1017	F/L STB LNK	F/L STB LNK	Original	<i>me</i> 68.00 X
1004	F/L TIE ROD	F/L TIE ROD	Original	<i>Ry</i> 95.00 ✓
1005	F/L TIE ROD END	F/L TIE ROD END	Original	<i>Ry</i> 105.00 ✓
1022	F/L WND MTR RGL	F/L WND MTR RGL	Original	<i>BR</i> 290.00 ✓
1026	FL/D INN/CB ORG	FL/D INN/CB ORG	Original	65.00 ?
1000	FRONT RIM LHS	FRONT RIM LHS	Original	<i>me</i> 480.00 ✓
4974	FRT ROOF GRAB HANDLE	85340A7000ED	Original	<i>me</i> 60.00 X
1001	FRT TYRE LHS	FRT TYRE LHS	Original	300.00 ?
1019	F STB BUSH	F STB BUSH	Original	<i>SL</i> 25.00 X
4355	GLOVEBOX	84510A7900WK	Original	<i>me</i> 150.00 X
4957	HEADLINING	85313A7240ED	Original	<i>Return</i> 1,450.00 ✓
1737	L/DOOR MIRROR	87610A7160	Original	<i>me</i> 330.00 ✓
2427	L/DRIP MOULDING	87230A7000	Original	<i>me</i> 350.00 ✓
1505	L/F DOOR CHECK	79380A7000	Original	<i>Ry</i> 38.00 ✓
1777	L/F DOOR FRAME SEAL	82110A7000	Original	<i>me</i> 85.00 ✓
1577	L/F DOOR LOCK	81310A7020	Original	<i>me</i> 220.00 ✓
1565	L/F DOOR OUT HANDLE	82651A7000	Original	<i>me</i> 70.00 X
1509	L/F DOOR SEAL	82130A7000	Original	<i>me</i> 85.00 X
1711	L/F DOOR TRIM CPL	82307A7030D2E	Original	<i>me</i> 680.00 ✓
1519	L/F DOOR WINDOW	82410A7000	Original	<i>Ry</i> 280.00 ✓
1563	L/F HANDLE BRACKET	82655A7000	Original	<i>Ry</i> 55.00 ✓
2193	L/F INNER SILL MLDG	85870A7000WK	Original	<i>me</i> 55.00 ✓
1685	L/F LOCK BRACKET	82486A7000	Original	45.00 ?
1495	L/F LOWER DOOR HINGE	794103K000	Original	<i>Ry</i> 45.00 ✓
1661	L/F OUT WINDOW MLDG	82210A7000	Original	<i>me</i> 68.00 ✓
2195	L/F SILL MOULDING	85872A7000WK	Original	65.00 ?
1707	L/F SPEAKER	96340A7100	Original	215.00 ?
1581	L/F STRIKER PLATE	813501D000	Original	65.00 ?
1487	L/F UPPER DOOR HINGE	793102E000	Original	<i>Ry</i> 45.00 ✓
1605	L/F UPP WINDOW GUIDE	82530A7000	Original	150.00 ?
0841	L/F WHEELHOUSE COVER	86811A7000	Original	<i>me</i> 75.00 ✓
0741	L/F WING	66311A7000	Original	<i>Ry</i> 220.00 ✓
0771	L/F WING INSULATOR	84141A7000	Original	<i>me</i> 60.00 ✓

Code	Description	Part Number	Part Source	Price SGD
1619	L/INN WINDOW SEAL	82231A7000	Original	105.00 ✓
4949	L/LWR B-PILLAR TRIM	85835A7000WK	Original	65.00 ✓
2227	L/OUTER A-PILLAR	71110A7A00	Original	580.00 ✓
2277	L/OUTER B-PILLAR	71401A7B00	Original	650.00 ✓
1781	L/R DOOR	77003A7000	Original	700.00 ✓
1805	L/R DOOR CHECK	79480A7000	Original	38.00 ✓
1907	L/R DOOR DECAL	86381A7000	Original	0.00 ✓
2063	L/R DOOR FRAME SEAL	83110A7000	Original	80.00 ✓
1877	L/R DOOR LOCK	81410A7010	Original	220.00 ✓
1865	L/R DOOR OUT HANDLE	82651A7000	Original	75.00 X
1809	L/R DOOR SEAL	83130A7000	Original	60.00 ✓
1607	L/R DOOR STRIP	86363A7000	Original	85.00 ✓
2011	L/R DOOR TRIM	83305A7120D2B	Original	680.00 ?
1897	L/R DOOR WDW GUIDE	83531A7000	Original	65.00 ?
1819	L/R DOOR WINDOW	83410A7000	Original	280.00 ✓
1867	L/R HANDLE BRACKET	82655A7000	Original	55.00 ?
1921	L/R INN CHANNEL SEAL	83231A7000	Original	65.00 ?
2199	L/R INNER SILL MLDG	85875A7000WK	Original	55.00 ?
1980	L/R LOCK BRACKET	83486A7000	Original	45.00 ?
1795	L/R LOWER DOOR HINGE	793102E000	Original	45.00 ✓
1961	L/R OUT WINDOW MLDG	83210A7000	Original	105.00 ✓
1829	L/R QUARTER GLASS	83417A7000	Original	250.00 X
4975	L/R ROOF GRAB HANDLE	85340A7000ED	Original	60.00 X
3483	L/RR SIDE PANEL	71503A7C00	Original	700.00 ?
2197	L/R SILL MOULDING	85877A7000WK	Original	65.00 ?
2005	L/R SPEAKER	96340A7100	Original	215.00 X
1881	L/R STRIKER PLATE	813501D000	Original	65.00 ?
1787	L/R UPPER DOOR HINGE	794103K000	Original	45.00 ✓
3861	L/R WDW BONDING KIT	KNGKWI1	Original	0.00
3685	L/R WHEELHOUSE COVER	86821A7000	Original	185.00 X
1893	L/R WINDOW RR GUIDE	83510A7000	Original	65.00 ?
4951	L/UPP B-PILLAR TRIM	85830A7000ED	Original	60.00 ?
1481	LEFT FRONT DOOR	76003A7000	Original	650.00 ✓
1520	R/F DOOR WINDOW	82420A7000	Original	280.00 ?
1027	R/L D/WIN SWTCH	R/L D/WIN SWTCH	Original	80.00 ?
1033	R/L DR LCK CBL	R/L DR LCK CBL	Original	45.00 ?
1028	R/L RIM	R/L RIM	Original	480.00 X
1030	RF LINNG A/BG	RF LINNG A/BG	Original	1,250.00 ✓
1008	STEERING RCK	STEERING RCK	Original	550.00 ✓
f: OEM Parts				0.00
n: Non-OEM Parts				19,894.00
u: Used parts				
Savings				0.00
Subtotal				19,894.00
Total				19,894.00

Final Calculation

	SGD	SGD
Parts	19,894.00	
Total Parts		19,894.00
Labour Time Base 10 WU/h		
Total 349.0 WU X 42.00 SGD/h	1,465.80	
Total of Labour		1,465.80
Paint Work Time Base 10 WU/h		
Labour Cost 165.0 WU X 42.00 SGD/h	693.00	
Total Paint Including Material		693.00
Repair Cost Excludes GST		22,052.80
GST (+9.00%)		1,984.75
Repair Cost Included GST		24,037.55

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.