

ASS. REC. BY:

REF:

10 / 24090122 / kna3

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / QD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

Trans Cab

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

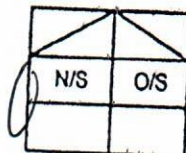

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

03 days

Res.: Yes or No

Lum Sum:

20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SHD 5965S

Yr Regn:

11, 18

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Toy Prius

c.c.

1798

Colour

M.P. White / Red

A/C:

Insured / Std / NI / NA

Sp. Reading

623833

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

JTDKB31FU703075517

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: Nil / S/Rlm / STD / Rlm or

Tyre Size:

F: Wanh

195/65R15

R: Continental

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Front

Rear

R/Bal.

8

mm

R/Bal.

4

mm

L/Bal.

8

mm

L/Bal.

4

mm

D.O.A.

17/7/24

D.O.I.

9/9/2024

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

N/S Rear body

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

10/9 21:00 & 23:00 / Car

Date/Time, File Pass to?

☐

: Prell. Report

1)

Date/Time, File Return to?

☐

: Final Report

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S - RS. \$

Fees

Others

TOTAL

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Report Format :

Lump Sum / I.B.I.: (\$

Not Authorized
11 Sep @ 2300hr

Trans-cab Auto Services Pte Ltd

AAD2407-072

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD5965S

09 SEP 2024

Vehicle No.:

Chassis No.:

UEN No:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

Date of Registration:

SHD5965S

JTDKB3FU703075517

200303878K

TOYOTA

PRIUS

17/7/2024

SNA6988P/II

1/11/2018

PART		LIST	
1	PANEL SUB-ASSY, FRONT DOOR, LH	\$	1,641.36 X
1	PANEL SUB-ASSY, REAR DOOR, LH	\$	1,634.33 —
1	FRAME SUB-ASSY, REAR DOOR OUTSIDE HANDLE, LH	\$	243.81 X
1	HANDLE ASSY, REAR DOOR OUTSIDE, LH	\$	123.06 X
1	WEATHERSTRIP, REAR DOOR OPENING TRIM, LH	\$	369.60 X
1	HINGE ASSY, REAR DOOR, LOWER LH	\$	109.62 X
1	HINGE ASSY, REAR DOOR, UPPER LH	\$	124.74 X
1	TAPE, BLACK OUT, NO.1 REAR LH	\$	27.62 —
1	TAPE, BLACK OUT, NO.2 REAR LH	\$	44.00 —
1	TAPE, BLACK OUT, NO.3 REAR LH	\$	19.43 —
1	COVER, REAR COMBINATION LAMP, LH	\$	81.48
1	LENS & BODY, REAR COMBINATION LAMP, LH	\$	559.13
1	LENS AND BODY, REAR LAMP, LH	\$	634.73
1	COVER, REAR BUMPER	\$	558.39
1	REINFORCEMENT SUB-ASSY, REAR BUMPER	\$	419.90
1	GUARD, REAR BUMPER, CENTER	\$	726.92
1	FILLER, REAR BUMPER EXTENSION, LH	\$	155.72
1	SEAL, REAR BUMPER SIDE, LH	\$	111.41
1	RETAINER, REAR BUMPER SIDE, LH	\$	147.11
1	PANEL SUB-ASSY, QUARTER, LH	\$	1,099.46
1	LINER, REAR WHEEL HOUSE, LH	\$	176.09
1	MOULDING ASSY, BODY ROCKER PANEL, LH	\$	624.54
TOTAL		\$	9,632.41
25%		\$	2,408.10
		\$	7,224.30

Trans-cab Auto Services Pte Ltd**AAD2407-072**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD59655**Special Nett**

1SET DOOR TRIM CLIP	\$	na	70.00	X
1SET DOOR WEATHERSTRIP CLIP	\$	na	65.00	X
1 DOOR STICKER TEL NO.	\$	na	100.00	601
1 REAR BUMPER CLIP	\$	na	65.00	X
1SET CLIP, ROCKER PANEL MOULDING	\$	na	65.00	X
1SET FENDER CLIP	\$	na	130.00	X
1 FENDER LINER CLIP	\$	na	65.00	X
TOTAL	\$		560.00	
TOTAL PARTS	\$		2,300.00	

LABOUR

To Rust-Proofing and apply undercoat Of The Affected Areas.	\$	240.00	301
To remove and refit interior fittings, trimings, garnish, fittings and other, to enable repair.	\$	380.00	601
Panel Beating, Knocking And Straightening The Necessary Portion, Remove And Renewal Of Parts, Adjust And Realign The Same	\$	1,600.00	5001
Putty And Spray Painting Of The Affected Portion.	\$	1,600.00	8801
To transfer of tire, rim and on wheel balancing.	\$	na 170.00	X
To Check Electrical Lighting Concerned.	\$	170.00	201
To check steering geometry and computer wheel alignment	\$	4 220.00	X
To remove and refit of rear fender fittings, attachment and notify perform water seepage test.	\$	4 170.00	X

TOTAL \$ 4,550.00

KKK Auto Services and notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

3 days

Trans-cab Auto Services Pte Ltd

AAD2407-072

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD5965S

Over All Total	\$	<u>14,074.30</u>
----------------	----	------------------

(PART-BY-PART) Repair Days

~~06~~ Days

3 days

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:	Company
Owner ID:	878K

Vehicle Details

Vehicle No.:	SHD5965S
Vehicle to be Exported:	Yes
Intended Deregistration Date:	17 Jul 2024
Vehicle Make:	TOYOTA
Vehicle Model:	PRIUS 5DR HATCHBACK (AUTO)
Primary Colour:	Red
Manufacturing Year:	2018
Engine No.:	2ZR2B63347
Chassis No.:	JTDKB3FU703075517
Maximum Power Output:	90.0 kW (120 bhp)
Open Market Value:	\$26,605.00
Original Registration Date:	01 Nov 2018
First Registration Date:	01 Nov 2018
Transfer Count:	0
Actual ARF Paid:	\$14,247.00

Intended PARF Rebate Details

PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	31 Oct 2026
PARF Rebate Amount:	\$9,972.00

Intended COE Rebate Details

COE Expiry Date:	31 Oct 2026
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	8
PQP Paid:	\$23,736.00
COE Rebate Amount:	\$6,787.00
Total Rebate Amount:	\$16,759.00

Message

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be deregistered once the COE expires, or when it reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 17 Jul 2024

OK