

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: SMH 9299A

at Workshop m/s BORNEO MOTOR

of PANASON C

Insured: ICS

Policy No. MP23A00367800

Claims No. DMPC2401418H/ST

Sum Insured:

Excess:


TBA 0

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

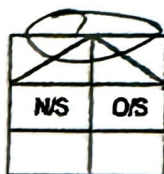

Bal. or Market Value:

84k

IDAC Accident Report:

Consistent?: Yes or No

GLA / PR Seen:

Consistent?: Yes or No

Est. Repairs:

days

Res: Yes or No

Lum Sum:

%

3 Val: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Date / Time

Action / Instruction

REPAIR LIMIT - 54K

Veh No:

SMH 9299A

Yr Regn: 2018 10CL

Type: M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

TOYOTA PRIUS PLUS A

cc 1798

Colour:

BLUE

AC: Insured / Std / NI / NA

Sp. Reading:

167111

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

JTD283E490 J038158

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Locked / Burnt or

Brake: In order / Jammed / Locked / Burnt or

Mod: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

205/60R16

R:

BS / DUN / EXNOVA / GY / FS / LZA / NIC / OHTSU / PIR / SUMI / TOYO / YOKO or

Front

Rear

R/Bal:

6

mm

R/Bal:

6

mm

L/Bal:

6

mm

L/Bal:

6

mm

D.O.A:

21/10/24

D.O.I:

21/10/24

Survey held at

PANONG

Des. of Damages: Frt / Rear / OS / N/S / UIC / Roof/Top or

The UIC / Chassis frame / Body Structure affected due to collision.

Date/Time, File Pass to?



Preli. Report

Days Of Repair: 10

Resurvey No. of Trip:

Survey Fee:

1)

Date/Time, File Return to?



Final Report

Add Fee:



Site Insp (\$

) \$ + \$5



Interview (\$

) \$



Tech. Invs (\$

) \$



Weekend (\$

) \$

Report Format:

Lump Sum / L.B.I. (\$

TOTAL

28/11/24 Rasul confirmed final fig \$30,451.51 (Red 9610.05, 23%)



Borneo Motors



TOYOTA

Inchcape

Co. Reg No. : 196700086Z
GST Reg No. : MR-8500000-9
No. 2 PANDAN CRESCENT
SINGAPORE 128462, Tel no.: 6631 1188

ESTIMATE

Account Details			Account No.		Customer Details		
ECICS Limited 10 Eunus Road 8 #13-06 Singapore 408600			S1000026 / ICECICS		Mr Tan Hock Hai 322A Jurong East Street 31 #04-270 Singapore 601322 Mobile: 96883851		
			Document No. 0				
			Document Date 21/10/2024				
Year	Model	Variant	Reg. Date	Reg. No.	Kilometers	Wip No.	Order No. / Remarks
2018	ZVW40R	AWXEBW S2	18/12/2018	SMH9299A	0	34006	79/OD/SMH9299A
Chassis No.		Engine No.	Terms	SA / Counter	Vehicle In		Collected On
JTDZS3EU90J035158		2ZR0C68145	60	Ong Wen Hong	--/--/----		0.00 --/--/---- 0.00
L	Cd	Job/Parts Description	Qty	Unit Price	Disc %	Amount	
1	Z	BP-SUNDRY SUNDRIES POLICY NO.:MPC23A00367800 ACC DATE:21/10/2024 TOW/DRIVE IN:DRIVE IN EXCESS: DATE-IN:21/10/2024 DATE SURVEY: NO OF REPAIR DAYS: BY: AUTHORIZED ON:				50 100.00	
2	Z	BP-SLANT SUPPLY SEALANT (NETT)				120 180.00	
3	B	BP-LAB2 TO REPLACE AND REPAIR ACCIDENT DAMAGED P ARTS				2304 3486.00	
4	B	BP-RES2 TO RESPRAY ALL ACCIDENT AFFECTED AREAS				2832 3804.00	
5	B	BP-LAB2 TO CHECK WIRING SYSTEM				97.92	
6	B	BP-MECH2 TO REMOVE AND REPLACE A/C CONDENSER & RA DIATOR				288.00	
7	B	BP-ECU2 TO RESET ECU AND REPROGRAMME				144.00	
8	B	BP-WS2 TO REMOVE AND INSTALL FRONT WINDSCREEN				369.60	
9	S	BP-SUBLET TO SUPPLY SOLAR FILM FOR FRONT WINDSCREE N				480.00	
10	S	BP-SUBLET TO SUPPLY FRONT NUMBER PLATE MIS ✓				80.00	
11	1	T11212-37090 COVER, CYLINDER ?	1.00	279.50	30.00	195.65	
12	2	T16400-37290 RADIATOR ASSY ✓	1.00	2979.00	30.00	2085.30	
For & on behalf of Borneo Motors (Singapore) Pte Ltd			Customer's Signature		Charge Summary		Total
			Please acknowledge receipt of vehicle		Parts Labour Sublet Lubrication/Fluid Others		Less Amount Due

Customer Copy



Borneo Motors



TOYOTA

Inchcape

Co. Reg No. : 196700086Z
GST Reg No. : MR-8500000-9
No. 2 PANDAN CRESCENT
SINGAPORE 128462, Tel no.: 6631 1188

ESTIMATE

Account Details	Account No.	Customer Details
ECICS Limited 10 Eunus Road 8 #13-06 Singapore 408600	S1000026 / ICECICS	Mr Tan Hock Hai 322A Jurong East Street 31 #04-270 Singapore 601322 Mobile: 96883851
	Document No. 0	
	Document Date 21/10/2024	

Year	Model	Variant	Reg. Date	Reg. No.	Kilometers	Wip No.	Order No. / Remarks
2018	ZVW40R	AWXEBW S2	18/12/2018	SMH9299A	0	34006	79/OD/SMH9299A
Chassis No.	Engine No.	Terms	SA / Counter	Vehicle In	Collected On		
JTDZS3EU90J035158	2ZR0C68145	60	Ong Wen Hong	--/--/----	0.00	--/--/----	0.00

L	Cd	Job/Parts Description	Qty	Unit Price	Disc %	Amount
13	3	T16361-37020 FAN ?	1.00	390.80	30.00	273.56
14	4	T16361-37010 FAN ?	1.00	303.30	30.00	212.31
15	5	L16711-37040 SHROUD, FAN ?	1.00	411.10	30.00	287.77
16	6	T16712-37051 SHROUD, FAN, NO.2 ?	1.00	167.10	30.00	116.97
17	7	UG9010-47050 RADIATOR ASSY	1.00	1299.50	30.00	909.65
18	8	T17120-37054 MANIFOLD ASSY	1.00	1437.50	30.00	1006.25
19	9	T17750-37070 INLET ASSY, AIR	1.00	335.10	30.00	234.57
20	0	T17700-37252 CLEANER ASSY, AIR	1.00	1582.40	30.00	1107.68
21	1	T17882-37040 HOSE, AIR CLEANER	1.00	82.40	30.00	57.68
22	2	T17894-37010 RESONATOR, INTAKE	1.00	97.30	30.00	68.11
23	3	T17881-37120 HOSE, AIR CLEANER	1.00	82.40	30.00	57.68
24	4	T52119-47969 COVER, FR BUMPER	1.00	855.40	30.00	598.78
25	5	T53395-47030 SEAL, HOOD TO FR END	1.00	141.40	30.00	98.98
26	6	T52115-47030 SUPPORT, FR BUMPER	1.00	104.50	30.00	73.15
27	7	T52116-47030 SUPPORT, FR BUMPER	1.00	104.50	30.00	73.15
28	8	T52821-47020 DUCT, AIR INTAKE, RH	1.00	178.90	30.00	125.23
29	9	T52822-47020 DUCT, AIR INTAKE, LH	1.00	178.90	30.00	125.23
30	0	S52161-0K040 PIECE, RR BUMPER	10.00	5.80	30.00	40.60
31	1	T53102-47180 GRILLE SUB-ASSY	1.00	789.60	30.00	552.72
32	2	T52112-47020 EXTENSION, FR ?	1.00	46.00	30.00	32.20

For & on behalf of Borneo Motors (Singapore) Pte Ltd	Customer's Signature	Charge Summary	Total
	Please acknowledge receipt of vehicle	Parts Labour Sublet Lubrication/Fluid Others	Less Amount Due

Customer Copy



Borneo Motors



TOYOTA

Inchcape

Co. Reg No. : 196700086Z
GST Reg No. : MR-8500000-9
No. 2 PANDAN CRESCENT
SINGAPORE 128462, Tel no.: 6631 1188

ESTIMATE

Account Details		Account No.		Customer Details				
ECICS Limited 10 Eunus Road 8 #13-06 Singapore 408600		S1000026 / ICECICS		Mr Tan Hock Hai				
		Document No. 0		322A Jurong East Street 31 #04-270 Singapore 601322				
		Document Date 21/10/2024		Mobile: 96883851				
Year	Model	Variant	Reg. Date	Reg. No.	Kilometers	Wip No.	Order No. / Remarks	
2018	ZVW40R	AWXEBW S2	18/12/2018	SMH9299A	0	34006	79/OD/SMH9299A	
Chassis No.		Engine No.	Terms	SA / Counter	Vehicle In		Collected On	
JTDZS3EU90J035158		2ZR0C68145	60	Ong Wen Hong	--/--/----		0.00 --/--/---- 0.00	
L	Cd	Job/Parts Description			Qty	Unit Price	Disc %	Amount
33	3	T52113-47020 EXTENSION, FR ?			1.00	47.30	30.00	33.11
34	4	T53113-47060 GRILLE, RADIATOR, <i>con</i>			1.00	207.40	30.00	145.18
35	5	T52611-47100 ABSORBER, FR BUMPER <i>con</i>			1.00	110.20	30.00	77.14
36	6	T52021-47160 REINFORCEMENT ?			1.00	1010.00	30.00	707.00
37	7	T52618-47060 ABSORBER, FR BUMPER, ?			1.00	205.10	30.00	143.57
38	8	T53111-47110 GRILLE, RADIATOR <i>con</i>			1.00	672.20	30.00	470.54
39	9	S52161-0K040 PIECE, RR BUMPER <i>st</i>			8.00	5.80	30.00	32.48
40	0	T53301-47070 HOOD SUB-ASSY <i>st</i>			1.00	1277.10	30.00	893.97
41	1	T53341-47030 INSULATOR, HOOD ?			1.00	570.00	30.00	399.00
42	2	T53801-47100 FENDER SUB-ASSY, FR <i>st</i>			1.00	1400.50	30.00	980.35
43	3	T53866-47030 SEAL, FR FENDER TO <i>st</i>			1.00	34.20	30.00	23.94
44	4	T53825-47020 PROTECTOR, FR ?			1.00	60.80	30.00	42.56
45	5	T53827-47040 PROTECTOR, FR FENDER ?			1.00	156.70	30.00	109.69
46	6	T53875-47061 LINER, FR FENDER, RH <i>st</i>			1.00	262.80	30.00	183.96
47	7	T53510-47121 LOCK ASSY, HOOD <i>st</i>			1.00	187.20	30.00	131.04
48	8	T53410-47160 HINGE ASSY, HOOD, RH <i>st</i>			1.00	81.80	30.00	57.26
49	9	T53420-47160 HINGE ASSY, HOOD, LH <i>st</i>			1.00	81.80	30.00	57.26
50	0	T53201-47050 SUPPORT SUB-ASSY, <i>st</i>			1.00	2033.60	30.00	1423.52
51	1	T53293-47050 DEFLECTOR, RADIATOR ?			1.00	120.00	30.00	84.00
52	2	T53294-47040 DEFLECTOR, RADIATOR ?			1.00	110.80	30.00	77.56
For & on behalf of Borneo Motors (Singapore) Pte Ltd		Customer's Signature		Charge Summary		Total		
		Please acknowledge receipt of vehicle		Parts Labour Sublet Lubrication/Fluid Others		Less Amount Due		

Customer Copy



Borneo Motors

Inchcape

Co. Reg No. : 196700086Z
GST Reg No. : MR-8500000-9
No. 2 PANDAN CRESCENT
SINGAPORE 128462, Tel no.: 6631 1188



TOYOTA

ESTIMATE

Account Details	Account No.	Customer Details
ECICS Limited 10 Eunos Road 8 #13-06 Singapore 408600	S1000026 / ICECICS	Mr Tan Hock Hai 322A Jurong East Street 31 #04-270 Singapore 601322 Mobile: 96883851
	Document No. 0	
	Document Date 21/10/2024	

Year	Model	Variant	Reg. Date	Reg. No.	Kilometers	Wip No.	Order No. / Remarks
2018	ZVW40R	AWXEBW S2	18/12/2018	SMH9299A	0	34006	79/OD/SMH9299A

Chassis No.	Engine No.	Terms	SA / Counter	Vehicle In	Collected On
JTDZS3EU90J035158	2ZR0C68145	60	Ong Wen Hong	--/--/----	0.00 --/--/---- 0.00

L	Cd	Job/Parts Description	Qty	Unit Price	Disc %	Amount
53	3	T53289-47041 COVER, RADIATOR <i>de</i>	1.00	190.30	30.00	133.21
54	4	T56101-4F914 GLASS SUB-ASSY, <i>cm</i>	1.00	2237.60	30.00	1566.32
55	5	T75533-47060 MOULDING, <i>m</i>	1.00	84.10	30.00	58.87
56	6	L56117-50140 DAM, WINDOW GLASS <i>m</i>	1.00	40.10	30.00	28.07
57	7	L56115-30100 STOPPER, WINDSHIELD <i>m</i>	1.00	6.40	30.00	4.48
58	8	T56116-22050 STOPPER, WINDSHIELD <i>m</i>	1.00	6.20	30.00	4.34
59	9	T55708-47150 LOUVER SUB-ASSY, <i>?</i>	1.00	916.70	30.00	641.69
60	0	T55820-47010 VENTILATOR ASSY, <i>?</i>	1.00	59.10	30.00	41.37
61	1	T75310-33050 EMBLEM ASSY, <i>m m13</i>	1.00	146.80	30.00	102.76
62	2	T81140-47660 UNIT ASSY, HEADLAMP, <i>cm</i>	1.00	3890.00	30.00	2723.00
63	3	T81070-47660 UNIT ASSY, HEADLAMP, <i>cm</i>	1.00	3890.00	30.00	2723.00
64	4	T52125-47010 EXTENSION, FR BUMPER <i>?</i>	1.00	105.50	30.00	73.85
65	5	T52126-47010 EXTENSION, FR BUMPER <i>?</i>	1.00	105.50	30.00	73.85
66	6	T81210-47010 LAMP ASSY, FOG, RH <i>X</i>	1.00	473.20	30.00	331.24
67	7	T81220-47010 LAMP ASSY, FOG, LH <i>X</i>	1.00	449.90	30.00	314.93
68	8	T81430-47050 LAMP ASSY, DAYTIME <i>X</i>	1.00	895.00	30.00	626.50
69	9	TG9200-29015 INVERTER ASSY, <i>?</i>	1.00	5976.10	30.00	4183.27
70	0	TG9110-47030 BRACKET ASSY, <i>?</i>	1.00	422.60	30.00	295.82
71	1	T85315-47221 JAR, WASHER, A <i>X</i>	1.00	303.30	30.00	212.31
72	2	T85319-47220 PIPE, WASHER, A <i>X</i>	1.00	92.90	30.00	65.03

For & on behalf of Borneo Motors (Singapore) Pte Ltd	Customer's Signature	Charge Summary	Total
	Please acknowledge receipt of vehicle	Parts Labour Sublet Lubrication/Fluid Others	Less Amount Due

Customer Copy



Inchcape

Co. Reg No. : 196700086Z
GST Reg No. : MR-8500000-9
No. 2 PANDAN CRESCENT
SINGAPORE 128462, Tel no.: 6631 1188

ESTIMATE

Account Details	Account No.	Customer Details
ECICS Limited 10 Eunus Road 8 #13-06 Singapore 408600	S1000026 / ICECICS	Mr Tan Hock Hai 322A Jurong East Street 31 #04-270 Singapore 601322 Mobile: 96883851
	Document No. 0	
	Document Date 21/10/2024	

Year	Model	Variant	Reg. Date	Reg. No.	Kilometers	Wip No.	Order No. / Remarks
2018	ZVW40R	AWXEBW S2	18/12/2018	SMH9299A	0	34006	79/OD/SMH9299A
Chassis No.	Engine No.	Terms	SA / Counter	Vehicle In	Collected On		
JTDZS3EU90J035158	2ZR0C68145	60	Ong Wen Hong	--/--/----	0.00	--/--/----	0.00

L	Cd	Job/Parts Description	Qty	Unit Price	Disc %	Amount
73	3	T86510-48070 HORN ASSY, HIGH	1.00	186.60	30.00	130.62
74	4	T88460-47170 CONDENSER ASSY	1.00	2170.80	30.00	1519.56
75	5	T21000-20 SIKA 182010 SIKA TACK GO! (BLA	2.00	108.00	30.00	151.20
76	6	T21000-22 SIKA 207. G+P ADHESIVE PRIMER	1.00	200.00	30.00	140.00
77	7	S08889-80102 COOLANT,SLLC&&	2.00	108.00		216.00

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed.
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Handwritten notes:
Pasul
Approved
10 days
EXCESS: TRA
Repair
Reg 54 part
21/10/24

For & on behalf of	Date:	Customer's Signature	Charge Summary	Total	39,267.16
Borneo Motors (Singapore) Pte Ltd				GST 9.00%	3,534.04
		Please acknowledge receipt of vehicle	Parts 30,767.64		
			Labour 7,939.52		
			Sublet 560.00		
			Lubrication/Fluid 0.00	Less	0.00
			Others 0.00	Amount Due	42,801.20

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	299B
Vehicle Details	
Vehicle No.:	SMH9299A
Vehicle to be Exported:	No
Intended Deregistration Date:	22 Oct 2024
Vehicle Make:	TOYOTA
Vehicle Model:	PRIUS PLUS (AUTO)
Primary Colour:	Black
Manufacturing Year:	2018
Engine No.:	2ZROC68145
Chassis No.:	JTDZS3EU90J035158
Maximum Power Output:	100.0 kW (134 bhp)
Open Market Value:	\$30,006.00
Original Registration Date:	18 Dec 2018
First Registration Date:	18 Dec 2018
Transfer Count:	0
Actual ARF Paid:	\$24,009.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	17 Dec 2028
PARF Rebate Amount:	\$16,806.00
Intended COE Rebate Details	
COE Expiry Date:	17 Dec 2028
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$31,302.00
COE Rebate Amount:	\$12,994.00
Total Rebate Amount:	\$29,800.00
Message	
You will not be eligible for any COE rebate from the current COE (including unused COE from any lay-up period/s), if you renew your COE.	

The information contained herein is correct as at 22 Oct 2024

OK



Toyota Prius Plus Hybrid 1.8A



\$84,800 Instalment \$1,334/mth

PREMIUM AD

Shortlist

Get Warranty

Loan Calculator



Overview Financial Leasing Photo Research

Depreciation

\$17,400 / year

Reg. Date

28-Dec-2018
(4yrs 2mths 5days COE left)

Manufactured

2018

Mileage

74,600 km (12.8k / year)

Transmission

Auto

Engine Cap

1,798 cc

Road Tax

\$976 / year

Power

100.0 kW (134 bhp)

Curb Weight

1,500 kg

Fuel Type

Petrol-Electric

COE

\$31,001

OMV

\$30,006

ARF

\$24,009

Dereg Value

\$29,776 as of today

No. of Owners

1