

REF:

CS/CTI 24110193/Avh3

## ASSIGNMENT

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estn: \_\_\_\_\_

OD / TP RES / OD RES / EVA / INV / MV

To In \_\_\_\_\_ Vehicle No: \_\_\_\_\_

at W/O \_\_\_\_\_

of \_\_\_\_\_

Insured: \_\_\_\_\_

Policy No: \_\_\_\_\_

Claims No: \_\_\_\_\_

Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_

(Client's Record)

Make of Vch: \_\_\_\_\_

(Policy Condition)

N/S	O/S

Remark: The veh had commenced its  
repair at the time of inspection.

Bal. or Market Value: \_\_\_\_\_

IDAC Accident Report: \_\_\_\_\_ Consistent? : Yes or No

GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No

Est. Repairs: \_\_\_\_\_ days Res.: Yes or No

Lum Sum: \_\_\_\_\_ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_

Vehicle: IN / OUT

Veh No: SNK8879E Yr Regn: 2023, MayType: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Honda Shuttle Hybrid C.O. 1496Colour: Blue A/C: Insured / Std / NI / NASp. Reading: 71295 T/Radio: Insured / Std / NI / NA

Eng/No: \_\_\_\_\_

C/No: GP72206885Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modif: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 195/65R15R: 195/65R15

BS / DUN / EXNOVA / GY / FS / LIZA / MIG / OHTSU / PIR / SUMI /

TOYO / YOKO or Rydan

Front \_\_\_\_\_ Rear \_\_\_\_\_

R/Bal. 06 mm R/Bal. 06 mmL/Bal. 06 mm L/Bal. 06 mmD.O.A. 9/11/24 D.O.I. 12/11/24Survey held at BitcostDes. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time \_\_\_\_\_ Action / Instruction

TP ChurnCOE ExpiryEstimate given during: Yes ✓1st Survey: No CMV: 160KPV: 103.3KNett: 56.7K

Date/Time, File Pass to?

☐

Prel. Report

1)

Date/Time, File Return to?

☐

Final Report

2)

Days Of Repair: \_\_\_\_\_

Resurvey No. of Trip: \_\_\_\_\_

Add Fee:

☐

Site Insp (\$

☐

Interview (\$

☐

Tech. Invo (\$

Survey Fee:

Transportation:

B + RS: \$1

Photos

Others

Report Form:

Report Form:



## SINGAPORE ACCIDENT STATEMENT

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

### ACCIDENT STATEMENT

Date of First Submission	11/11/2024 09:09 (SGT)
Reported by	Actual Driver
Date of Accident	09/11/2024 11:36 (SGT)
Exact Location of Accident	Singapore
Additional Location Information	ALONG WOODLANDS AVENUE 6
Country/State of Loss	Singapore

### DETAILS OF OWN VEHICLE

Vehicle Registration Number	SNK8879E
INSURED/POLICYHOLDER	
Is company?	Yes
Name Of Registered Owner	STARK HOLDINGS INN BIKE LEASING PTE. LTD.
Company Reg No	2XXXXXX069W
Email Address	STARKHOLDINGSINN@GMAIL.COM
Mobile Phone No	(Phone) +65-90914676
Alternative Phone No	-

### VEHICLE PARTICULARS

Manufacturer	Honda
Model	Shuttle
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Private hire
Transmission	Auto
CC	0
Vehicle Fuel	Petrol-Electric
First Registration Date	22/05/2023
Chassis no	GP72206885
Effective Date/Time of Ownership	22/05/2023 00:00 (SGT)

### INSURANCE COMPANY

Name of Insurance Company	Income Insurance Limited
Policy Number / Cover Note Number	5133793562-01

### DRIVER



Name of Driver .....	MOHAMED ALI KHAN BIN ABDUL RASHID KHAN
NRIC No .....	SXXXX752F
Date Of Birth .....	28/01/1972
Occupation .....	Indoor
Driving Pass Date .....	26/11/2001
Driving License Pass Class .....	3
Driving License Validity .....	Valid
Driving experience .....	23 YEARS
Gender .....	Male
Mobile Number .....	(Phone) +65-90914676
Alt. Phone Number .....	-
Email Address .....	STARKHOLDINGSINN@GMAIL.COM
Address .....	774 WOODLANDS CRESCENT #02-24
Address complement .....	-
Postcode .....	730774
Is the driver the policyholder? .....	No
If No, Relationship of the Driver with the Insured .....	Hirer
Does Driver Own Other Vehicles? .....	No
Vehicle Registration Number of Other Vehicle Owned by Driver .....	-
Insurance Company of Other Vehicle Owned by Driver .....	-

#### GENERAL INFORMATION OF THE ACCIDENT

Type of Accident .....	Collision - Head to Rear
Weather Conditions .....	Clear
Road Surface .....	Dry

#### OTHER INFORMATION

Was any foreign vehicle involved in the accident? .....	No
Number of vehicles involved in the accident .....	2
Was anybody injured in the Accident? .....	No
Was any injured conveyed to hospital by ambulance? .....	-
Was any other vehicle or property damaged? .....	Yes
Number of Passengers (Including Driver) .....	1
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance? .....	No
Translator's name .....	-
Translator's ID .....	-
Translator's phone number .....	-
Translator's email .....	-
Original language used in the statement .....	-

#### DETAILS OF POLICE ACTION

Was the accident reported to the police? .....	No
Was notice of intended Prosecution given? .....	No
If yes, against whom? .....	-

#### CIRCUMSTANCES OF ACCIDENT

#### REFER TO ATTACHED

#### ATTACHMENT(S)

Are accident photos available for attachment? .....	Yes
Was there any video captured by Car Camera? .....	No

#### DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number .....	GBB2375X
Vehicle Manufacturer .....	-

Vehicle Model .....	-
Vehicle Variant .....	-
Vehicle Colour .....	-
Vehicle Category .....	Commercial vehicle
Name of Driver .....	-
Contact Number .....	-
Address .....	-
Address complement .....	-
Postcode .....	-
Insurance Company Name .....	-
Nature Of Damage .....	-
Details of property damaged in accident .....	-
No. Of Passenger (Including Driver) .....	-

**SKETCH PLAN**

**IMPORTANT NOTICE**

- 1 Please report correctly the details of the accident to speed up the claims process
- 2 This Form must be completed by the Policyholder and/or the Actual Driver
- 3 Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability
- 4 The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies
5. **Any false reporting may be referred to the Traffic Police Department for investigation.**
- 6 This report will be forwarded by the insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties
- 7 By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid
- 8 **Consent under the Personal Data Protection Act (PDPA)**  
I understand, acknowledge, agree and consent that:  
(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "insurers"), the insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of  
(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;  
(ii) investigating the accident and/or my claims;  
(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;  
(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or  
(v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")  
(b) all insurer(s) who have insured vehicle(s) involved in this accident and the insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and  
(c) my Personal Information may/can be disclosed by any of the insurers and/or GIA to their third-party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes




LENG

Policyholder's Signature / Date & Time

Actual Driver's Signature (if driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel (Name as in NRIC/ID card)

Sketch Plan

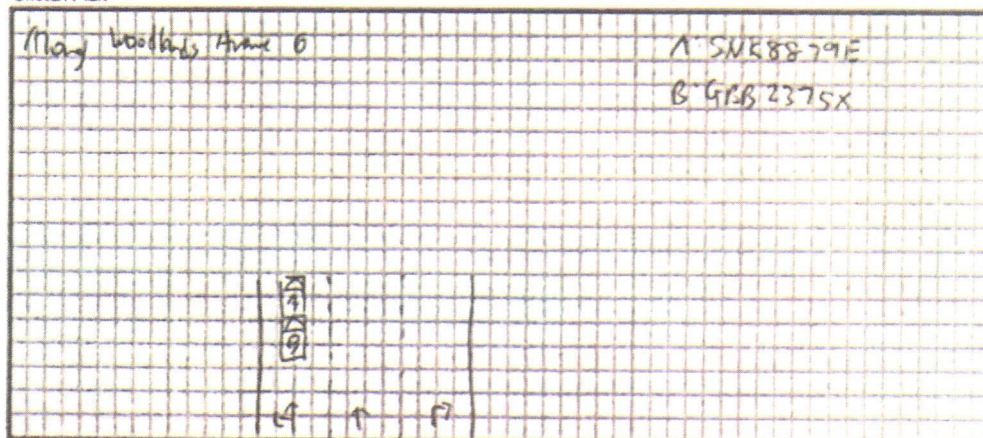

v Jun 2022



Describe Circumstance of the Accident

On the stated time and date, I was driving  
 Vehicle A, SNE6879E and stationary at the traffic  
 light junction when suddenly vehicle B, GAB2275X  
 collided me from the rear

Declaration

We declare the foregoing particulars are true in every respect.

LENG

Policyholder's Signature / Date & Time

Actual Driver's Signature (if driver is not the policyholder)  
 / Date & Time

Witnessed by Reporting Centre Personnel  
 (Name as in NRIC/ID card)

## Bifrost Auto Pte Ltd

8 Kaki Bukit Ave 4 #01-49, Premier @ Kaki Bukit Singapore 415875

Tel: 93290237 Email: claims\_rar@bifrostauto.com

SJE : \_\_\_\_\_  
 Date of Survey : \_\_\_\_\_  
 Date of ReSurvey: \_\_\_\_\_  
 Contacts : \_\_\_\_\_

Vehicle Nos : **SNK 8879E**  
 Made : Honda  
 Model : Shuttle Hybrid 1.5 Auto  
 Chassis No : GP72206885

### \* AGREED Cost Of Repair and Repair Day/s with SJE \*

Amount: \_\_\_\_\_

Working Day: \_\_\_\_\_

Nos.	PARTS	Qty	Unit S\$	TOTAL S\$	
1	Rear Bumper <i>Replaced</i>	1	\$ 1,150.60	\$ <i>1050</i> 1,150.60	<i>1050</i>
2	Rear Bumper Side Retainer RH <i>3pc</i>	1	\$ 38.50	\$ 38.50	<i>+</i>
3	Rear Bumper Side Retainer LH <i>3pc</i>	1	\$ 38.50	\$ 38.50	<i>+</i>
4	Rear Bumper Reflector RH <i>3pc</i>	1	\$ 78.50	\$ 78.50	<i>+</i>
5	Rear Bumper Reflector LH <i>3pc</i>	1	\$ 78.50	\$ 78.50	<i>+</i>
6	Rear Bumper Side Sponge RH <i>new</i>	1	\$ 98.50	\$ 98.50	<i>+</i>
7	Rear Bumper Side Sponge LH <i>could</i>	1	\$ 98.50	\$ 98.50	<i>+</i>
8	Rear Bumper Bracket RH <i>new</i>	1	\$ 38.70	\$ 38.70	<i>+</i>
9	Rear Bumper Bracket LH <i>new</i>	1	\$ 38.70	\$ 38.70	<i>+</i>
10	Rear Bumper Tow Cover <i>new</i>	1	\$ 32.50	\$ 32.50	<i>+</i>
11	Rear Tailgate <i>Replaced</i>	1	\$ 1,243.10	\$ <del>1,243.10</del>	<i>1243</i>
12	Rear Tailgate Lock <i>new</i>	1	\$ 207.10	\$ 207.10	<i>+</i>
13	Rear Tailgate Windscreen Glass <i>new</i>	1	\$ 1,230.10	\$ 1,230.10	<i>+</i>
14	Rear Tailgate Windscreen Glass Top Moulding <i>3pc</i>	1	\$ 67.80	\$ 67.80	<i>+</i>
15	Rear Tailgate Windscreen Glass Bottom Moulding <i>3pc</i>	1	\$ 89.40	\$ 89.40	<i>+</i>
16	Rear Tailgate Windscreen Glass Side Moulding <i>2</i>	2	\$ 62.50	\$ 125.00	<i>+</i>
17	Third Brake Lamp <i>new</i>	1	\$ 256.00	\$ 256.00	<i>+</i>
18	Rear Tailgate Reflector Lamp RH <i>3pc</i>	1	\$ 389.30	\$ 389.30	<i>+</i>
19	Rear Tailgate Reflector Lamp LH <i>3pc</i>	1	\$ 389.30	\$ 389.30	<i>+</i>
20	Rear Tailgate Outer Garnish w Chrome <i>3pc</i>	1	\$ 456.60	\$ 456.60	<i>+</i>
21	Rear Tailgate Inner Trim Board <i>3pc</i>	1	\$ 396.00	\$ 396.00	<i>+</i>
22	Rear Tailgate Inner Side Trim RH <i>3pc</i>	1	\$ 128.20	\$ 128.20	<i>+</i>
23	Rear Tailgate Inner Side Trim LH <i>3pc</i>	1	\$ 128.20	\$ 128.20	<i>+</i>
24	Rear Tailgate Inner Upper Trim <i>3pc</i>	1	\$ 108.70	\$ 108.70	<i>+</i>
25	Rear Tailgate Weatherstrip <i>lit</i>	1	\$ 196.80	\$ 196.80	<i>+</i>
26	Rear Tailgate Emblem <i>new</i>	1	\$ 49.80	\$ 49.80	<i>+</i>
27	Rear Tailgate "Shuttle" Emblem <i>3pc</i>	1	\$ 69.90	\$ 69.90	<i>+</i>
28	Rear Tailgate "Hybrid" Emblem <i>3pc</i>	1	\$ 70.40	\$ 70.40	<i>+</i>
29	Rear Tailgate Inner Handle <i>3pc</i>	1	\$ 89.30	\$ 89.30	<i>+</i>
30	Rear Tailgate Wiper Motor <i>3pc</i>	1	\$ 320.60	\$ 320.60	<i>+</i>
31	Rear Tailgate Wiper Arm <i>3pc</i>	1	\$ 78.60	\$ 78.60	<i>+</i>



32	Rear Tailgate Wiper	1	\$	34.60	\$	34.60	+
33	Rear Taillamp Assembly RH	1	\$	570.50	\$	570.50	+
34	Rear Taillamp Assembly LH	1	\$	570.50	\$	570.50	+
35	Rear Taillamp Panel RH	1	\$	377.80	\$	377.80	+
36	Rear Taillamp Panel LH	1	\$	377.80	\$	377.80	+
37	Rear End Panel Antenna	1	\$	169.00	\$	169.00	+
38	Rear End Panel Buzzer	1	\$	152.50	\$	152.50	+
39	Rear End Panel <i>Dented</i>	1	\$	580.80	\$	580.80	+
40	Rear Side End Panel RH <i>Regr</i>	1	\$	416.00	\$	416.00	+
41	Rear Side End Panel LH <i>Regr</i>	1	\$	416.00	\$	416.00	+
42	Rear End Panel Top Garnish <i>crackd</i>	1	\$	176.80	\$	176.80	+
43	Rear Floor Panel <i>Regr</i>	1	\$	1,056.80	\$	1,056.80	+
44	Rear Floor Panel Top Board <i>Regr</i>	1	\$	395.00	\$	395.00	+
45	Rear Compartment Box <i>crackd</i>	1	\$	482.00	\$	482.00	+
46	Rear Compartment Box Lid Assembly	1	\$	504.00	\$	504.00	+
47	Rear Compartment Box Lid Cover	1	\$	126.50	\$	126.50	+
48	Rear Compartment Inner Floor Board Cover	1	\$	952.30	\$	952.30	+
49	Rear Floor Under Cover LH	1	\$	186.00	\$	186.00	+
50	Rear Exhaust Pipe	1	\$	614.70	\$	614.70	+
51	Rear Exhaust Pipe Heat Shield	1	\$	89.80	\$	89.80	+
52	Rear Exhaust Pipe Mounting	2	\$	28.60	\$	57.20	+
53	Rear Fender LH	1	\$	1,136.00	\$	1,136.00	+
54	Rear Fender Inner Trim Board LH <i>crackd</i>	1	\$	499.60	\$	499.60	+
55	Rear Fender Inner Shield LH <i>Regr</i>	1	\$	67.70	\$	67.70	+
Parts Sub Total :					\$	17,791.60	
20% Discount					\$	3,558.32	
<b>PARTS TOTAL :</b>					<b>\$</b>	<b>14,233.28</b>	

Nos.	SPECIAL NETT	Qty	Unit S\$	TOTAL S\$
1	Rear Number Plate <i>Regr</i>	1	\$ 50.00	\$ 50.00 <i>+</i>
2	Rear Bumper Clips - Set <i>Regr</i>	1	\$ 50.00	\$ 50.00 <i>30</i>
3	Rear Taillamp Assembly Clips - Set <i>Regr</i>	1	\$ 50.00	\$ 50.00 <i>+</i>
4	Rear Tailgate Reflector Lamp Clips - Set <i>Regr</i>	1	\$ 50.00	\$ 50.00 <i>+</i>
5	Rear Tailgate Inner Trim Clips - Set <i>Regr</i>	1	\$ 40.00	\$ 40.00 <i>30</i>
6	Rear Tailgate Outer Garnish Clips - Set <i>Regr</i>	1	\$ 40.00	\$ 40.00 <i>+</i>
7	Rear End Panel Top Garnish Clips - Set <i>Regr</i>	1	\$ 50.00	\$ 50.00 <i>20</i>
8	Rear Fender Inner Trim Board Clips - Set <i>Regr</i>	1	\$ 80.00	\$ 80.00 <i>30</i>
9	Rear Fender Inner Shield Clips - Set <i>Regr</i>	1	\$ 60.00	\$ 60.00 <i>+</i>
10	Rear Tailgate Windscreen Glass Sealant <i>Regr</i>	1	\$ 120.00	\$ 120.00 <i>60</i>
11	Rear Fender Glass Sealant LH <i>Regr</i>	1	\$ 120.00	\$ 120.00 <i>+</i>
12	Rear Tailgate Sealant <i>Regr</i>	1	\$ 150.00	\$ 150.00 <i>+</i>
13	Rear End Panel Sealant <i>Regr</i>	1	\$ 150.00	\$ 150.00 <i>60</i>
14	Rear End Panel Side RH Sealant <i>Regr</i>	1	\$ 150.00	\$ 150.00 <i>+</i>



15	Rear End Panel Side LH Sealant	1	\$	150.00	\$	150.00	f
16	Rear Floor Panel Sealant	1	\$	150.00	\$	150.00	f
17	Rear Fender LH Sealant	1	\$	150.00	\$	150.00	f
18	Rear Tailgate Windscreen Glass Solar Film	1	\$	450.00	\$	450.00	f
19	Rear Bumper Reverse Sensor - Set	1	\$	250.00	\$	250.00	2w
20	Rear Tailgate Reverse Camera	1	\$	500.00	\$	500.00	f
<b>SPECIAL NETT TOTAL :</b>						<b>\$ 2,810.00</b>	

Nos.	LABOUR	S\$ TOTAL	
1	To Panel Beat, Remove & Refix Parts	\$ 2,400.00	2w
2	To Spray Paint Affected Areas	\$ 1,800.00	2w
3	Wiring & Bulb Check	\$ 100.00	30
4	To Transfer Rear Tailgate Mechanism	\$ 150.00	60
5	To Remove & Refix Rear Tailgate Windscreen Glass	\$ 150.00	120
6	To Remove & Refix Rear Fender LH Glass	\$ 150.00	+
7	To Remove & Refix Rear Bumper Reverse Sensor	\$ 120.00	50
8	To Remove & Refix Rear Tailgate Reverse Camera	\$ 150.00	50
9	To Remove & Refix Rear Exhaust Pipe	\$ 120.00	+
10	To Remove & Refix Interior Upholstry to facilitate repairs	\$ 150.00	60
11	To Remove & Refix Fuel Tank to facilitate repairs	\$ 200.00	+
12	To apply anti rust on affected parts	\$ 100.00	60
13	To Conduct Water Leak Test	\$ 100.00	+
14	To Send for Diagnostic and Reset Control Unit. Programming & Calibration	\$ 480.00	+
<b>LABOUR TOTAL :</b>		<b>\$ 6,170.00</b>	

PARTS TOTAL : \$ 14,233.28

SPECIAL NETT TOTAL : \$ 2,810.00

LABOUR TOTAL : \$ 6,170.00

**GRAND TOTAL : \$ 23,213.28**

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer  
Signature:  
Date:

Adrian Ling  
A/S 12/11/24  
06 Days